

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

DISTRICT I
1625 N French Dr, Hobbs, NM 88240

HOBBS OCD

1220 South St. Francis Dr.
Santa Fe, NM 87505

DISTRICT II
1301 W Grand Ave, Artesia, NM 88210

AUG 13 2012

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals)		WELL API NO 30-025-28951
1 Type of Well Oil Well ☒ Gas Well ☐ Other ☐		5 Indicate Type of Lease STATE ☒ FEE ☐
2 Name of Operator Occidental Permian Ltd.		6 State Oil & Gas Lease No
3 Address of Operator HCR 1 Box 90 Denver City, TX 79323		7 Lease Name or Unit Agreement Name North Hobbs (G/SA) Unit Section 33
4 Well Location Unit Letter <u>G</u> <u>2525</u> Feet From The <u>North</u> <u>1453</u> Feet From The <u>East</u> Line Section <u>33</u> Township <u>18-S</u> Range <u>38-E</u> NMPM <u>Lea</u> County <u></u>		8 Well No <u>323</u>
11 Elevation (Show whether DF, RKB, RT GR, etc) 3642' KB		9 OGRID No <u>157984</u>
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____		10. Pool name or Wildcat <u>Hobbs (G/SA)</u>

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG & ABANDONMENT ☐
PULL OR ALTER CASING ☐	Multiple Completion ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: _____	☐	OTHER: _____	☐

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU & RU.
2. RU wireline & shoot drain holes @3863'. RD wireline.
3. ND wellhead/NU BOP.
4. POOH w/ESP equipment.
5. RIH w/bit. Tag @4316'. No fill. POOH w/bit.
6. RU wireline & log well from 4200-3200'. Perforate casing @4139-54', 4114-26', 4094-4101', 4068-83', 4053-60', 4013-25'. RD wireline.
7. RIH w/treating packer. RU HES and acid treat new perms w/2700 gal of 15% PAD acid. Flush w/50 bbl fresh water. RD HES
8. RIH w/ESP equipment set on 128 jts of 2-7/8" tubing. Intake set @3883'.
9. ND BOP/NU wellhead.
10. RDPU & RU. Clean location and return well to production.

RUPU 04/13/2012
RDPU 04/20/2012

I hereby certify that the information above is true and complete to the best of my knowledge and belief I further certify that any pit or below-grade tank has been/will be constructed or

closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A Johnson TITLE Administrative Associate DATE 08/10/2012

TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy_johnson@oxy.com TELEPHONE NO 806-592-6280

For State Use Only


APPROVED BY [Signature] TITLE DIST. MGR DATE 8/14/2012

CONDITIONS OF APPROVAL IF ANY _____

AUG 14 2012

July 11, 2012

Work Plan Report for Well:NHSAU 323-33

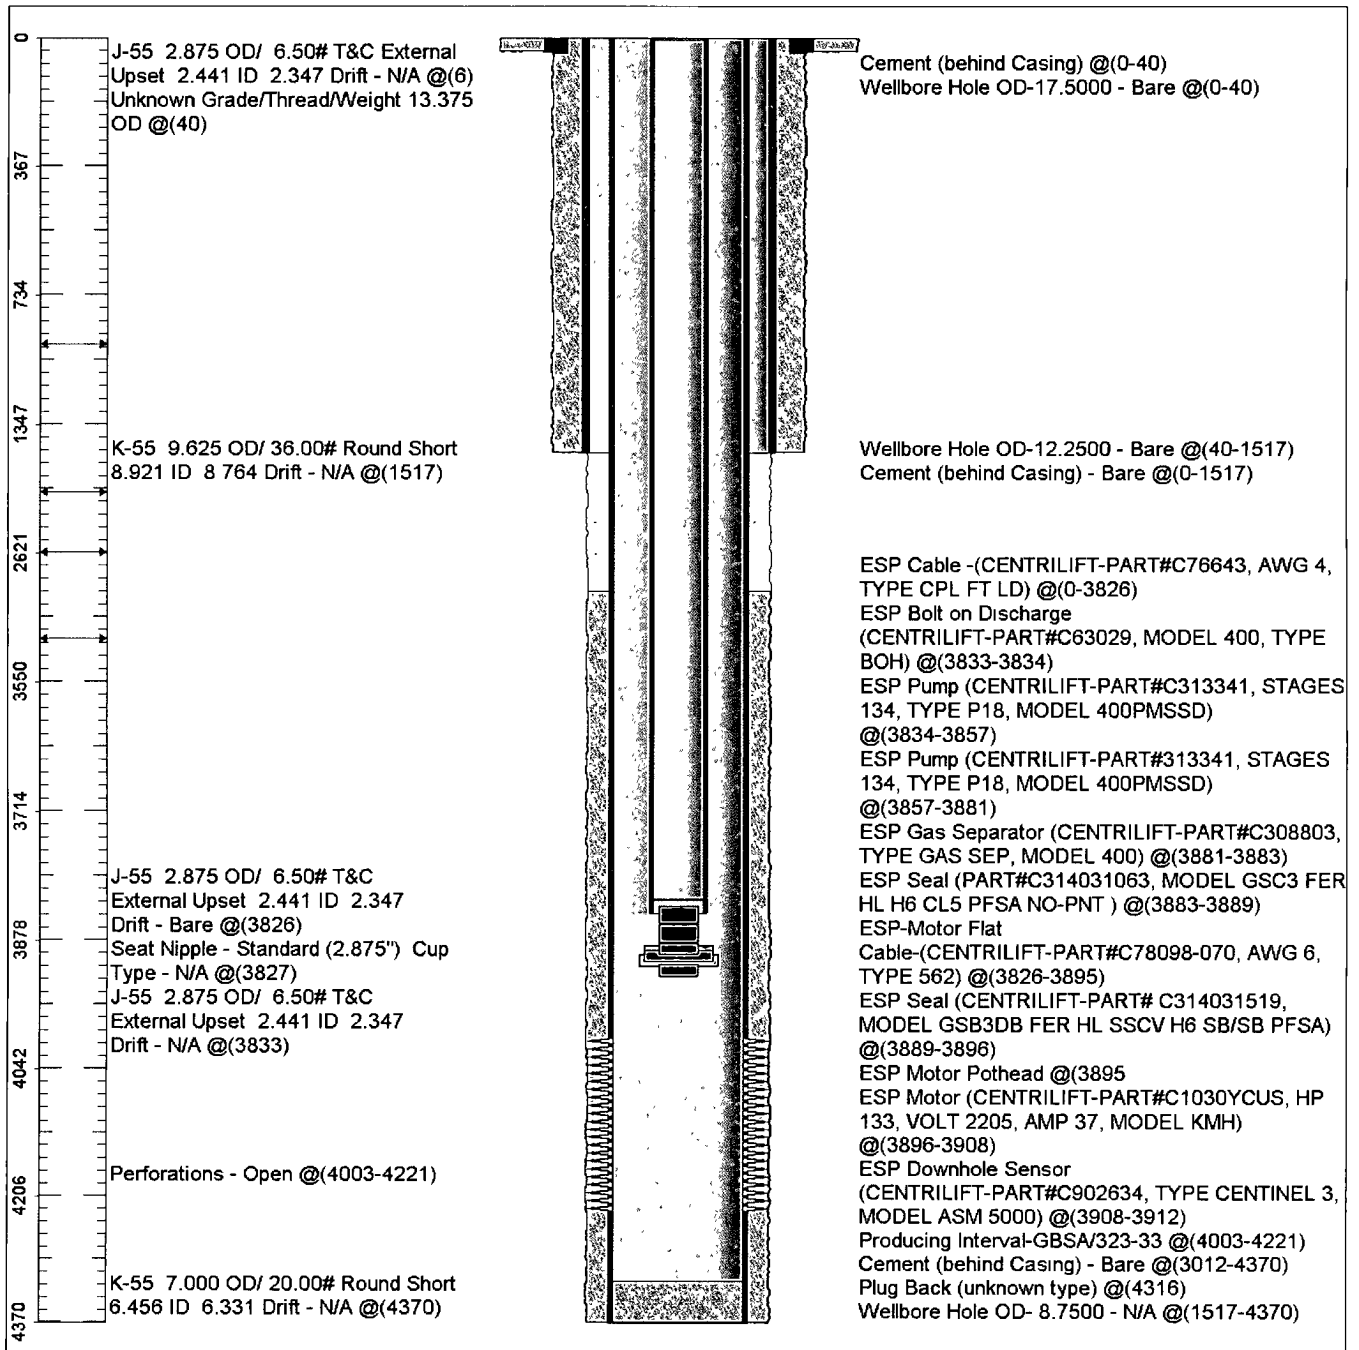

Survey Viewer