

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Hobbs
HOBBS OCD

FORM APPROVED
OMB NO. 1004-0137
Expires July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter a
abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.

LC-069420- NM 104049

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No

8. Well Name and No

West Corbin 16

Federal

9. API Well No.

30-025-30683

10. Field and Pool, or Exploratory Area
Corbin; Bone Spring, South

11. County or Parish, State

Lea NM

SUBMIT IN TRIPLICATE - Other instructions on page 2

RECEIVED

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other Water Injection SWD

2. Name of Operator

EOG Resources Inc.

3a. Address

P.O. Box 2267 Midland, Texas 79702

3b. Phone No. (include area code)

432-686-3689

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

800' FSL & 1980' FEL
Sec 7, T18S, R33E

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☐ Acidize

☐ Alter Casing

☐ Casing Repair

☐ Change Plans

☐ Convert to Injection

☐ Deepen

☐ Fracture Treat

☐ New Construction

☐ Plug and Abandon

☐ Plug Back

☐ Production (Start/Resume)

☐ Reclamation

☐ Recomplete

☐ Temporarily Abandon

☐ Water Disposal

☐ Water Shut-Off

☐ Well Integrity

☒ Other

Repair tubing

leak

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

8/09/12 MIRU to repair tubing leak. RIH and unset packer. POOH w/ 43 jts 2-7/8" IPC tubing.
Found hole in tubing.

8/10/12 POOH w/ remainder of 2-7/8" IPC tubing and packer. Laydown packer.
Send packer in for redress.

8/14/12 RIH w/ 2-7/8" IPC tubing and packer set at 8592'. All tubing and packer tested good.
Perform BLM witnessed MIT test.
MIT test to 550 psi for 30 minutes. Test good. Chart attached.
Returned to injection.

ACCEPTED FOR RECORD

OCT 14 2012

BUREAU OF LAND MANAGEMENT
CARLSBAD FIELD OFFICE

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Stan Wagner

Title Regulatory Analyst

Signature

Date 9/13/2012

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title


Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

OCT 25 2012

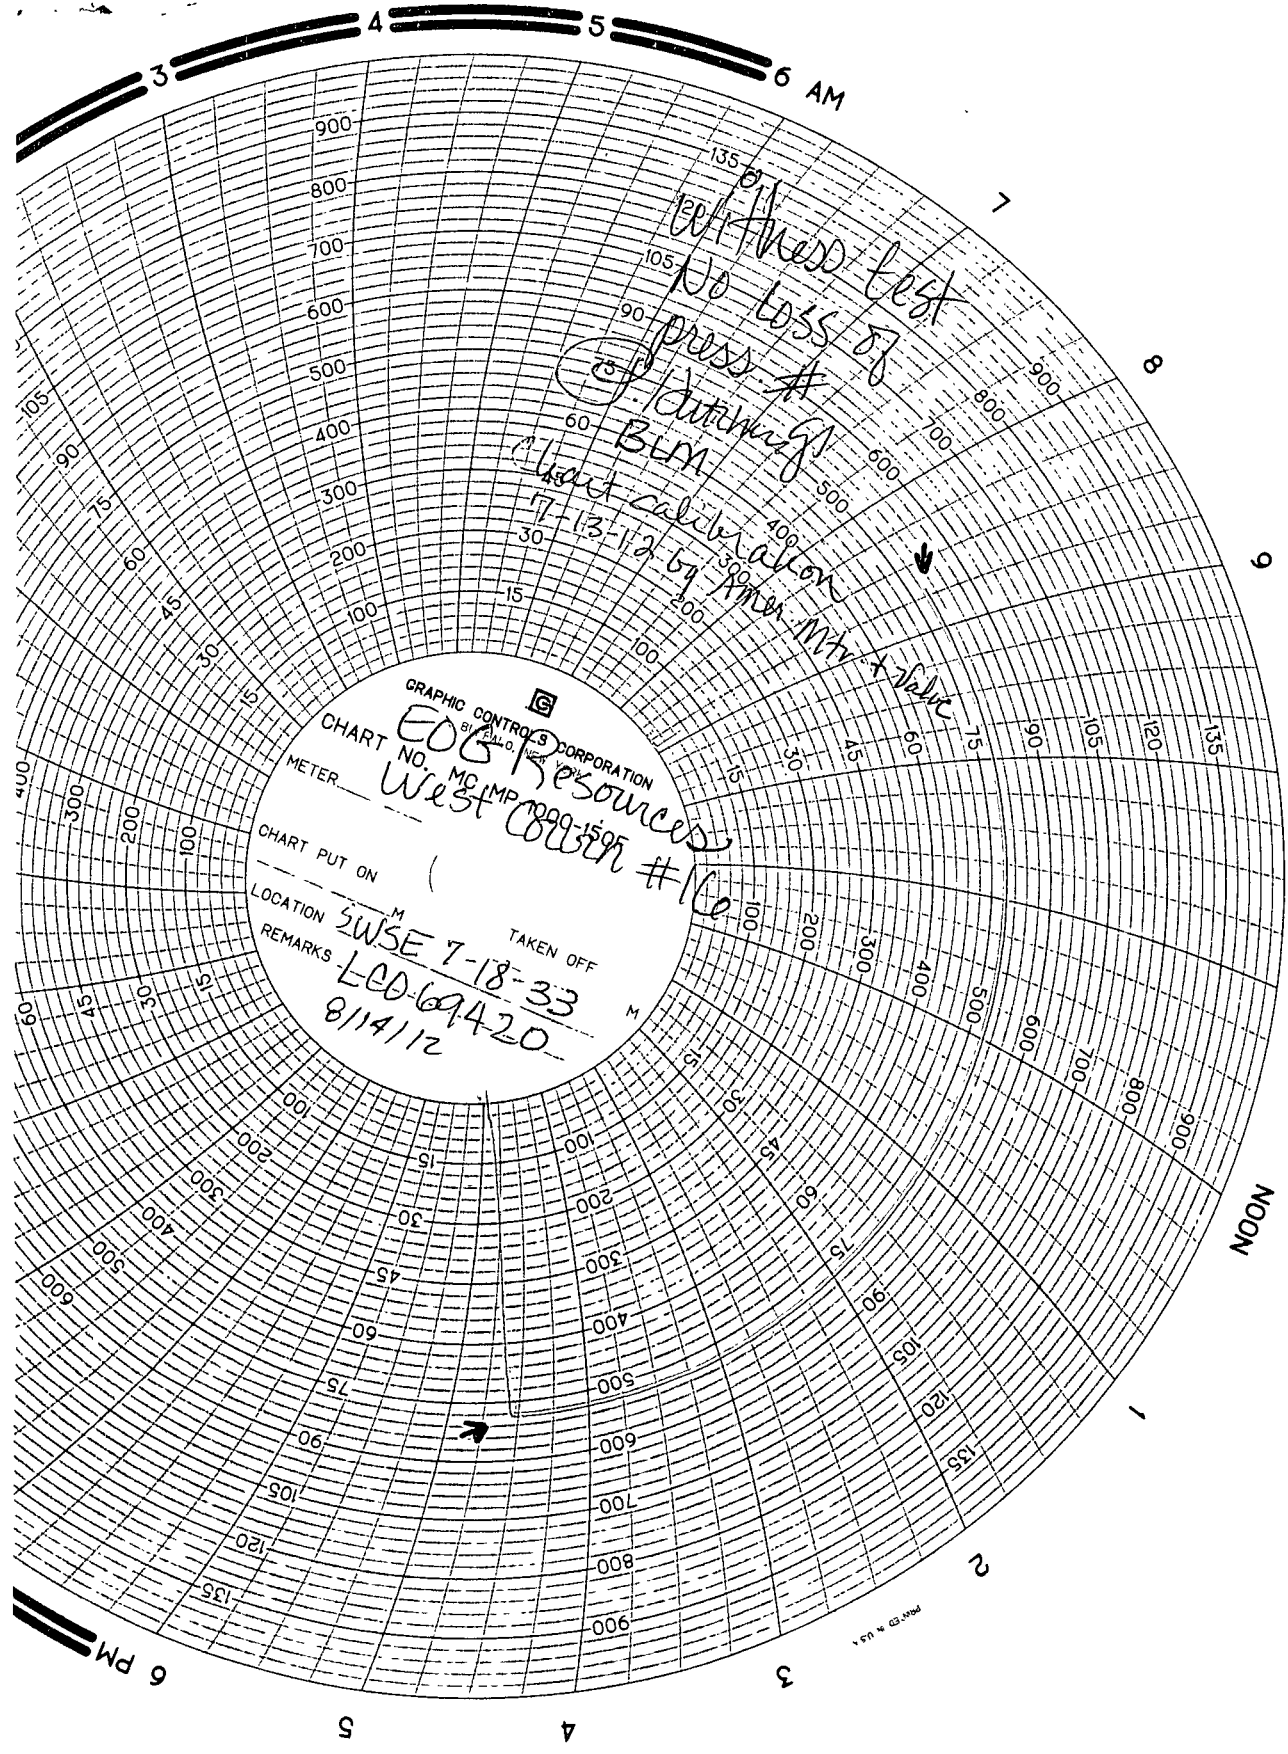

GRAPHIC CONTROLS CORPORATION
CHART NO. **EOG Resources**
METER **West Cowin #116**
CHART PUT ON **7-18-33**
LOCATION **SWSE**
REMARKS **8/14/12**
TAKEN OFF **8/14/12**

with these test
No loss of
press #
of butting
BLM
Chart calibration
7-13-12 by 8m Mr + 1/2