

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
RECEIVED
OIL CONSERVATION DIVISION
NOV 01 2012
HOBBS
South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised August 1, 2011

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-05125
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Celero Energy II, LP		6. State Oil & Gas Lease No.
3. Address of Operator 400 W. Illinois, Ste. 1601 Midland, TX 79701		7. Lease Name or Unit Agreement Name Buckley B
4. Well Location Unit Letter D : 990 feet from the North line and 330 feet from the West line Section 25 Township 14S Range 37E NMPM County Lea		8. Well Number 2
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3812'		9. OGRID Number 247128
		10. Pool name or Wildcat Denton Pennsylvanian

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: Amend P&A procedure ☒

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RIH w/ BP & PS on 2 7/8" tbg to 11,000' & spot 30 sx. Class C. Pick up, WOC, a min 4 hrs & tag TOC.
2. Circ salt mud to 5300'. Pull tbg to 9370' & spot 30 sx. Pull tbg to 6500' & spot 35 sx. POOH. SPOT CMT - 256xs @ 5927'
3. Perf 4 @ 4825'. RIH w/ pkr & sqz 50 sx. POOH w/ pkr. RBIH w/ BP & PS & tag TOC at/above 4725'. Circ salt mud to 2140' & POOH.
4. Perf 4 @ 2140'. RIH w/ pkr & sqz 50 sx. POOH w/ pkr. RBIH w/ BP & PS & tag TOC at/above 2040'. Circ salt mud to 423' & POOH.
5. Perf 4 @ 423'. Fill 5 1/2" & 5 1/2" by 8 5/8" annulus to surf w/ min 100 sx.
6. RD. Set P&A marker, clean & reclaim location.

All plugs Class C cmt.

Min 9.5 ppg salt mud between plugs.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Lisa Hunt

TITLE Regulatory Analyst

DATE 11/01/2012

Type or print name Lisa Hunt

E-mail address: lhunt@celeroenergy.com

PHONE: (432)686-1883

For State Use Only

APPROVED BY:

Mary Brown

TITLE

Compliance Officer


DATE 11/1/2012

Conditions of Approval (if any):

Buckley "B" # 2 - 990' FNL & 330' FWL of Sec. 25, T-14S, R-37E, Unit Letter "D"

Spud: 9/24/54
 Compl: 12/4/54
 ELEV: 3815'
 API # 30-025-05125

MWM, 11/1/12

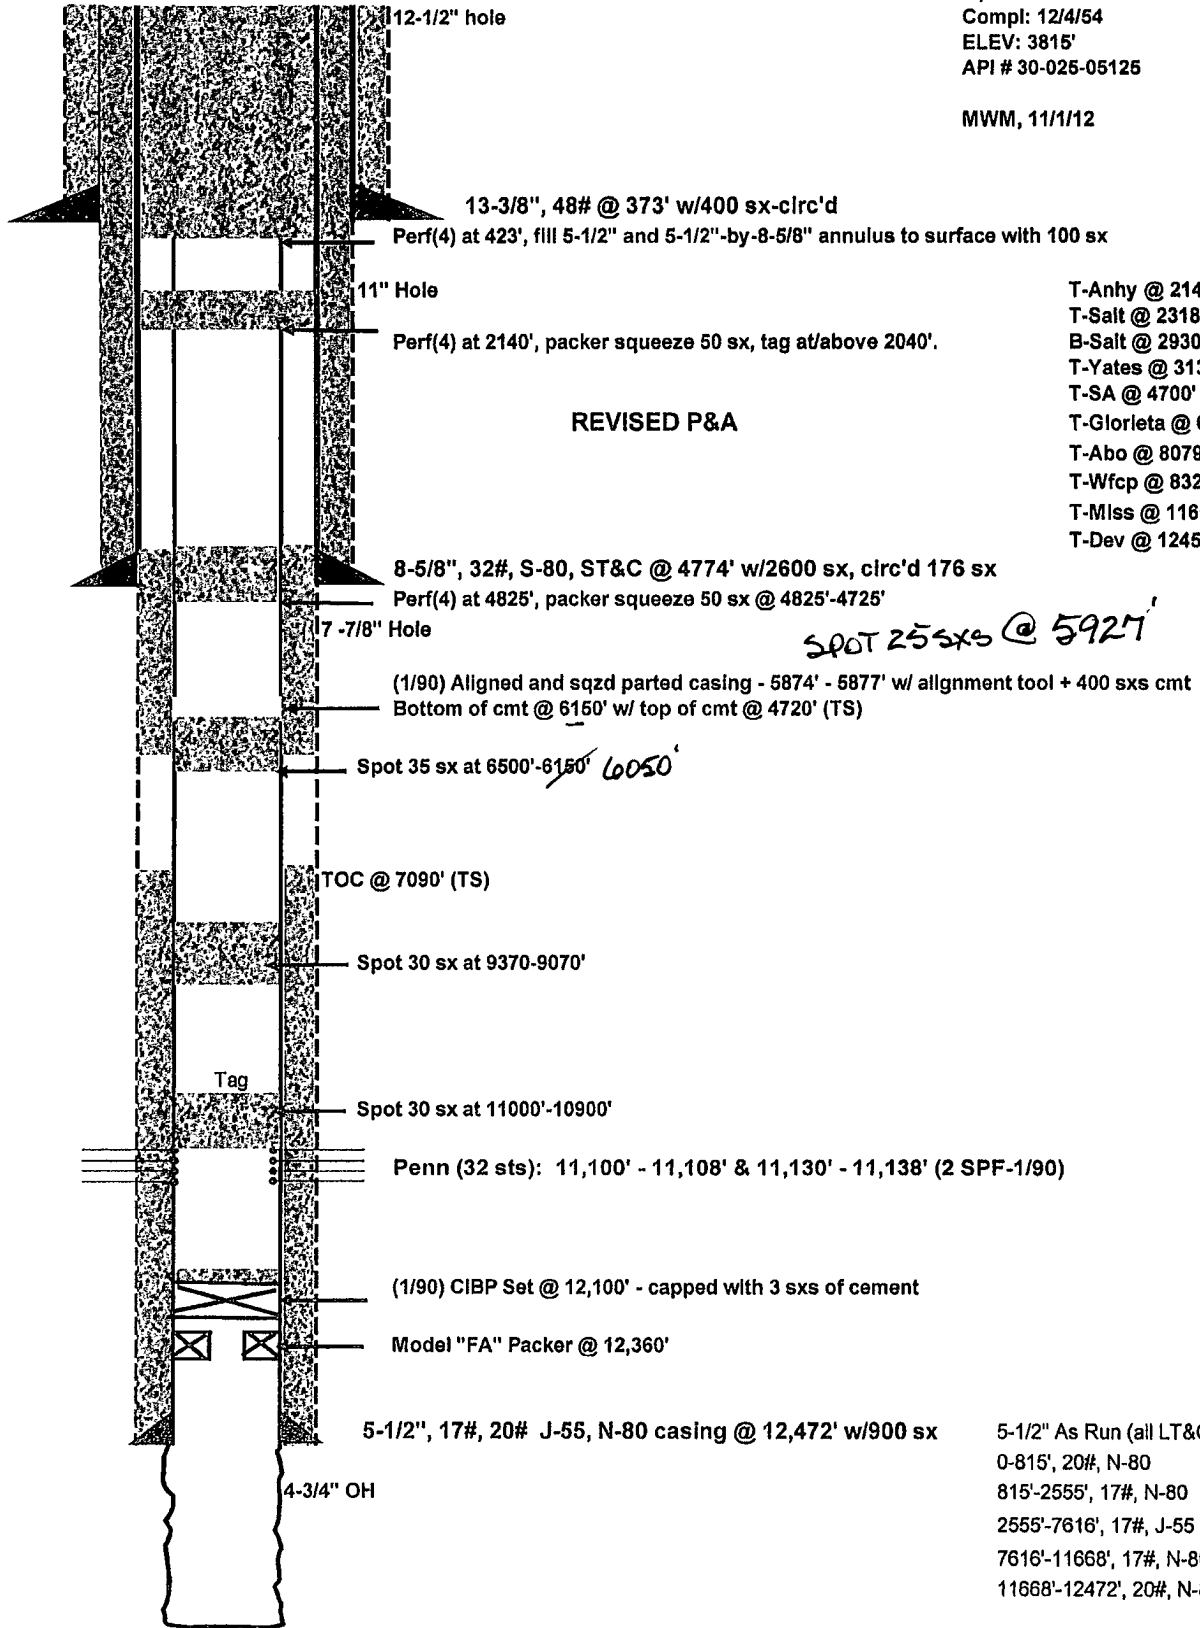

T-Anhy @ 2142' est
 T-Salt @ 2318' est
 B-Salt @ 2930' est
 T-Yates @ 3130' est
 T-SA @ 4700' est
 T-Glorieta @ 6208' .
 T-Abo @ 8079'
 T-Wfcp @ 8324'
 T-Miss @ 11602'
 T-Dev @ 12450'

TD @ 12,605'