

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

DISTRICT I
1625 N French Dr., Hobbs, NM 88240

DISTRICT II
1301 W. Grand Ave., Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd, Aztec, NM 87410

HOBBS OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

NOV 16 2012

RECEIVED

WELL API NO
30-025-37435

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7 Lease Name or Unit Agreement Name

North Hobbs (G/SA) Unit
Section 19

8. Well No. 943

9 OGRID No 157984

10. Pool name or Wildcat Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS			
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals)			
1 Type of Well Oil Well ☒ Gas Well ☐ Other ☐			
2 Name of Operator Occidental Permian Ltd.			
3 Address of Operator HCR 1 Box 90 Denver City, TX 79323			
4. Well Location Unit Letter <u>H</u> <u>2470</u> Feet From The <u>North</u> Line and <u>225</u> Feet From The <u>East</u> Line Section <u>19</u> Township <u>18-S</u> Range <u>38-E</u> NMPM Lea County			
11. Elevation (Show whether DF, RKB, RT GR, etc) 3660' GL			
Pit or Below-grade Tank Application ☐ or Closure ☐ Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____			

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG & ABANDONMENT ☐
PULL OR ALTER CASING ☐	Multiple Completion ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: _____	☐	OTHER: _____	☐

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU & RU.
2. RU wireline & perforate tubing @4241'. RD wireline.
3. ND wellhead/NU BOP.
4. POOH w/ESP equipment.
5. RIH w/bit. Tag @4407' (TD). POOH w/bit.
6. RU wireline & perforate casing @4262-64' and 4271-85' @4 JSPF (72 holes). RD wireline.
7. RIH w/PPI packer set @4169'. RU HES and pump 2400 gal of 15% PAD acid in 3 stages into new perfs. RD HES.
8. RU pump truck and pump scale squeeze. Flush w/200 bbl fresh water. RD pump truck. POOH w/PPI packer.
9. RIH w/ ESP equipment set on 126 jts of 2-7/8" tubing. Intake set @4181'.
10. ND BOP/NU wellhead.
11. RDPU & RU. Clean location and return well to production

RUPU 08/13/2012 RDPU 09/07/2012

I hereby certify that the information above is true and complete to the best of my knowledge and belief I further certify that any pit or below-grade tank has been/will be constructed or

closed according to NMOC guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE Mendy A. Johnson TITLE Administrative Associate DATE 11/14/2012
TYPE OR PRINT NAME Mendy A. Johnson E-mail address: mendy_johnson@oxy.com TELEPHONE NO 806-592-6280

For State Use Only
APPROVED BY [Signature] TITLE Dist. Mgr DATE 11-20
CONDITIONS OF APPROVAL IF ANY _____

NOV 19 2012

September 24, 2012

Work Plan Report for Well:NHSAU 943-19

Pumping Unit

No Data found for Section - surfaceunit


MOP, Status and Type for Each Completion

Status Date	Well Name	API10	API14	Type	Production Method Code	Current Status Comment
12/16/2005	NHSAU 943-19	3002537435	30025374350000	SU	SU	(masters)

Special Objects

No Data found for Section - SpecialObjects

Wellbore Diagram

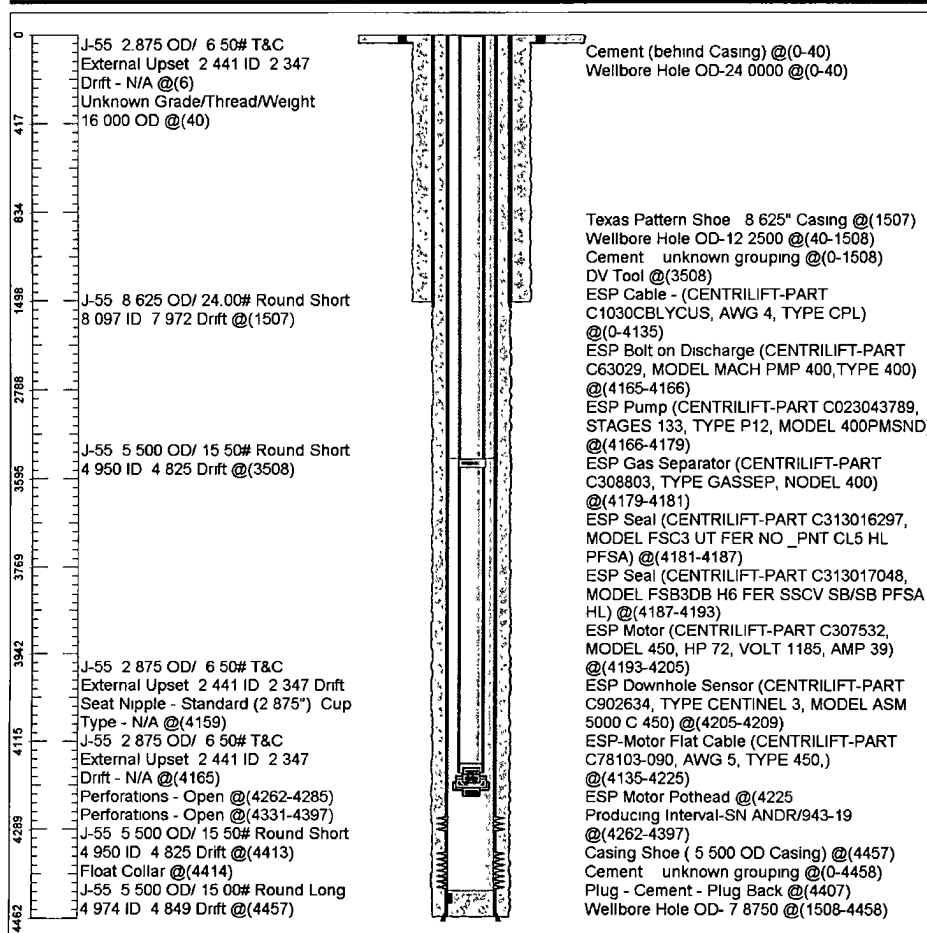

Survey Viewer