

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-025-06285

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
2616

7. Lease Name or Unit Agreement Name

Eunice Monument South Unit

8. Well Number 128

9. OGRID Number
005380

10. Pool name or Wildcat
Grayburg Monument San Andres

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injection

2. Name of Operator
XTO Energy Inc.

3. Address of Operator
200 N. Loraine, Ste 800, Midland, Texas 79701

4. Well Location

Unit Letter O : 660 feet from the South line and 1980 feet from the East line
Section 30 Township 20-S Range 37-E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

Pit or Below-grade Tank Application ☒ or Closure ☐

Pit type steel Depth to Groundwater 300 Distance from nearest fresh water well 1000+ Distance from nearest surface water 1000+

Pit Liner Thickness: mil Below-Grade Tank: Volume bbls Construction Material

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

MIRU
ND WH & NU BOP
POH & LD 2-3/8" IPC tbg & pkr
RU W/L & set 7" CIBP @ 3570'
RIH w/tbg & tag CIBP
Circ hole w/MLF (140 bbls) spot 25 sxs cmt on top of CIBP 3570' - 3420'
Pull tbg to 2480', spot 25 sxs cmt 2480'-2380',
Pull tbg to 1060', spot 25 sxs cmt 1060'-960', WOC & tag
Pull tbg to 300', spot 50 sxs cmt 300' - 4', POH w/tbg
RDMO. Cut off wellhead & anchors, install dry hole marker, & clean location.

THE OIL CONSERVATION DIVISION MUST
BE NOTIFIED 24 HOURS PRIOR TO THE
BEGINNING OF PLUGGING OPERATIONS.

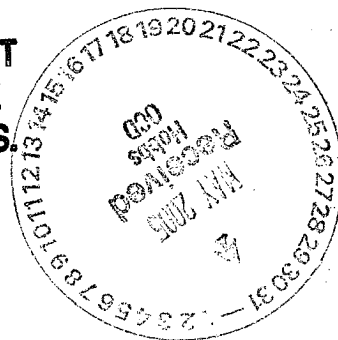

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE DeeAnn Kemp TITLE Regulatory DATE 5/27/05

Type or print name DeeAnn Kemp E-mail address: Telephone No. 432-620-6724

For State Use Only

APPROVED BY: Hayden Wink OC FIELD REPRESENTATIVE II/STAFF MANAGER
Conditions of Approval (if any): DATE JUN 01 2005