

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-025-05242

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

State H

8. Well Number

1

9. OGRID Number

227103

10. Pool name or Wildcat

Denton; Devonian

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Platinum Exploration Inc

3. Address of Operator

550 W. Texas, Suite 500 Midland, TX 79701 432-687-1664

4. Well Location

Unit Letter H : 2310 feet from the N line and 990 feet from the East line
Section 2 Township 15S Range 37-E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

3814 - GR

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ P AND A ☐

CASING/CEMENT JOB ☐

OTHER: Add Perfs ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

06/18/05-07/21/05 MIRU Basic. Unhang well. ND WH. NU BOP. Release TAC. POOH. PU WS & tag @ 12662'. POOH w/ WS. RIH & tag @ 12649'. RU swivel & pump 430 bbls FW & PW. RD Swivel. RIH & tag @ 12649'. RU swivel & est circ. Drill to 11698', circ hole cln. POOH. MU 5 1/2 RBP & RIH to 12201. Load & test cst to 1000# - OK. Rel RPB & POOH. RU Schlumberger WL & run correlation log from 12698-11589'. Perf from 12650-12670' w/80 holes. RD Schlumberger. MU 5 1/2 HP pkr. RIH to 12620' & set pkr. Load & test to 1000 psi - OK. RU Key & acdz w/3000 gals 15% HCL. RD Key.

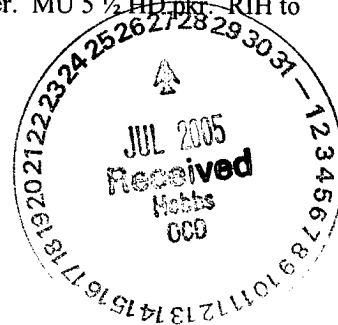

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Gloria Holcomb TITLE Agent DATE 07/26/05

Type or print name Gloria Holcomb

E-mail address: gholcomb@t3wireless.com

Telephone No. 432-687-1664

For State Use Only

PETROLEUM ENGINEER

APPROVED BY: [Signature] TITLE _____ DATE AUG 08 2005

Conditions of Approval (if any):