

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-025-07185
5. Indicate Type of Lease
STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
28938

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name:
Goldengate

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

8. Well No.
2

2. Name of Operator
BRECK OPERATING CORP.

3. Address of Operator
P.O. BOX 911, BRECKENRIDGE, TEXAS 76424

9. Pool name or Wildcat
Gladiola, Wolfcamp

4. Well Location

Unit Letter C : 990 feet from the NORTH line and 2310 feet from the WEST line

Section 18 Township 12S Range 38E NMPM LEA County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3886.1' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

CURRENT STATUS OF WELL

1. 13-3/8" set @ 325' cement circ.
2. 8-5/8" set @ 4600' cement circ.
3. 5-1/2" set @ 11,968' TOC 11,700' top of 5-1/2" cut off @ 4408'.
4. Open hole cemented, TOC 10,044'.
5. CIBP @ 9700' no cement.
6. Perf 9514'-9530'.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

PLUGGING PROCEDURE

1. Dump 35' of cement on top of CIBP.
2. Set CIBP @ 9500' w/35' cement.
3. Perf 5930' & squeeze 100' plug & tag.
4. Perf 4650' & squeeze 100' plug & tag.
5. Spot 100' plug 2330' - 2230' & tag.
6. Spot 100' plug 375'-275' & tag.
7. Surface plug 60'-0.
8. Install dry hole marker.
9. Clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ernie Underwood TITLE DISTRICT ENGINEER DATE May 29, 2003

Type or print name ERNIE UNDERWOOD

Telephone No. (254) 559-3355

(This space for State use)

APPROVED BY Gay W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE JUN 05 2003

Conditions of approval, if any

PLUGGING & ABANDONMENT WORKSHEET (3 STRING CSNG)

OPERATOR Breck Operating Corp
LEASENAME Golden Gate

WELL # 2

SECT 18 TWN 12S RNG 38E

FROM 990 N/S L 2310 E/W L

TD: 11,978 FORMATION @ TD Devonian

PBTD: 9700 FORMATION @ PBTD Wolfcamp

13 7/8"
@ 325'
TOC Surface

Top of
5 1/2" 4408'

8 7/8"
@ 4600'
TOC Surface

9514' - 9530'
Wolfcamp Payls


CIBP @ 9700'

10,644'

5 1/2"
@ 11,968'
TOC 10,700'

Cement

11,978'

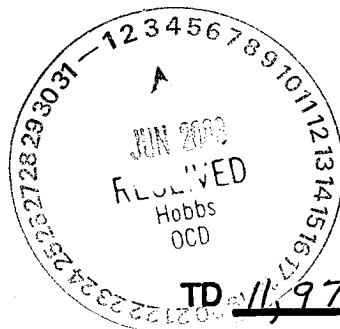

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE	13 7/8'	325'	Surface		
INTMED 1	8 7/8"	4600'	Surface		
INTMED 2					
PROD	5 1/2"	11,968'	11,700'	Calculated	
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					
	CUT & PULL @			TOP - BOTTOM	
INTMED 1				PERFS	-
INTMED 2				OPENHOLE	-
PROD					

* REQUIRED PLUGS DISTRICT I

RUSTLER (ANHYD)	2221'
YATES	3075'
QUEEN	
GRAYBURG	
SAN ANDRES	4435'
CAPTAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
GLORIETA	5883'
BLINEBRY	
TUBB	
DRINKARD	
ABO	7800'
WC	9324'
PENN	9510'
STRAWN	
ATOKA	
MORROW	
MISS	11,330'
DEVONIAN	11,961'

PLUG	TYPE PLUG	SACKS CMNT	DEPTH
EXAMPLES			
PLUG #1	OH	25 SXS	9850'
PLUG #2	SHOE	50 SXS	8700'-8800'
PLUG #3	CIBP/35'		5300'
PLUG #3	CIBP	25 SXS	5300'
PLUG #4	STUB	50 SXS	4600'-4700'
PLUG #6	RETNR SOZ	200 SXS	400
PLUG #7	SURF	10 SXS	0-10'
PLUG #1	CIBP/35'		9700'
PLUG #2	CIBP/35'		9500'
PLUG #3			5930'-5930
PLUG #4	Stub		4500'-4450'
PLUG #5			2330'-2230
PLUG #6	Shoe		375'-275'
PLUG #7	Surf	10 SXS	0-10'
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			