

Submit 1 Copy To Appropriate District Office

District I ~ (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II ~ (575) 748-1283
811 S. First St., Artesia, NM 88210
District III ~ (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV ~ (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

HOBBS OGD

State of New Mexico

Energy, Minerals and Natural Resources

Form C-103

Revised August 1, 2011

MAR 28 2013

RECEIVED

CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.	30-025-03820
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	E-2359
7. Lease Name or Unit Agreement Name	State L "A"
8. Well Number	12
9. OGRID Number	258350
10. Pool name or Wildcat	Lovington Drinkard
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator Vanguard Permian LLC	
3. Address of Operator 5847 San Felipe St. Ste. 3000, Houston, TX 77057	
4. Well Location Unit Letter <u>K</u> : <u>2310'</u> feet from the <u>South</u> line and <u>2310'</u> feet from the <u>West</u> line Section <u>1</u> Township <u>17S</u> Range <u>36E</u> NMPM County <u>Lea</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to move in to P & A

2. MIRU P & A equip. RIH tag PBTD @ 4826'

3. Circ hole w/MLF min 9 lb bw w/25 lbs gel p/bbl

4. Spot 25x "c" cmt F/ 4826'-4600' woc & tag

5. Perf @ 3800' sqz 50x "c" cmt 3800'-3700' (8 5/8" shoe) woc & tag

6. Perf @ 3000' sqz 75x "c" cmt F/ 3000'-2800' (B. salt, Yates) woc & tag

7. Perf @ 2050' sqz 75x "c" cmt F/ 2050'-1900' (T. salt) woc & tag

8. Perf @ 350' circ. cmt to surf via 5 1/2" x 8 5/8" & 8 5/8" x 13 3/8" csg ann leaving 5 1/2" csg full of cmt (13 3/8" shoe) w / 200 x's

9. Cut off well heads, Install dry hole marker, clean location

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE

Agent

DATE 3/26/13

Type or print name

Jimmy Bagley

E-mail address: sunsetwellservice@yahoo.com

PHONE: 432-561-8600

For State Use Only

APPROVED BY:

Maley Strawn

TITLE

Compliance Officer

DATE

3/28/2013


Conditions of Approval (if any):

LEASE/WELL: STATE L"A" NO 12
 LOCATION UL K, SEC 1, T 17S, R 36E
 CO/ST: LEA, NM
 API NO: 30-025-03820
 FIELD: LOVINGTON (DRINKARD)
 STATE LEASE: E-2359

GR 3823
 KB 3835

SPUDDED 1/10/1953 6/10/1998 RE-ENTERED
 COMPLETED 2/23/1953 7/13/1998 COLLINS&WARE

LAT (27) 32.86314072
 LONG(27) -103.3090895

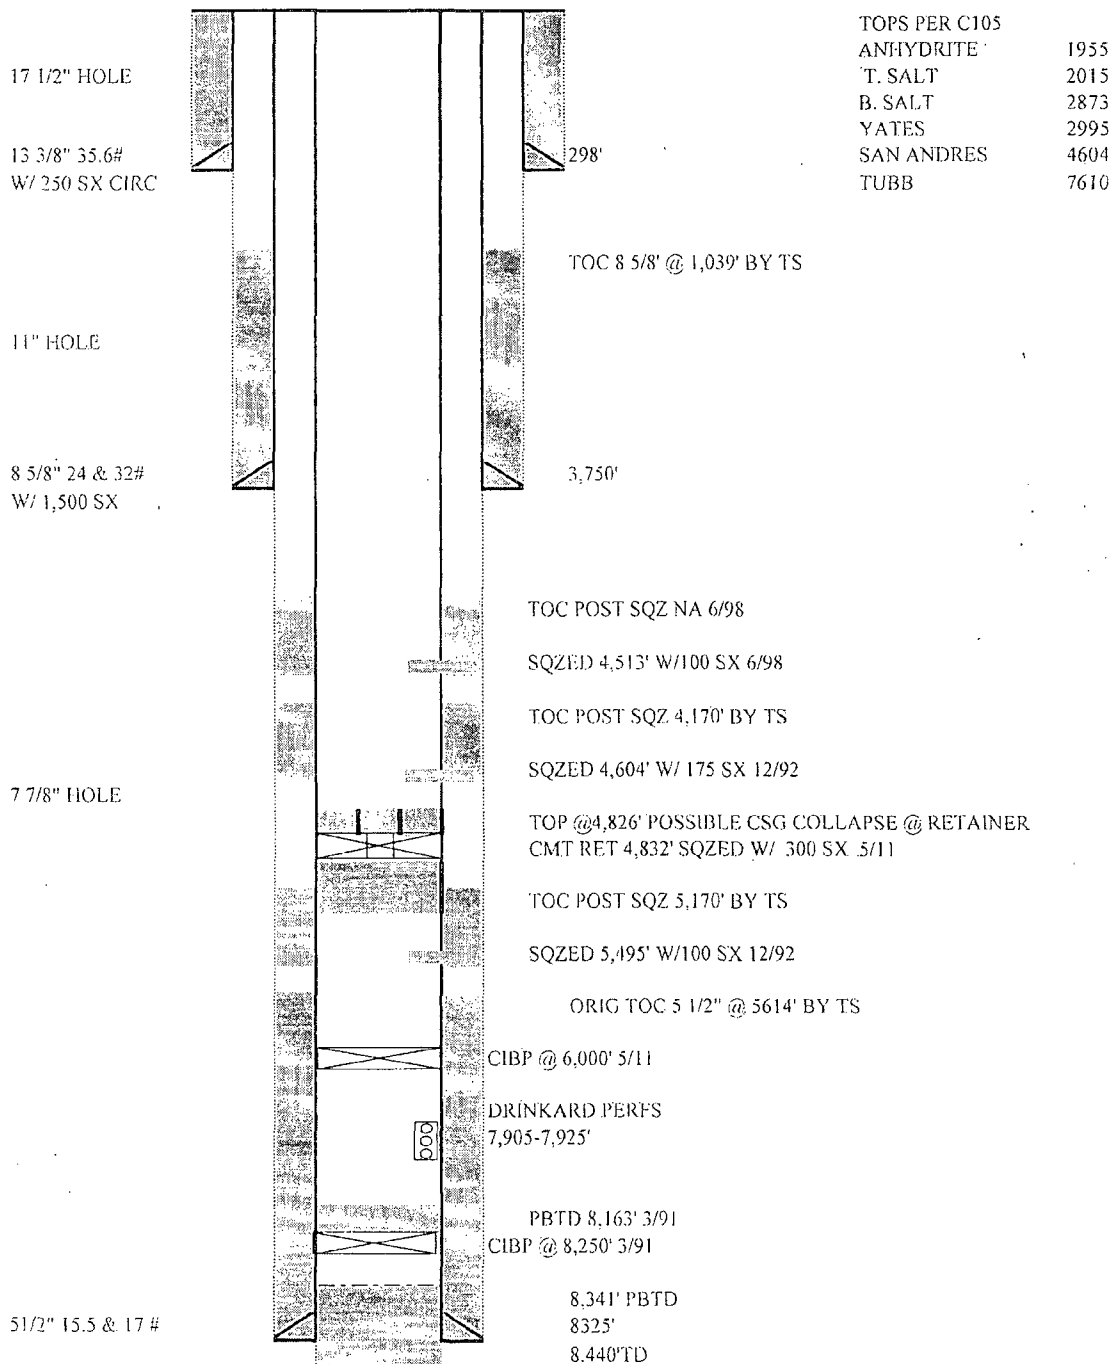

CMB 03-19-13