

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
100 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-03234
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name WEST PEARL QUEEN UNIT
8. Well Number #108
9. OGRID Number 25482
10. Pool name or Wildcat PEARL QUEEN
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other **INJ**

2. Name of Operator
STATE OF NEW MEXICO formerly XERIC O&G

3. Address of Operator
1625 N. FRENCH DRIVE HOBBS, NM 88240

4. Well Location
Unit Letter **F** : **1980** feet from the **NORTH** line and **1980** feet from the **WEST** line
Section **28** Township **19S** Range **35E** NMPM County **LEA**

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED PLUGGING PROCEDURE

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Maureen Brown

TITLE

Compliance Officer

DATE

2/21/2013

Type or print name

E-mail address:

PHONE:

State Use Only

APPROVED BY:

Maureen Brown

TITLE

Compliance Officer

DATE

02-22-2013

Conditions of Approval (if any):

State of New Mexico formerly XERIC OIL & GAS

LEASE NAME WEST PEARL QUEEN UNIT #108 API 30-0 25-03234

Section 28 -T 19 S-R 35 E FROM 1980 N / ~~S~~ L, 1980 E / W L.

SPECIAL NOTE—Mud Laden Fluid will consist of 9.5# brine with 12.5# Salt Gel per BBL (25 sacks of gel/ per 100 BBLs Brine). All cement plugs will be 25 sacks of cement or 100', whichever is greater. **Unless otherwise specified in the approved procedure**, cement plugs shall consist of class "C" for depths to 7500'. Class "H" will be used for plugs deeper than 7500'.

1. MIRU plugging unit. Lay down production equipment.
2. Set CIBP @ 4650 '. Circulate MLF. Spot 25 sxs cmt on CIBP.
3. ~~Perf/~~ Spot 25 sxs cmt @ 3390 '. If perf, WOC and TAG.
4. Perf/ ~~Spot~~ 25 sxs cmt @ 1750 '. If perf, WOC and TAG.
5. Perf/~~Spot~~ @ 376 '. Sqz w/ sufficient volume to circ cmt to surface inside/outside of csg strings.
6. Cutoff wellhead and anchors, install marker.

-----SPECIAL NOTES-----


PLUGGING & ABANDONMENT WORKSHEET

OPERATOR STATE OF NM - XERIC
LEASENAME WEST PEARL QUEEN UNIT

WELL # 108

SECT FROM TWN N/S L RNG E/W L

TD: FORMATION @ TD
PBTD: FORMATION @ PBTD

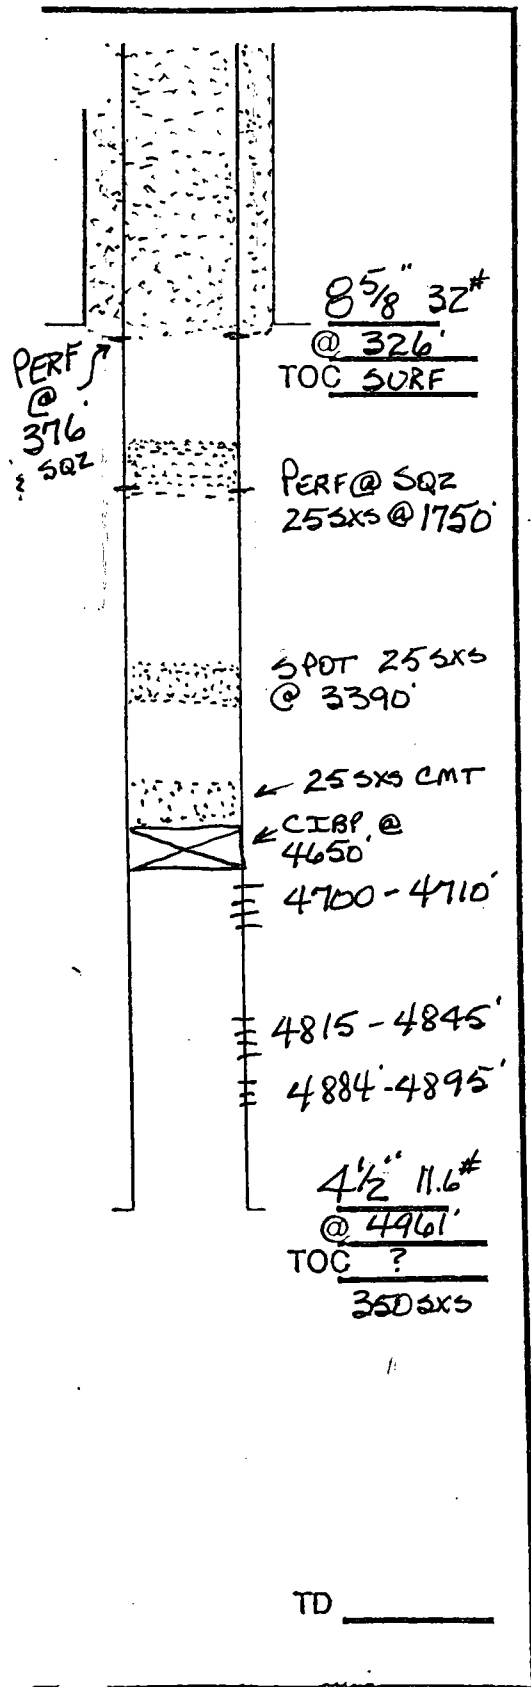

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE					
INTMED 1					
INTMED 2					
PROD					
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					
	CUT & PULL @			TOP - BOTTOM	
INTMED 1			PERFS	-	
INTMED 2			OPENHOLE	-	
PROD					

*** REQUIRED PLUGS DISTRICT I**

RUSTLER (ANEYD)	1785
YATES	3390
QUEEN	4590
GRAYBURG	
SAN ANDRES	
CAPTAIN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
OLOJETA	
BLUEBERRY	
TUBS	
DRINKARD	
ABO	
WC	
PERK	
STRAWN	
ATOKA	
MOORELOW	
MISS	
DEVONIAN	

[illegible]