

Office

Revised July 18, 2013

District I - (575) 393-6161

1625 N. French Dr., Hobbs, NM 88240

District II - (575) 748-1283

811 S. First St., Artesia, NM 88210

District III - (505) 334-6178

1000 Rio Brazos Rd., Aztec, NM 87410

District IV - (505) 476-3460

1220 S. St. Francis Dr., Santa Fe, NM

87505

Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO.

30-025-05425

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

CS CAYLOR

8. Well Number

4

9. OGRID Number

258660

10. Pool name or Wildcat

LOUNGTON ABO

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

THREE FORKS RESOURCES, LLC

3. Address of Operator

1515 WAZEE, SUITE 350, DENVER CO 80202

4. Well Location

Unit Letter F : 1653 feet from the N line and 1558 feet from the W line
Section 6 Township 17S Range 37E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

PROPOSED TO P&A WELL AS FOLLOWS: PERF 5 1/2" @ 3350',
SQUEEZE 75 sx cement, SPOT 35 SX @ 100' TO SURFACE.
INSTALL DRY HOLE MARKER AND CLEAN LOCATION.

WORK TO START AS SOON AS CONTRACTOR AVAILABILITY.

DDO WILL BE NOTIFIED 24 HOURS IN ADVANCE.

SEE REVISED P/A PROCEDURE

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE

DATE

Type or print name

E-mail address:

PHONE:

For State Use Only

APPROVED BY:

TITLE

DATE


Conditions of Approval (if any):

AUG 29 2013

THREE FORKS RESOURCES CS CAYLOR #4 30-025-05425

REVISED P&A WELL PROCEDURE BY OCD:

1. MIRU PA RIG. CLEAN OUT 5 $\frac{1}{2}$ " CSG TO 8200'. RIH W/ 5 $\frac{1}{2}$ " CIBP TO 8200', CAP W/25 SXS CLASS "H" CMT. CIRC WELLBORE W/ MUD LADEN FLUID (12.5# SALT GEL PER BARREL OF 9.5# BRINE). WOC AND TAG.
2. SPOT 25 SXS "C" CMT @ 6000'.
3. SET 5 $\frac{1}{2}$ " CIBP @ 3800' AND CAP W/25 SXS CMT. WOC AND TAG.
4. PERF 5 $\frac{1}{2}$ " CSG @ 3350'. SQZ W/75 SXS "C" CMT. WOC AND TAG.
5. PERF 5 $\frac{1}{2}$ " CSG @2000'. SQZ W/30 SXS "C" CMT. WOC AND TAG.
6. PERF 5 $\frac{1}{2}$ " CSG @333'. CIRC "C" CMT INSIDE AND OUT TO SURFACE. CUTOFF WELLHEAD AND INSTALL MARKER.

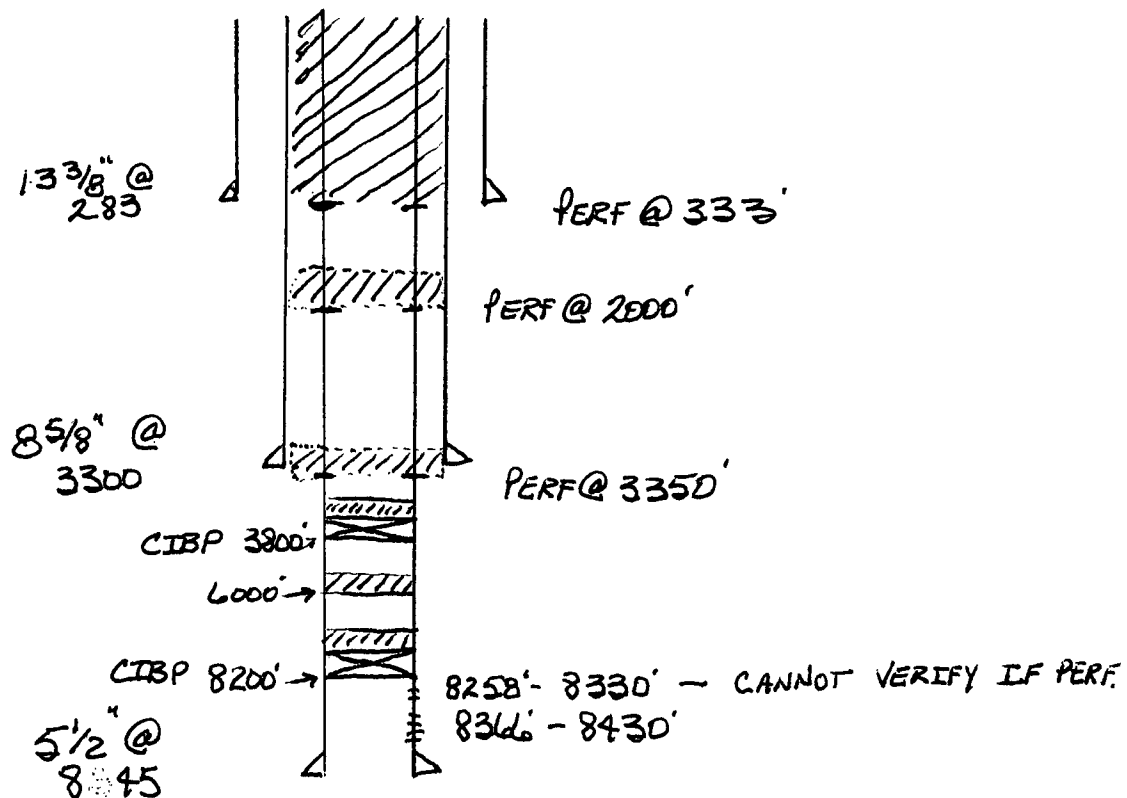

F-6-175-37E

API# 30-025-05425

13³/₈ @
283' w/
280 SX

8⁵/₈ @ 3300
w/800 SX

5¹/₂" @ 8445'
w/800 SX

3803
CIBP @ 3803 w/50 SX
= 3853-4003

* SHOULD BE A
SQUEEZ JOB CLOSE TO
UPPER PERFS - NOT
REPORTED!

8370-8430



PLUG # 2
SURF TO 100'
35 SX



PLUG #1
PERF @ 3350
SQ 75 SX

* RECORD DO NOT REFLECT
SQUEEZING OF PERFS