

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-31982
1. Type of Well: Oil Well ☐ Gas Well ☒ Other		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator DAVID H. ARRINGTON OIL AND GAS,		6. State Oil & Gas Lease No.
3. Address of Operator P.O. BOX 2071 MIDLAND, TX 79702		7. Lease Name or Unit Agreement Name Foster
4. Well Location Unit Letter <u>P</u> : 660 feet from the <u>South</u> line and <u>330</u> feet from the <u>East</u> line Section <u>34</u> Township <u>19S</u> Range <u>36E</u> NMPM County <u>Lea</u>		8. Well Number <u>3</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3614 GR		9. OGRID Number 5898
		10. Pool name or Wildcat Monument; Abo

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

E-PERMITTING

RE P&A NR P&A R
CC INT TO P&A P.M. COMP
CA CSNG CHG Loc
TA RBDMS CHART

Other: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 25 1. CIBP 5 1/2 @ 7000' w/ 20 sx
2. 20 sx cmt @ 4998-4898', tag (DV tool @ 4948')
3. Cut & pull 5 1/2 csg, +/- 3000', 40 sx cmt across stub & tag
4. 40 sx cmt @ 2663', tag 2563'
5. Perf 5 1/2 & 8 5/8 @ 350', sqz w/ 150 sx cmt. WOC & tag @ 250'
6. 10 sx to surface. Install DHM 600'-0'

PERF 5 SQZ 60 SX CMT @ 1212'
WOC & TAG

Brine mud between all plugs.

Closed loop system to be used and all fluids transported to licensed facility.

The Oil Conservation Division
MUST BE NOTIFIED 24 Hours
Prior to the beginning of operations

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE ENGINEERING TECH

DATE 01/12/2015

Type or print name DEBBIE WHITING

E-mail address: DEBBIE.WHITING@ARRINGTON.NM.GOV

For State Use Only

APPROVED BY:

TITLE

DATE

Conditions of Approval (if any)

JAN 15 2015


**Foster No. 3
Monument ABO Field
Lea County, New Mexico
Existing Wellbore**

**KB: 3627'
GL: 3614'**

**660' FSL
330' FEL
S-34
T19S
R36E**

API: 30-025-31982

**Spud: 10/6/93
Rig Rel: 10/25/93**

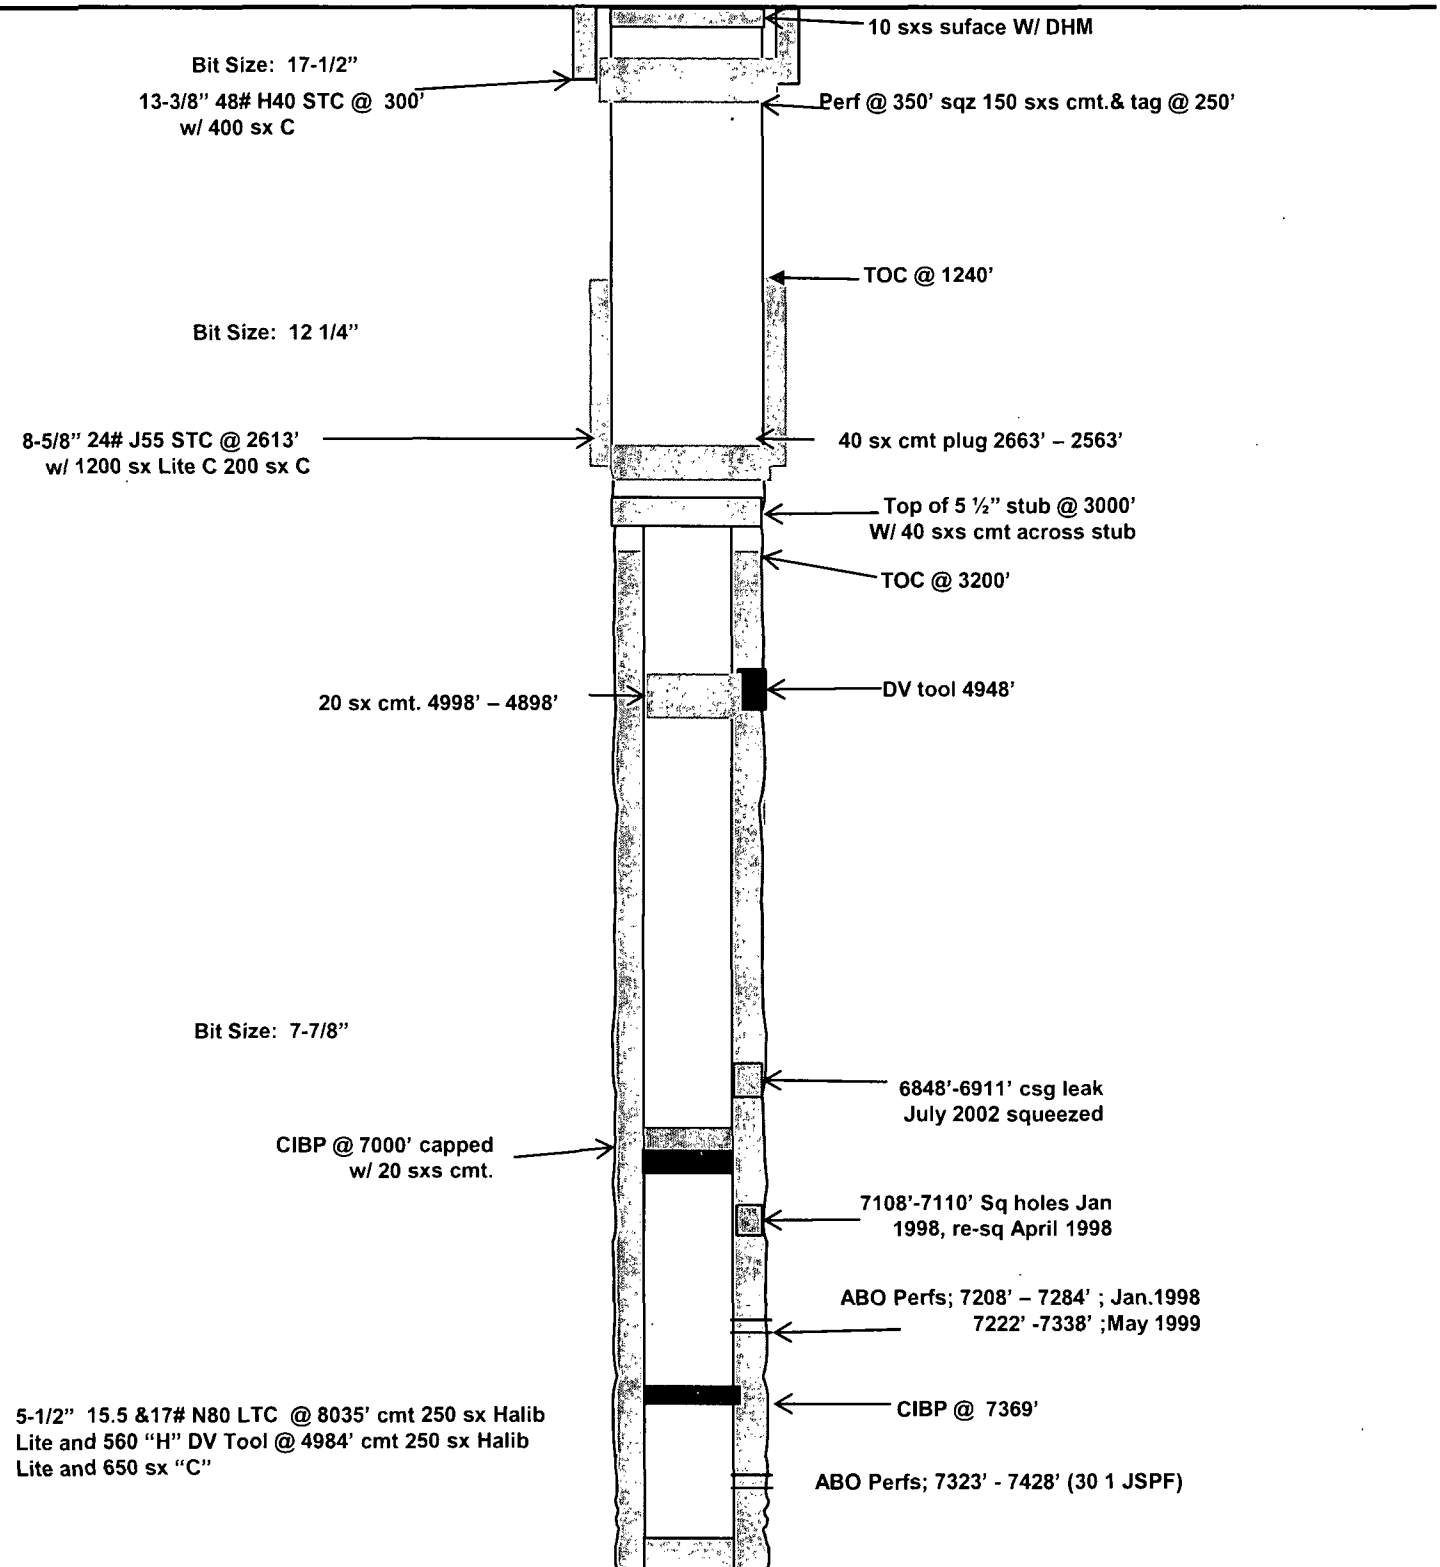

TD: 8035', PBTD: 7987'


Foster No. 3
Monument ABO Field
Lea County, New Mexico
Existing Wellbore

KB: 3627'
GL: 3614'

660' FSL
330' FEL
S-34
T19S
R36E

API: 30-025-31982

Spud: 10/6/93
Rig Rel: 10/25/93

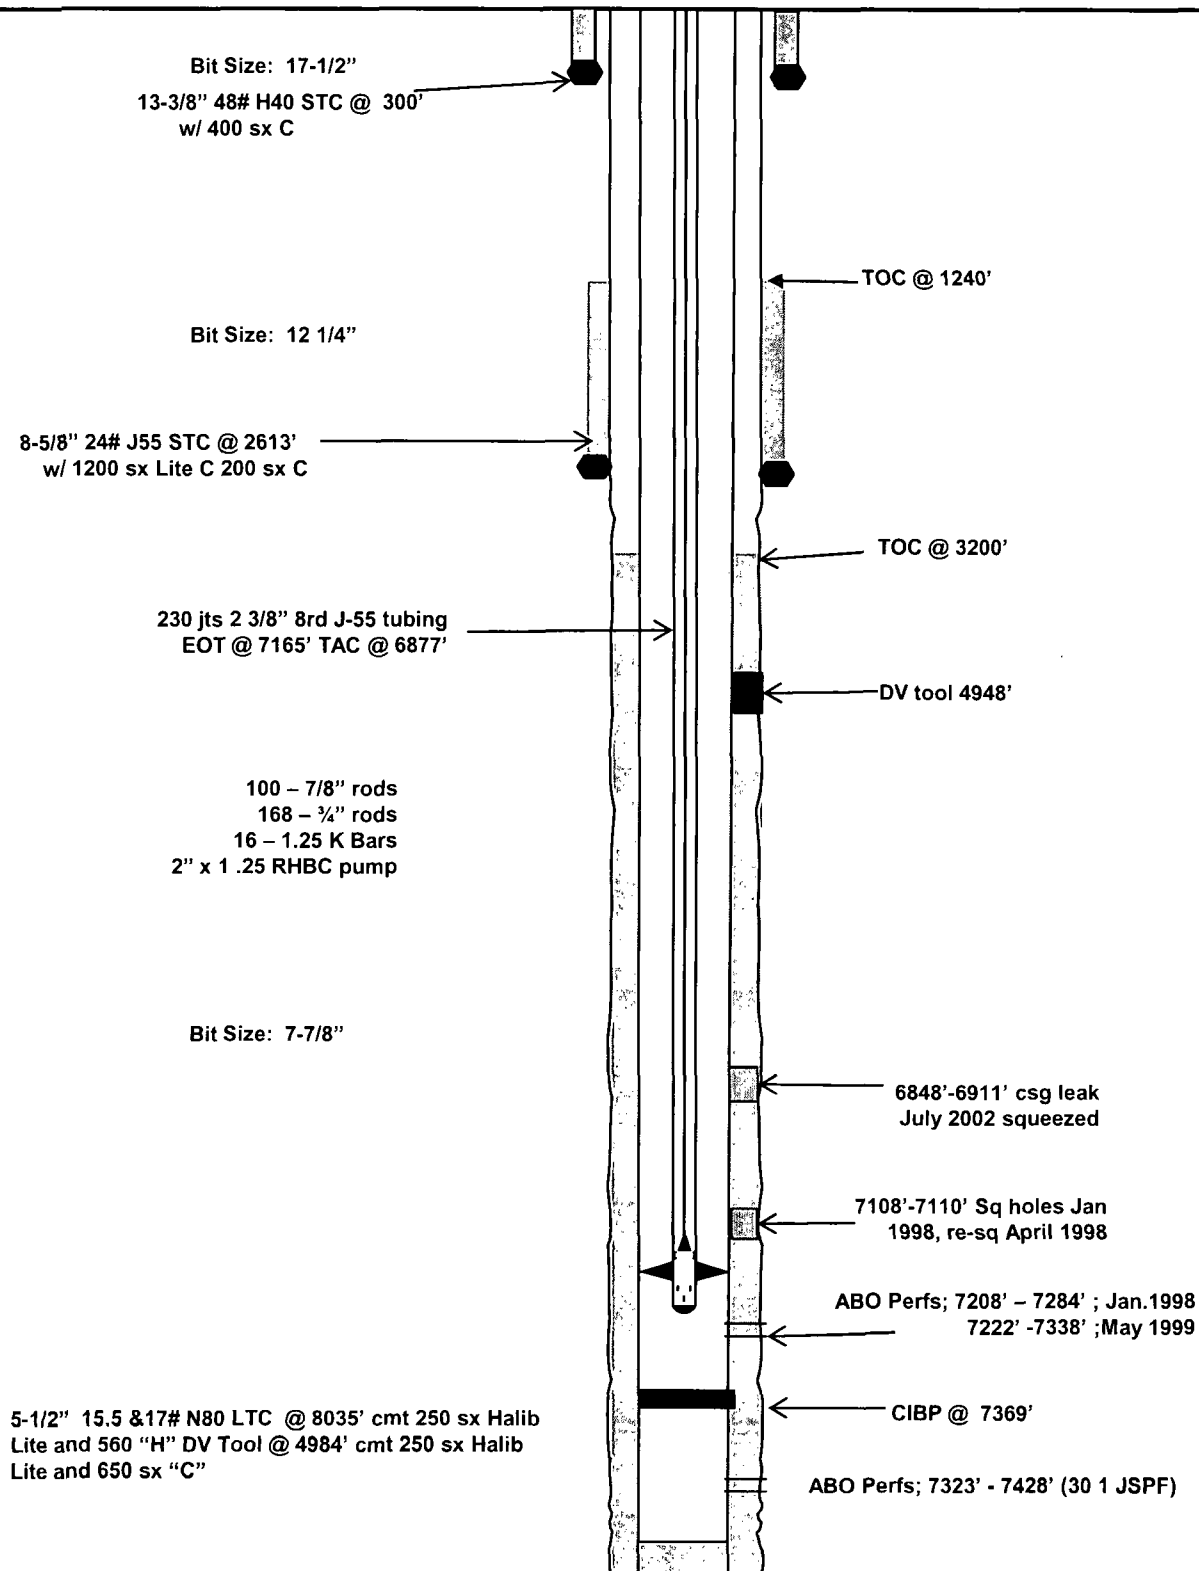

TD: 8035', PBTD: 7987'