

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-21613
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: mesalero Ridge UT 8910074858
8. Well No. mesalero ridge UT 14
9. Pool name or Wildcat Pearl Queen

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Merit Energy

3. Address of Operator
13272 NOEL RD. Dallas, TX 75240 STE. 500

4. Well Location
Unit Letter D : 660' feet from the North line and 990 feet from the west line
Section 35 Township 19S Range 34E NMPM County lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. circulate well w/mud set 5 1/2 CIBP @ 4550' w 35' cement
2. Perf sqz. 100' plug from 3440 to 3340 (Base salt 3391) woc tag
3. Perf sqz. 100' plug from 2530 to 2430 (Top salt 2484) woc tag
4. Perf 5 1/2 CSG @ 1640' sqz. 100' plug
5. Perf 5 1/2 CSG @ 256' (8 5/8 shoe @ 206) sqz 100' plug woc tag
6. Perf. 5 1/2 CSG @ 60' circulate cnt. to surface
7. Cut off well head install dry hole marker

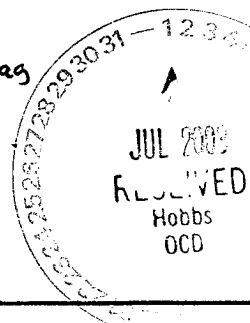

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Brpley TITLE Foreman DATE 6-30-03

Type or print name Brandon Ripley Telephone No. (505) 420-5502
(This space for State use)

APPROVED BY Harry W. Wink OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE JUL 01 2003