

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
May 27, 2004

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-29929
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-1709
7. Lease Name or Unit Agreement Name Buckeye -C-, 8601 JV-P
8. Well Number 2
9. OGRID Number 003002
10. Pool name or Wildcat Vacuum Grayburg, San Andres

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator  
BTA Oil Producers

3. Address of Operator  
104 S. Pecos, Midland, TX 79701

4. Well Location  
Unit Letter D : 990 feet from the north line and 330 feet from the west line

Section 36 Township 17S Range 35E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3900' GR 3914' RKB

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type \_\_\_\_\_ Depth to Groundwater \_\_\_\_\_ Distance from nearest fresh water well \_\_\_\_\_ Distance from nearest surface water \_\_\_\_\_

Pit Liner Thickness: \_\_\_\_\_ mil Below-Grade Tank: Volume \_\_\_\_\_ bbls; Construction Material \_\_\_\_\_

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

BTA proposes to P&A this well as follows:

1. Dump 20' cmt on CIBP @ 9050' w/wireline bailer
2. Set CIBP w/wireline @ 7500' w/20' cmt on top (Tubb).
3. Set CIBP w/wireline @ 6500' w/20' cmt on top (Glorietta).
4. Set CIBP w/wireline @ 4700' w/20' cmt on top (San Andres).
5. Spot 30 sx plug @ 3100' (Yates).
6. Spot 30 sx plug @ 2482' (50' below and 50' above) 8-5/8" shoe @ 2432'.
7. Cut and pull 5-1/2" & 8-5/8" casings @ 700'.
8. Spot 75 sx plug @ 750' (50' below & 50' above) 5-1/2" & 8-5/8" stubs.
9. Spot 75 sx plug @ 455' (50' below and 50' above) 13-3/8" shoe.
10. Spot 10 sx plug @ Surface. Install Dry Hole Marker.

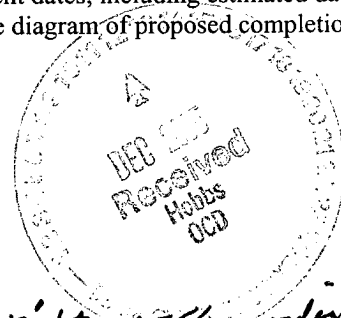

? 4410' btm of 8-5/8" according to well file.

**THE OIL CONSERVATION DIVISION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS.**

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE [Signature] TITLE Regulatory Administrator DATE 12/09/2005

Type or print name \_\_\_\_\_ E-mail address: \_\_\_\_\_ Telephone No. \_\_\_\_\_  
**For State Use Only**

APPROVED BY: [Signature] DATE DEC 14 2005  
Conditions of Approval (if any): \_\_\_\_\_