

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.  
Santa Fe, NM 87505

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

WELL API NO.

30-025-07504 30-025-07546

5. Indicate Type of Lease

STATE ☒

FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

NORTH HOBBS (G/SA) UNIT  
Section 33

8. Well No. 331

9. OGRID No. 157984

10. Pool name or Wildcat HOBBS (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)

1. Type of Well:

Oil Well ☒

Gas Well ☐

Other

2. Name of Operator

Occidental Permian Ltd.

3. Address of Operator

1017 W. Stanolind Rd., HOBBS, NM 88240

505/397-8200

4. Well Location

Unit Letter J : 1920 Feet From The SOUTH 1780 Feet From The EAST Line

Section 33 Township 18-S Range 38-E NMPM LEA County

11. Elevation (Show whether DF, RKB, RT GR, etc.)

3644' GR

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit Type \_\_\_\_\_ Depth of Ground Water \_\_\_\_\_ Distance from nearest fresh water well \_\_\_\_\_ Distance from nearest surface water

Pit Liner Thickness \_\_\_\_\_ mil Below-Grade Tank: Volume \_\_\_\_\_ bbls; Construction Material

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

Multiple Completion ☐

OTHER: \_\_\_\_\_

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG & ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Temporary Abandon Well ☒

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU. Pull 2-3/8" tbg.
2. Could not fish ESP cable. Severe scale.
3. Could not pull ESP equipment. Clean out cable and tbg to 3800'.
4. Set CIBP @3793'.
5. Circ csg w/60 bbl pkr fluid. Load and tst csg to 600 psi for 30 min and chart for the NMOCD.
6. RDPU. Clean Location. Well is T&A'd. Rig on well 44 work days. Spend \$300,000 trying to fish ESP cable.

Rig Up Date: 10/20/2005

Rig Down Date: 12/19/2005

OC FIELD REPRESENTATIVE II/STAFF MANAGER

This Approval of Temporary  
Abandonment Expires 12/19/10

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or

closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved ☐ plan

SIGNATURE

Robert Gilbert

TITLE

Workover Completion Specialist

DATE

12/20/2005

TYPE OR PRINT NAME

Robert Gilbert

E-mail address:

robert\_gilbert@oxy.com

TELEPHONE NO.

505/397-8206

For State Use Only

APPROVED BY

Gary W. Wink


OC FIELD REPRESENTATIVE II/STAFF MANAGER

TITLE

DATE

DEC 29 2005

CONDITIONS OF APPROVAL IF ANY:

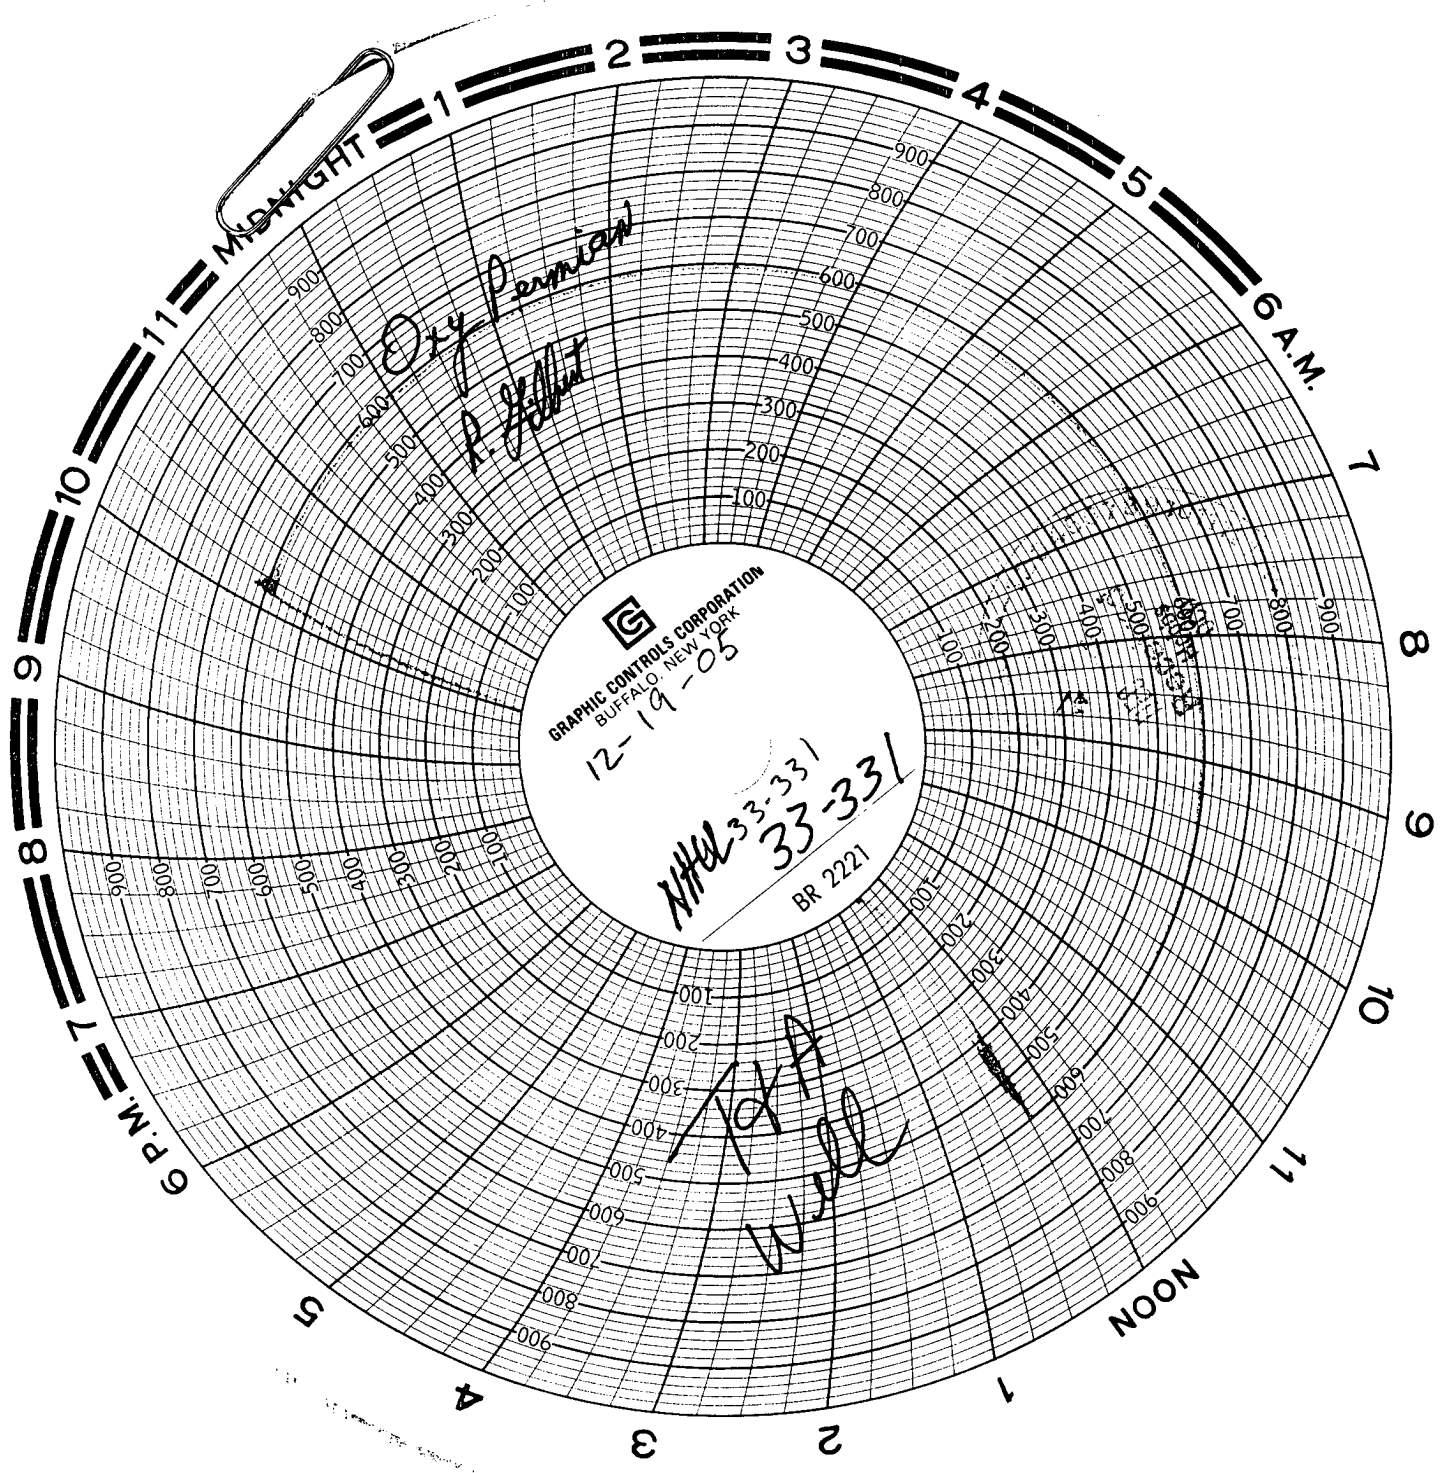

GRAPHIC CONTROLS CORPORATION  
BUFFALO, NEW YORK  
12-19-05

33-331  
33-331  
BR 2221

10 A  
WILL

Dry Pennian  
P. J. J. J.