
Submit 3 Copies To Appropriate District Office District I State of New Mexico Energy, Minerals and Natural Resources May 27, 2004	
District I Energy, Minerals and Natural I 1625 N. French Dr., Hobbs, NM 88240	Resources May 27, 2004 WELL API NO.
District II ON GERMATION DI	20.025.07169
1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DI	VISION 5 Indicate Type of Lease
District III 1220 South St. Francis 1000 Rio Brazos Rd., Aztec, NM 87410	Dr. STATE FEE X
District IV Santa Fe, NM 8/503	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG B DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SU	ICH
PROPOSALS.)	IVI. IVI. FIGHTS
1. Type of Well: Oil Well Gas Well Other SWD	8. Well Number
2. Name of Operator Platinum Exploration Inc	9. OGRID Number 227103
3. Address of Operator	10. Pool name or Wildcat
550 W. Texas, Suite 500 Midland, TX 79701 432-687-1664	SWD; Devonian (96101)
4. Well Location	
Unit LetterD: 660 feet from the North	line and660feet from the West line
Section 8 Township 12S Rang	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3869' GR	
Pit or Below-grade Tank Application or Closure	
Pit type Depth to Groundwater Distance from nearest fresh water	well Distance from nearest surface water
Pit Liner Thickness: mil Below-Grade Tank: Volume	bbls; Construction Material
12. Check Appropriate Box to Indicate Natur	e of Notice, Report or Other Data
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
	MEDIAL WORK ALTERING CASING
TEMPORARILY ABANDON	DMMENCE DRILLING OPNS. P AND A
PULL OR ALTER CASING MULTIPLE COMPL CA	SING/CEMENT JOB
OTHER: OT	HER: log/acidize 🏻 🖂
12 Describe ground an architectural (Cl. 1 et al.)	
13. Describe proposed or completed operations. (Clearly state all perting of starting any proposed work). SEE BULE 1103. For Multiple Co.	lent details, and give pertinent dates, including estimated date
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.	
or recompletion. SWD - 991	
12/20/05-1/3/06 - RIH & tag sand - Dump 350 gal sand while trickling wtr dwn tbg @ ¼ BPM. Pmp 5 Bbl fresh wtr on top of sand, & POOH. RU Rotary WL, & tag sand @ 12,196'. Dump 2 bailers of cmt (apx 40'). RIH w/ FS, 7 jts 4 ½" 11.60# FL4S	
Inr & Inr entry guide, setting tool & 10 jts 2 3/8" L80 EUE 8rd tbg inside 4 ½" Inr, & latch into float shoe. Cont in hole w/ xo, & 365 jts 2 7/8" L80 EUE 8rd tbg. Tag cmt @ 12,158' -Prs up to 4,000 psi, sting out of shoe, & spot 10 Bbl 16# Class H cmt to	
btm of the w/ 55 Rbl fresh wtr. Sting back into shoo 8 displace w/ 42	Sting out of shoe, & spot 10 Bbl 16# Class H cmt to
btm of tbg w/ 55 Bbl fresh wtr. Sting back into shoe, & displace w/ 13 Bbl wtr (68 Bbl flush total). POOH & prs up on csg to 1,000 psi. RIH w/ 4 5/8" mill tooth bit, 2 – 3 ½" drill collars & 359 jts 2 7/8" L80 EUE 8 rd tbg. Tag cmt @ 11,709' ,RU swivel	
and drill out hard cmt from 11,706' to top of 4 ½" FJ liner @ 11,869' &	test liner top to 1000 psi for 15 min. lose 0 psi in 5 min.
10 psi in 10 min, &15 psi in 15 min. Drill out float shoe @ 11,157' -11,	158'-drill out soft cmt f/ float shoe to 12, 196'. Fall out
of cmt @ 12,196' & wash out sand to TD @ 12,716, POOH. Press up to 1000# - Lose 50 psi in 1 min. 100 psi in 2 min. 150	
psi in 3 min, 200 psi in 4 min, 250 psi in 5 min. RIH w/ 4 ½" pkr. profile	e nipple. & on/off tool. & 10 its 2 7/8" L80 FUF 8rd
plastic coated the w/ turned dwn collars. Clean threads, & tally 3 ½" of	s hydrill tbg. RIH w/ WL & log open hole from 12716-
12158'. Pump 20000 gal 15% HCL acid @ ave rate 15.9 BPM & ave	ors 4199 psi – ISIP vac.
I hereby certify that the information above is true and complete to the best of	my knowledge and belief. I further certify that any pit or below-
grade tank has been/will be constructed or closed according to NMOCD guidelines [], a g	eneral permit [] or an (attached) alternative OCD-approved plan [].
SIGNATURE SIGNATURE A	gentDATE1/6/06
Type or print name Debbie Freeman ddress: debbief@t3wire	eless.com Telephone No. 432-687-1664
APPROVED BY Z (QUALUM LUMAND) OF FIGHT PROVENTIVE WASTATT WARNESS DATE	
Conditions of Approval (if arty):	
U	·

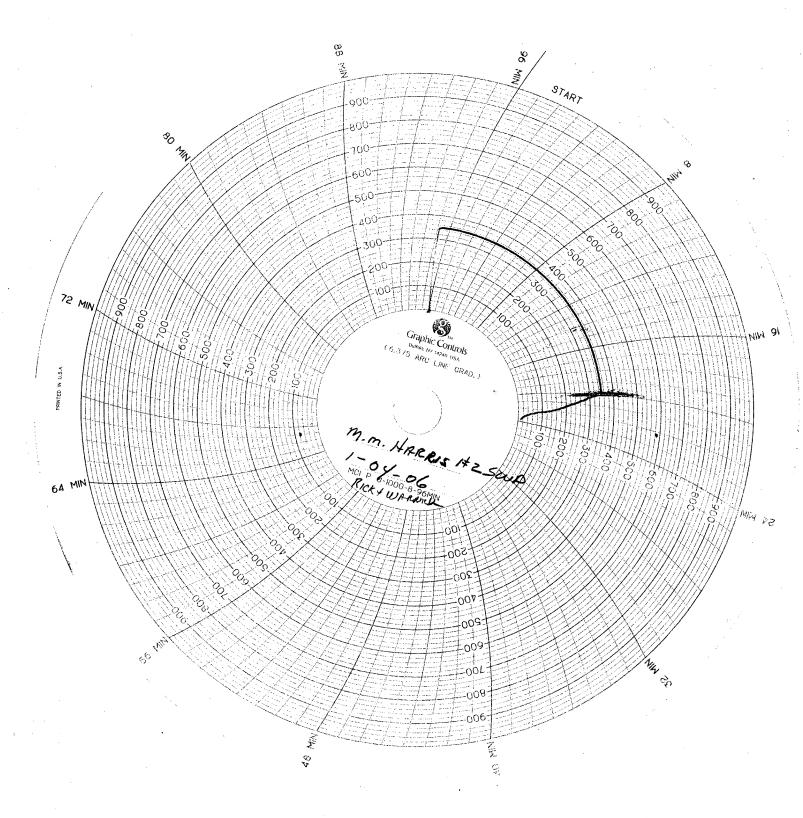

SOME STATE WELL IN PLATINUM MM HARRIS #SWIN