

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised May 08, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505


WELL API NO. <u>30-025-21212</u>
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. <u>NM 058102</u>
7. Lease Name or Unit Agreement Name <u>Flying M SA Unit</u>
8. Well Number <u>Tract 25 #2</u>
9. OGRID Number
10. Pool name or Wildcat <u>Flying M San Andres</u>

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☐ Gas Well ☒ Other <u>Water Injection Well</u>	
2. Name of Operator <u>Southwest Royalties, Inc.</u>	
3. Address of Operator <u>P.O. Box 11390 Midland, Tx 79702</u>	
4. Well Location Unit Letter <u>F</u> : <u>1840</u> feet from the <u>North</u> line and <u>1840</u> feet from the <u>West</u> line Section <u>28</u> Township <u>9S</u> Range <u>33E</u> NMPM <u>10a</u> County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) <u>9340' GR</u>	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐	REMEDIAL WORK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐ PLUG AND ☐
PULL OR ALTER CASING ☐ MULTIPLE ☐	ABANDONMENT
COMPLETION	CASING TEST AND ☐
OTHER: ☐	CEMENT JOB
OTHER: ☐	OTHER: <u>Repair tubing leak</u> ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See attached report & pressure test chart.

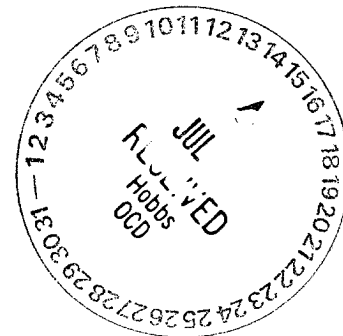

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Area Supervisor DATE 07/14/03

Type or print name C.M. Blodworth, P.E. Telephone No. (432)-686-9927

(This space for State use)

APPROVED BY [Signature] OC FIELD REPRESENTATIVE II/STAFF MANAGER JUL 16 2003

Conditions of approval, if any:

Operator: Southwest Royalties, Inc.
Well: **Flying M Tract 25-2**
Location: Sec 28, T9S, R33E
Lea County, NM
Field: Flying M (San Andres)


07-01-03 MI RU WSU; OWU on vac; chg out nips on WH; ND WH; NU BOP; POH w/138 jts J-55 tbg @ 4266' + AD-1 pkr; bad pipe and pkr. SDON.

07-02-03 TIH w/138 jts; TOH; LD tbg; PU bit scraper & 142 jts N-80 WS; tag fill @ 4440'; POH LD tools; SDON.

07-03-03 TIH w/bailer @ 141 jts tbg; CO to 4462'; PU WO tag @ 4440'; unable to go past 4440'; TOH w/tbg and bailer and LD tool. PU TIH w/impression block @ 142 jts tbg; tag @ 4440'; TOH w/tbg & block; inspect block; indicates csg corroded; TOH w/WS; LD WS. SDON.

07-04-03 PU Baker Loc-set pkr, on/off tool, SN; TIH w/pkr & tbg; pkr kept setting; TOH w/pkr and tbg; PU new pkr; TIH w/Baker Loc-set, 4-1/2" X 11.0 X 13.0, on/off tool, 3-3/4" X 1.78X 2-3/8, SN and 132 jts PC tbg; set pkr @ 4325'; tst csg 350# 10 a.m.; got off on/off tool; circ hole w/2% KCL; latch on on/off tool; ran MIT chart 400# - 30 mins; tst OK; ND BOP; NU WH; start injection.

07-05-03 Well on injection; **WELL DROPPED FROM REPORT.**

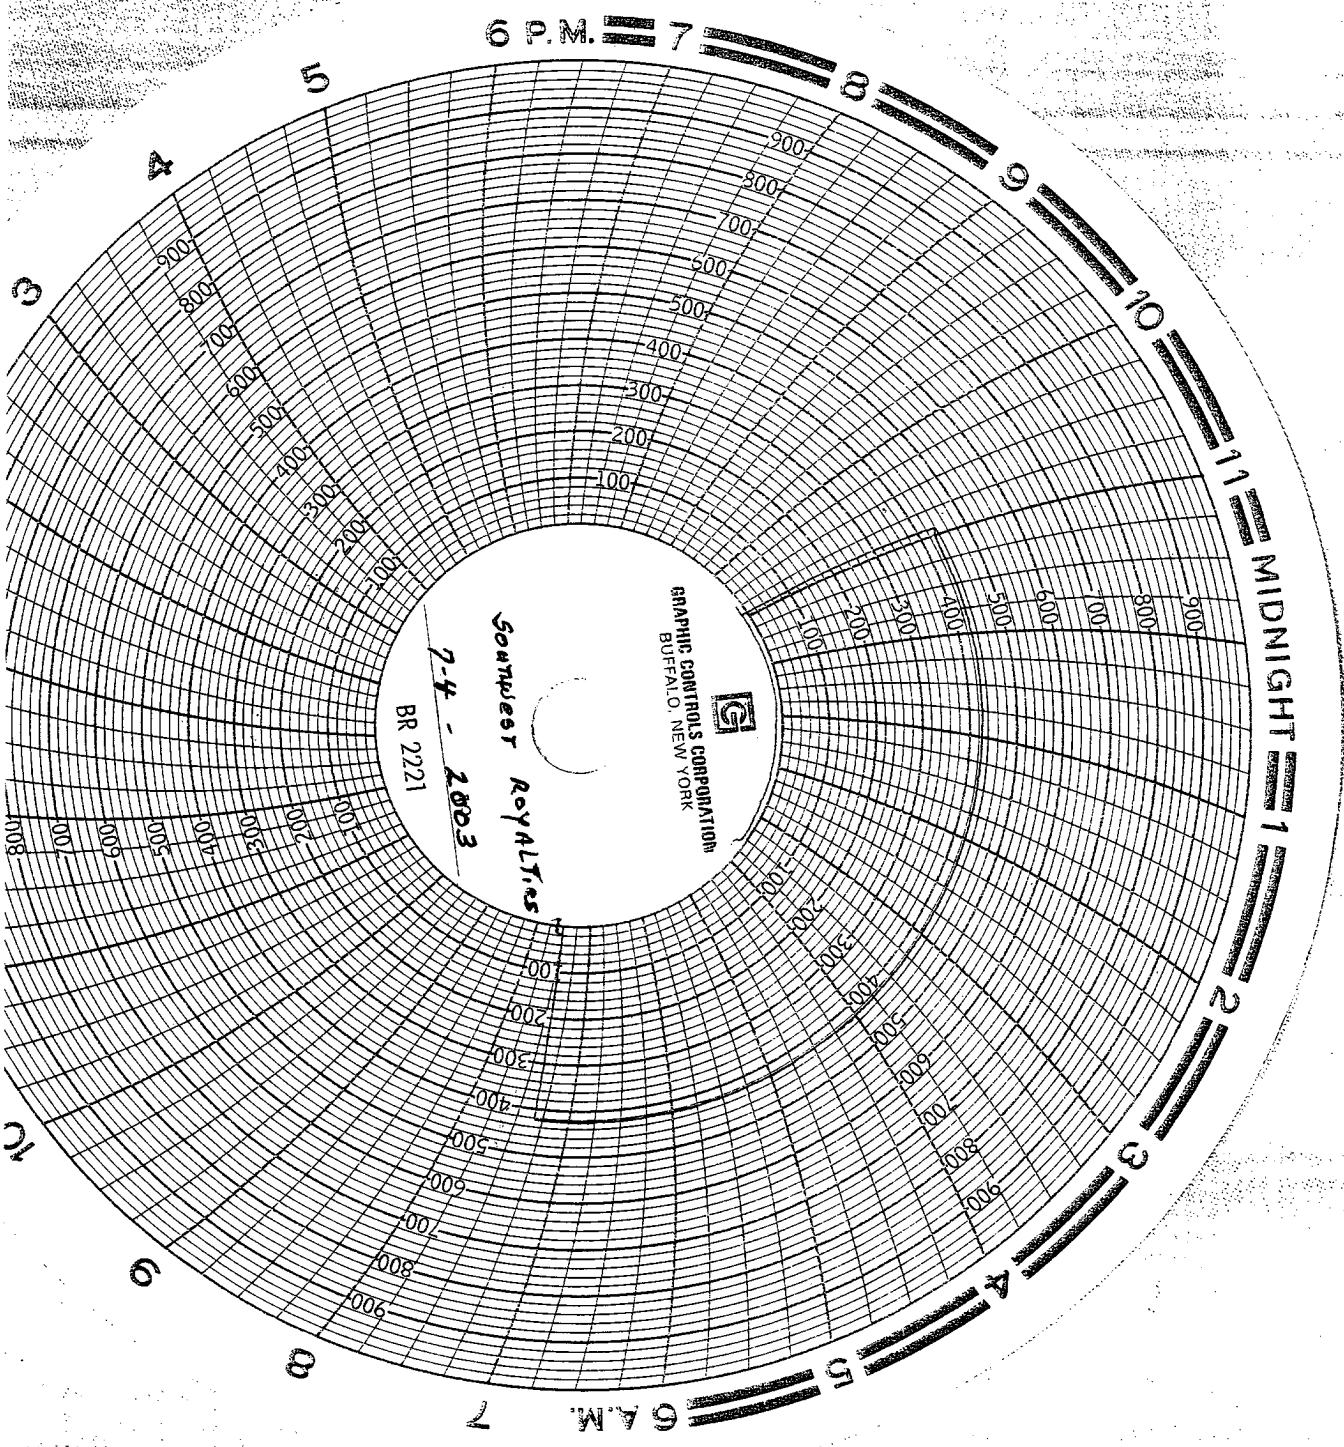

Southwest Royalties
7-4 - 2003
BR 2221

ROYALTYES
SOUTHWEST UNIT
FLYING 25 WCLL
TRACT 1840 FWR
UNIT F
1840 FNL
GCC 28, T-9-S, R-33E