

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-27921
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name STATE DT
8. Well Number 1
9. OGRID Number 020451
10. Pool name or Wildcat Jalmat, TN (33820)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

SDX RESOURCES, Inc.

3. Address of Operator

P.O. Box 5061, Midland, TX 79704

4. Well Location

Unit Letter **I**: **2310** from the **SOUTH** line and **330** feet from the **EAST** line

Section **26** Township **22 S** Range **35E** NMPM **Lea** County **NM**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type Line Dirt _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ P AND A ☒


CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1-31-06 M.I. R.U. Buddy Hill, N.M.O.C.D. notified of P. & A. Could not get past 990' w/ 5 1/2" gauge ring. P.O.O.H. w/Wireline and T.I.H. w/4 3/4" bit to 3,700'.
- 2-1-06 Set 5 1/2" C.I.B.P. @ 3,660'. T.I.H. tag C.I.B.P. w/tbg. Circulate hole w/10# M.L.F. Spot 25 sx. cmt. Csg. standing full and tested @500#. O.K. No tag on cement plug. O.K. per Buddy Hill. Pull tbg. to 1,352'. Spot 35 sx. cmt. W.O.C.
- 2-2-06 Tag T.O.C. @1,051'. Spot 25 sx. cmt. 400'. No tag required, per Buddy Hill. Pull out of hole w/tbg. N.D. B.O.P. Spot 10 sx. to surface. Plug & install dry hole marker.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

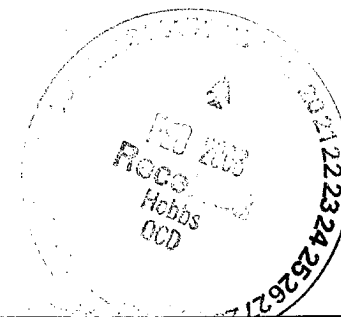

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOC guidelines ☐, a general permit ☐ or an (attached) alternative OGD-approved plan ☐.

SIGNATURE Randall Minear

TITLE: Agent

DATE: 2-10-06

Type or print name

E-mail address: roger.massey@basicenergyservices.com

Telephone No.: (432) 530-0907

For State Use Only

RANDALL MINEAR

OIL FIELD REPRESENTATIVE II/STAFF MANAGER

FEB 20 2006

APPROVED BY: Ray W. Wink

TITLE

Conditions of Approval (if any):