

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-025-20563

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

E-9721

7. Lease Name or Unit Agreement Name:

NEW MEXICO "CR" STATE

8. Well No.

1

9. Pool name or Wildcat

LUSK; DELAWARE

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

MARBOB ENERGY CORPORATION

3. Address of Operator

PO BOX 227, ARTESIA, NM 88211-0227

4. Well Location

Unit Letter D : 660 feet from the NORTH line and 660 feet from the WEST line

Section 32 Township 19S Range 32E NMPM County LEA

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

3542' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

MARBOB ENERGY CORPORATION PROPOSES TO PLUG & ABANDON THIS WELL AS FOLLOWS:

WILL NOTIFY OCD 24 HOURS BEFORE STARTING PLUGGING.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

1. POOH W/ TUBING

2. SET 4 1/2" CIBP @ 4500' (PERF @ 4548'-4566')

3. CUT & PULL 4 1/2" CASING

4. SPOT 100' PLUG ACROSS STUB 50' IN 50' OUT - TAG

5. SPOT 100' PLUG @ 3950' (8 5/8" SHOE @ 3900'), WOC, TAG

6. SPOT 100' PLUG @ 2260' (B SALT @ 2210'), WOC, TAG

7. SPOT 100' PLUG @ 1040' (T SALT @ 990'), WOC, TAG

8. SPOT 100' PLUG @ ~~975'-875'~~ - TAG → SPOT 100' PLUG F/400'-300'

9. SPOT 60' PLUG FROM 60' TO SURFACE

10. CUT OFF WELL HEAD, INSTALL DRY HOLE MARKER

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Diana J. Cannon TITLE PRODUCTION ANALYST DATE 7/16/03

Type or print name DIANA J. CANNON

Telephone No. (505) 748-3303

(This space for State use)

APPROVED BY Diana J. Cannon TITLE PRODUCTION ANALYST

Conditions of approval, if any:

DATE JUL 18 2003

VUC 11 IVRW 1012X100 L15 JTL 1

Kern: 11 174

Location: 660' FNL, 660' FNL
 D-32-19s-32e
 Lea Co., NM

KB: 3562'


GL: 3545

Casing Program:

Size	Wt.	Grade	Conn.	Depth
11 3/4"	31.2	SW		925'
8 5/8"	24	J55		3900'
4 1/2"	10.6	N80		11495'

Cement Coverage Summary:

10500' to 11495' (Wolfcamp - Strawn)
 ±7626' to ±9452' (Bone Spring)
 5250' to ±6500' } (Delaware)
 4388' to ±4900' }

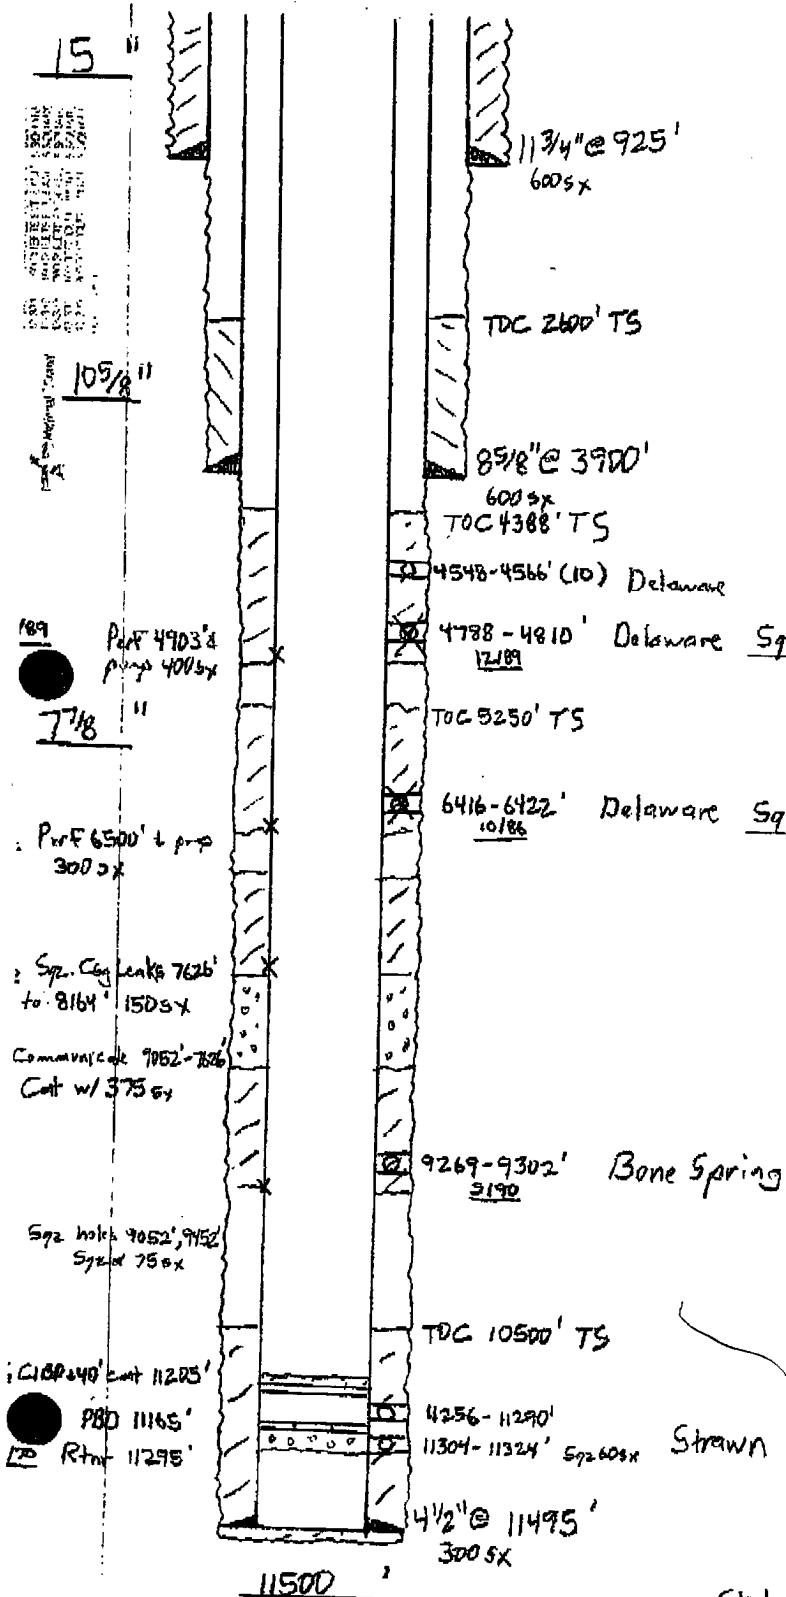

AFTER

— Sketch Not To Scale —

KBC Collins / 20 Sept 02