

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

NMOCD  
Hobbs

FORM APPROVED  
OMB NO. 1004-0135  
Expires: July 31, 2010

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*

5. Lease Serial No.  
NMNM128927

6. If Indian, Allottee or Tribe Name

**SUBMIT IN TRIPLICATE - Other instructions on reverse side.**

7. If Unit or CA/Agreement, Name and/or No.  
NMNM125386A

8. Well Name and No.  
RED HILLS WEST UNIT 009H

9. API Well No.  
30-025-42705-00-X1

10. Field and Pool, or Exploratory  
JENNINGS

11. County or Parish, and State  
LEA COUNTY, NM

1. Type of Well  
 Oil Well  Gas Well  Other

2. Name of Operator  
MEWBOURNE OIL COMPANY  
Contact: JACKIE LATHAN  
E-Mail: jlathan@mewbourne.com

3a. Address  
HOBBS, NM 88241  
3b. Phone No. (include area code)  
Ph: 575-393-5905

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
Sec 8 T26S R32E SWSW 330FSL 380FWL

HOBBS OCD  
NOV 30 2015  
RECEIVED

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	Drilling Operations
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

8/05/2015 Spud 17 1/2" hole. TD hole at 1132'. Ran 1132' of 13 3/8" 54.5# J55 ST&C Csg. Cemented with 750 sks Class C w/ additives. Mixed @ 13.5#/g w/1.75 yd. Tail w/ 200 sks Class C w/ 1% CaCl2. Mixed @ 14.8#/g w/ 1.75 yd. Plug down @ 9:00 a.m. 8/07/2015. Circ 155 sks of cmt to the pit. WOC. At 7:00 a.m. 8/08/15, tested BOPE & csg to 1500# for 30 min, held OK. Drilled out w/ 12 1/4" bit.

Charts and schematic attached.

Bond on file: NM1693 nationwide & NMB000919

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #315069 verified by the BLM Well Information System  
For MEWBOURNE OIL COMPANY, sent to the Hobbs

Committed to AFMSS for processing by JENNIFER SANCHEZ on 10/29/2015 (16JAS0048SE)

Name (Printed/Typed) JACKIE LATHAN

Title AUTHORIZED REPRESENTATIVE

Signature (Electronic Submission)

Date 09/01/2015

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved By <b>/S/ DAVID R. GLASS</b>	Title	Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office	<i>KE</i>

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

**\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\***

DEC 10 2015

*jm*

# MAN WELDING SERVICES, INC

Company MEWBOURNE Date 8.8.15

Lease RED Hills WEST UNIT # 0094 County LEA

Drilling Contractor PATTERSON 36 Plug & Drill Pipe Size 4 1/2 XH

Accumulator Pressure: 3000 Manifold Pressure: 1500 Annular Pressure: 1000

## Accumulator Function Test - OO&GO#2

### To Check - USABLE FLUID IN THE NITROGEN BOTTLES (III.A.2.c.i. or ii or iii)

- Make sure all rams and annular are open and if applicable HCR is closed.
  - Ensure accumulator is pumped up to working pressure! (Shut off all pumps)
1. Open HCR Valve. (If applicable)
  2. Close annular.
  3. Close **all** pipe rams.
  4. Open one set of the pipe rams to simulate closing the blind ram.
  5. For 3 ram stacks, open the annular to achieve the 50+ % safety factor. (5M and greater systems).
  6. Record remaining pressure 1450 psi. Test Fails if pressure is lower than required.
- a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system }
7. If annular is closed, open it at this time and close HCR.


### To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.)


- Start with manifold pressure at, or above, maximum acceptable pre-charge pressure:
    - a. {800 psi for a 1500 psi system} b. {1100 psi for 2000 and 3000 psi system}
1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure)
  2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to.
  3. Record pressure drop 950 psi. Test fails if pressure drops below minimum.
- Minimum: a. {700 psi for a 1500 psi system } b. {900 psi for a 2000 & 3000 psi system}


### To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)


- Isolate the accumulator bottles or spherical from the pumps & manifold.
  - Open the bleed off valve to the tank, {manifold psi should go to 0 psi} close bleed valve.
1. Open the HCR valve, (if applicable)
  2. Close annular
  3. With pumps only, time how long it takes to regain the required manifold pressure.
  4. Record elapsed time 1 min 12 SEC Test fails if it takes over 2 minutes.
- a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system}




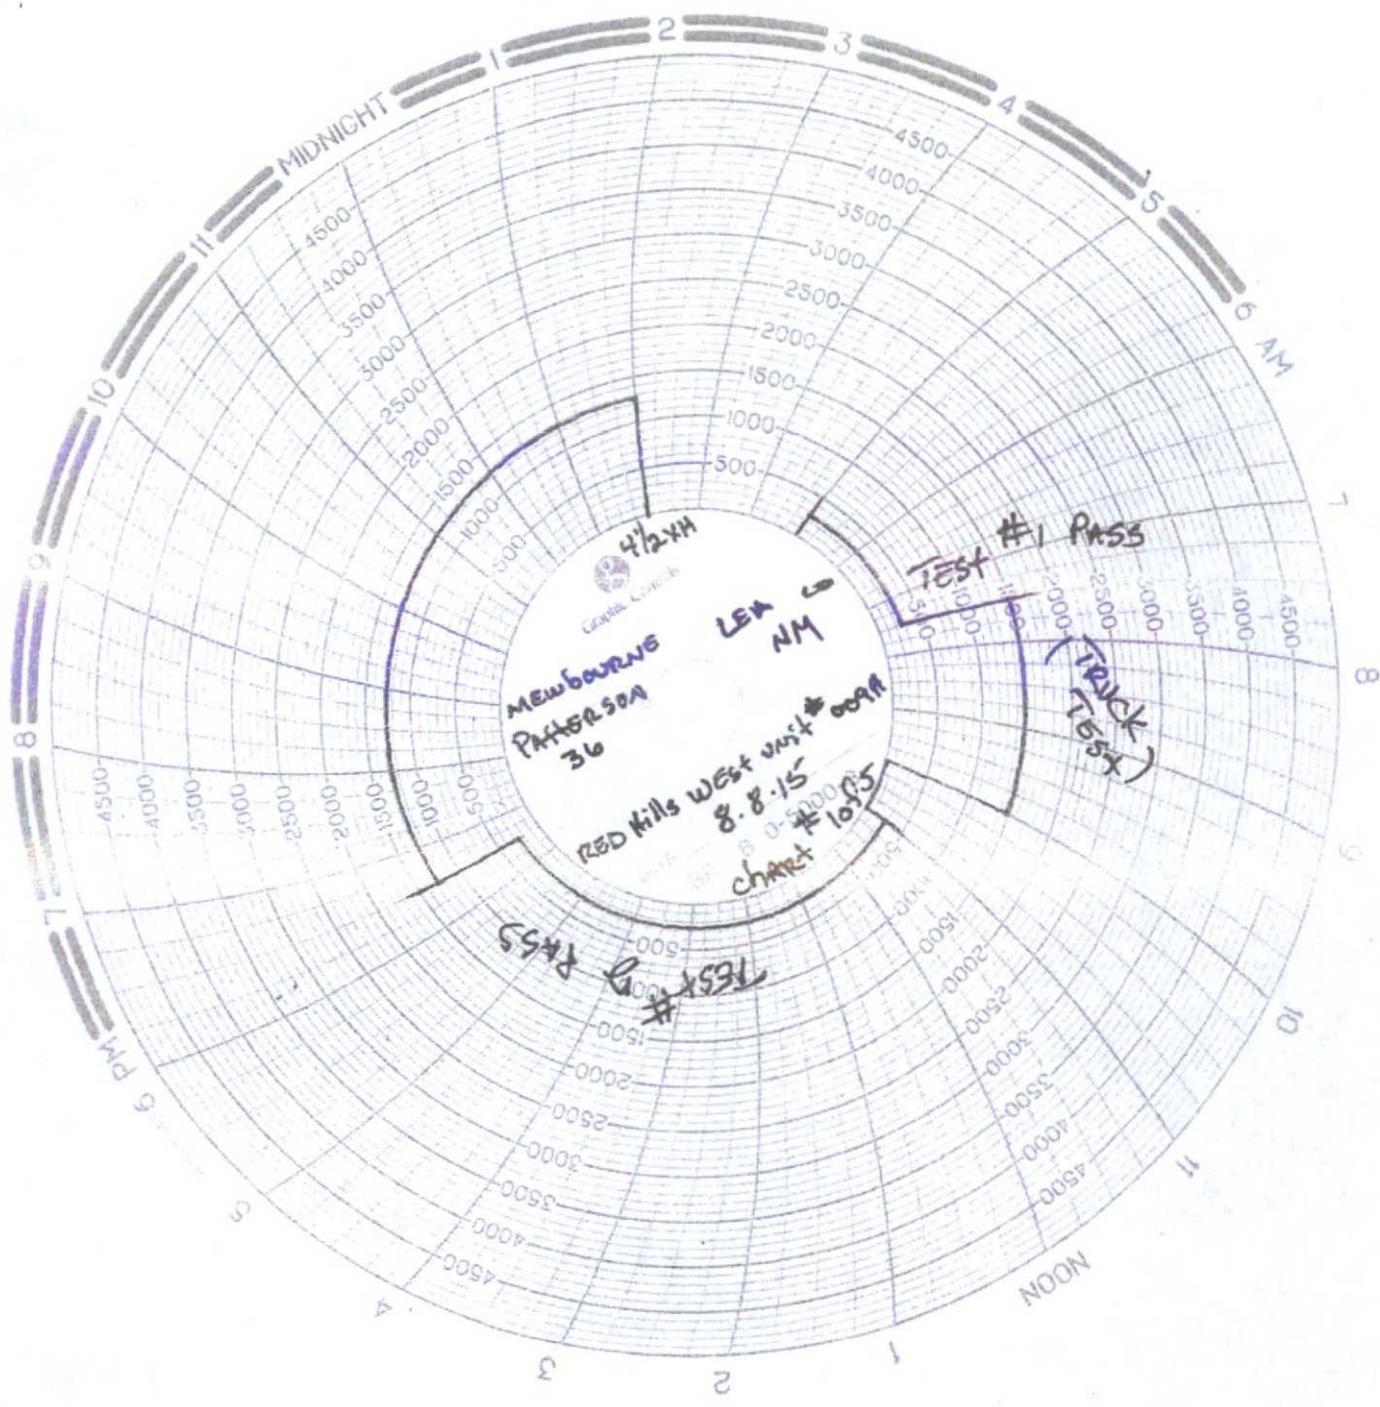

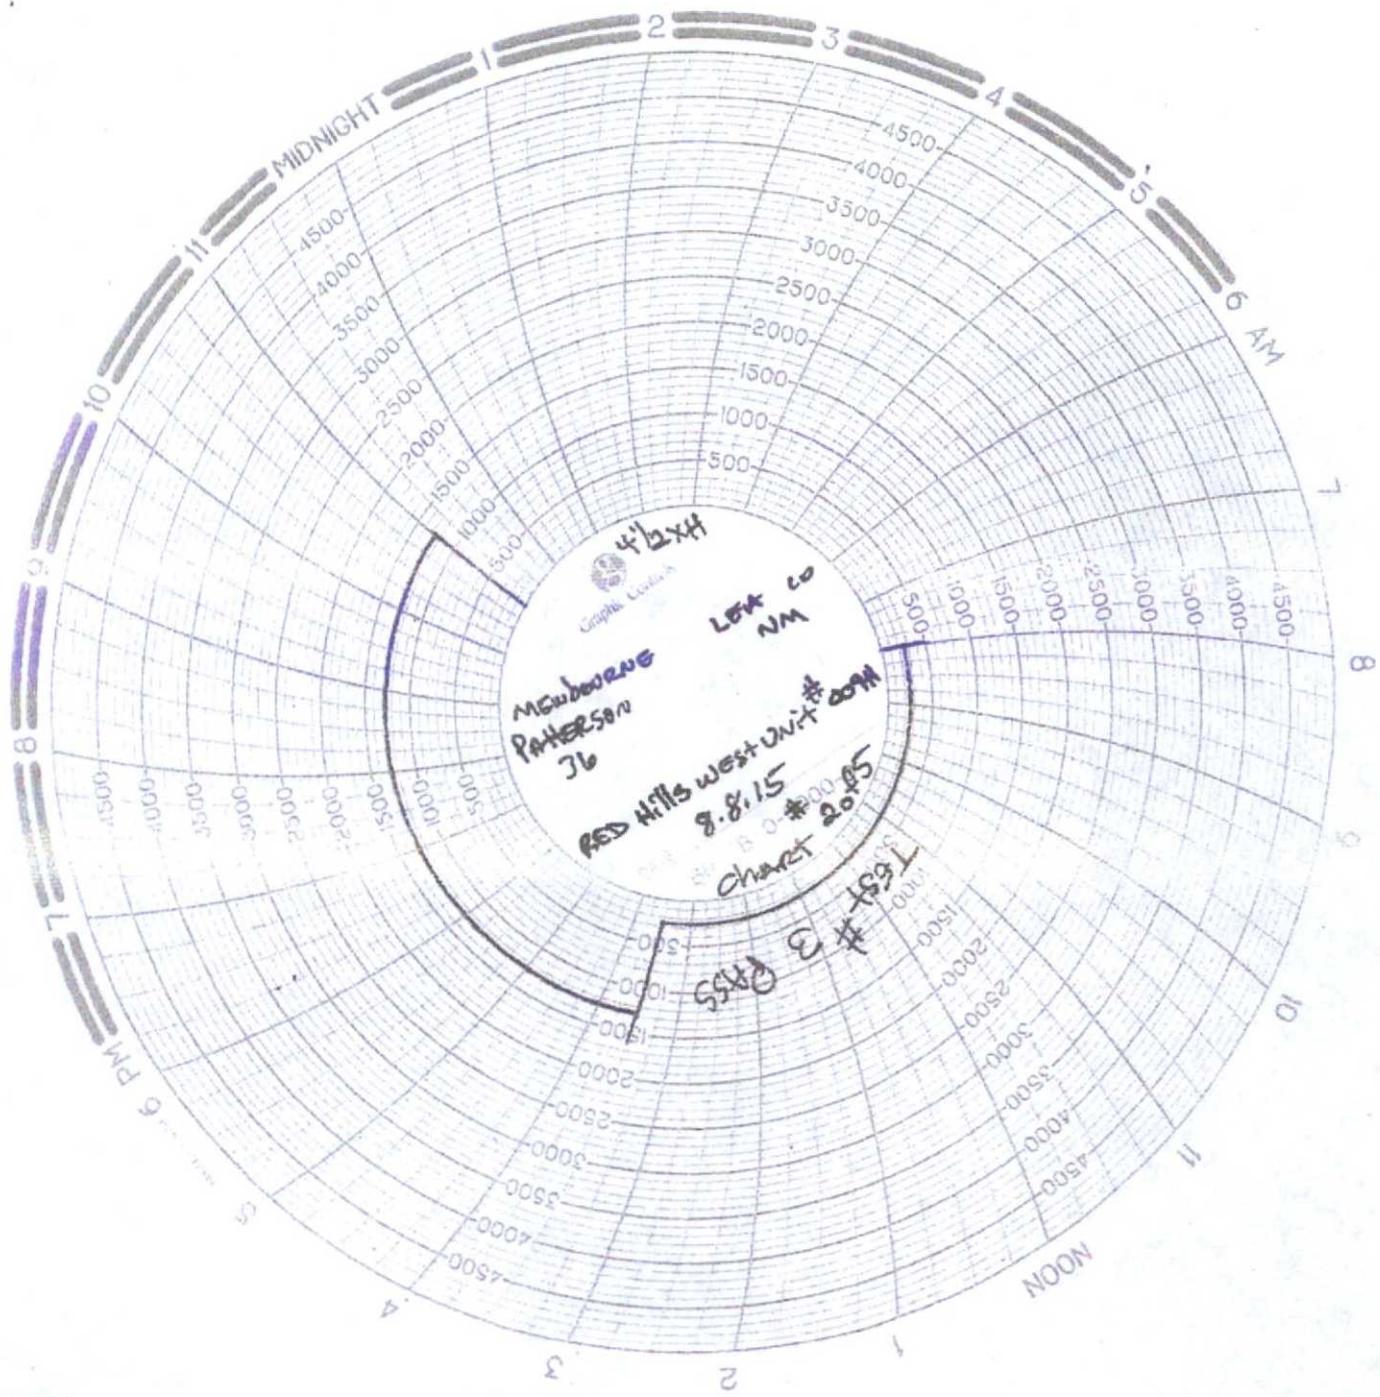

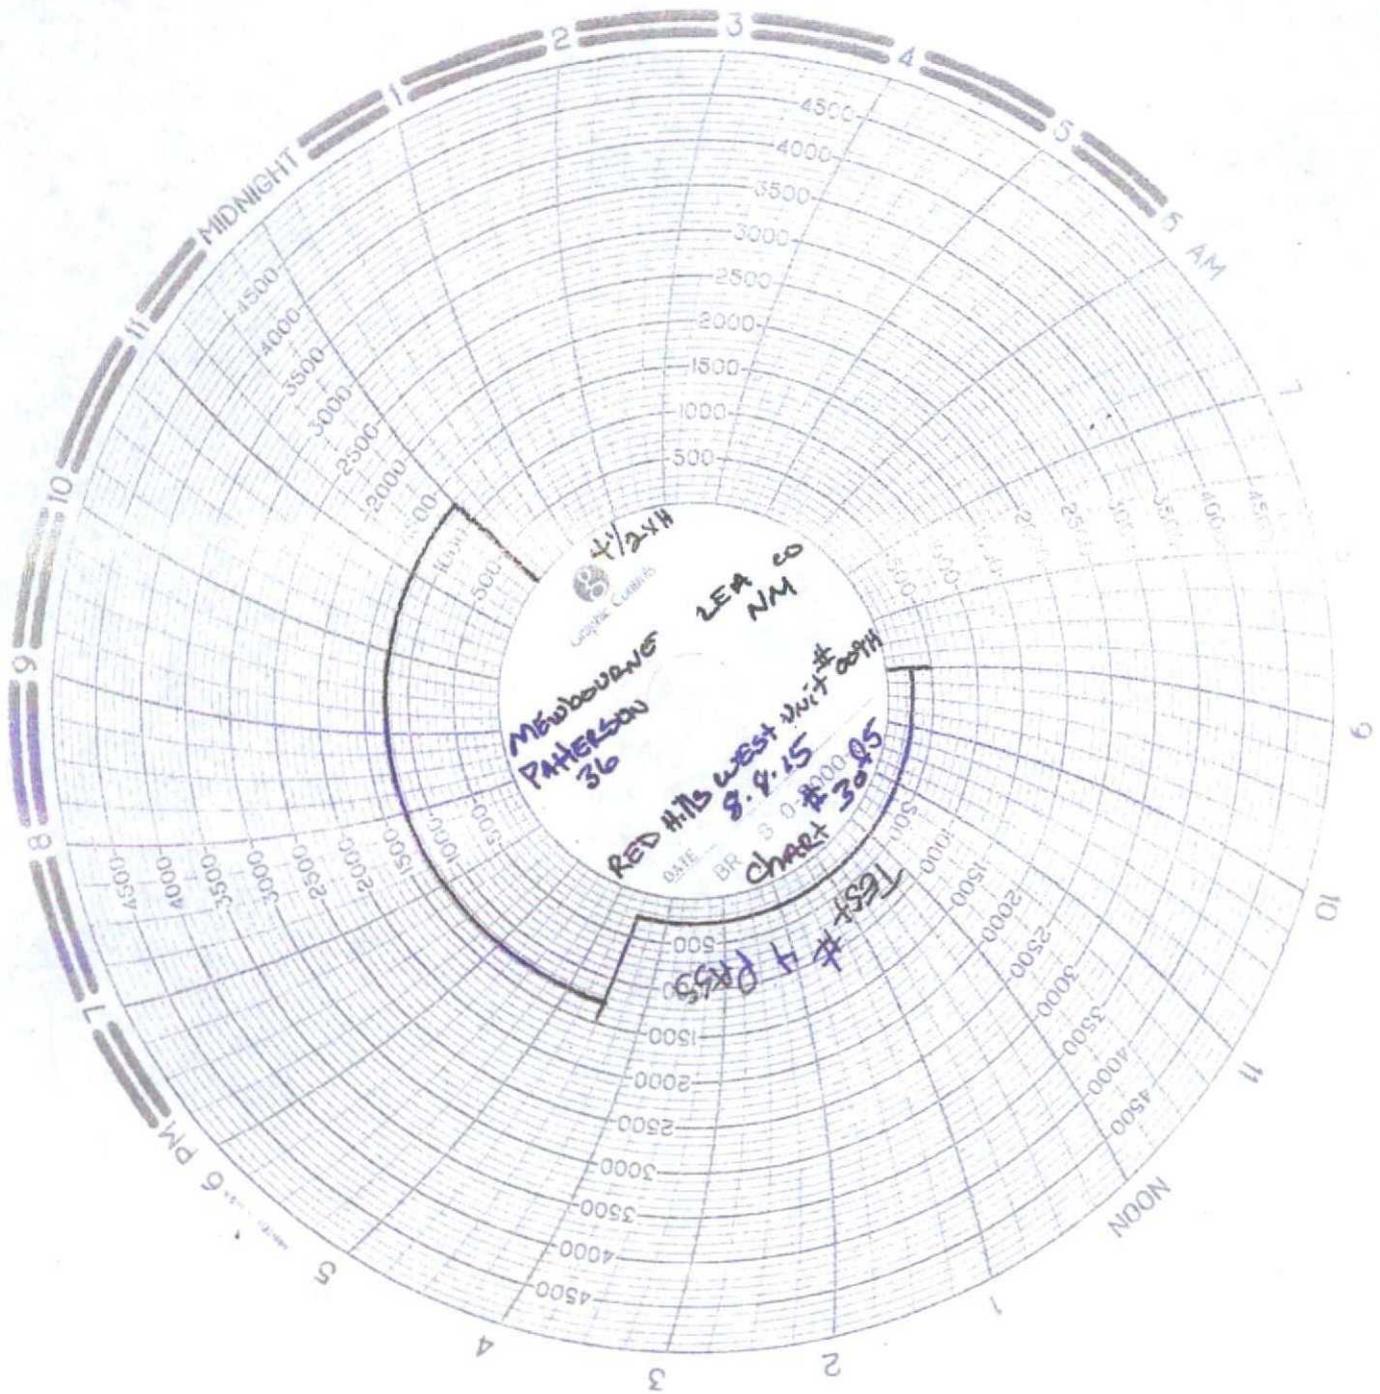

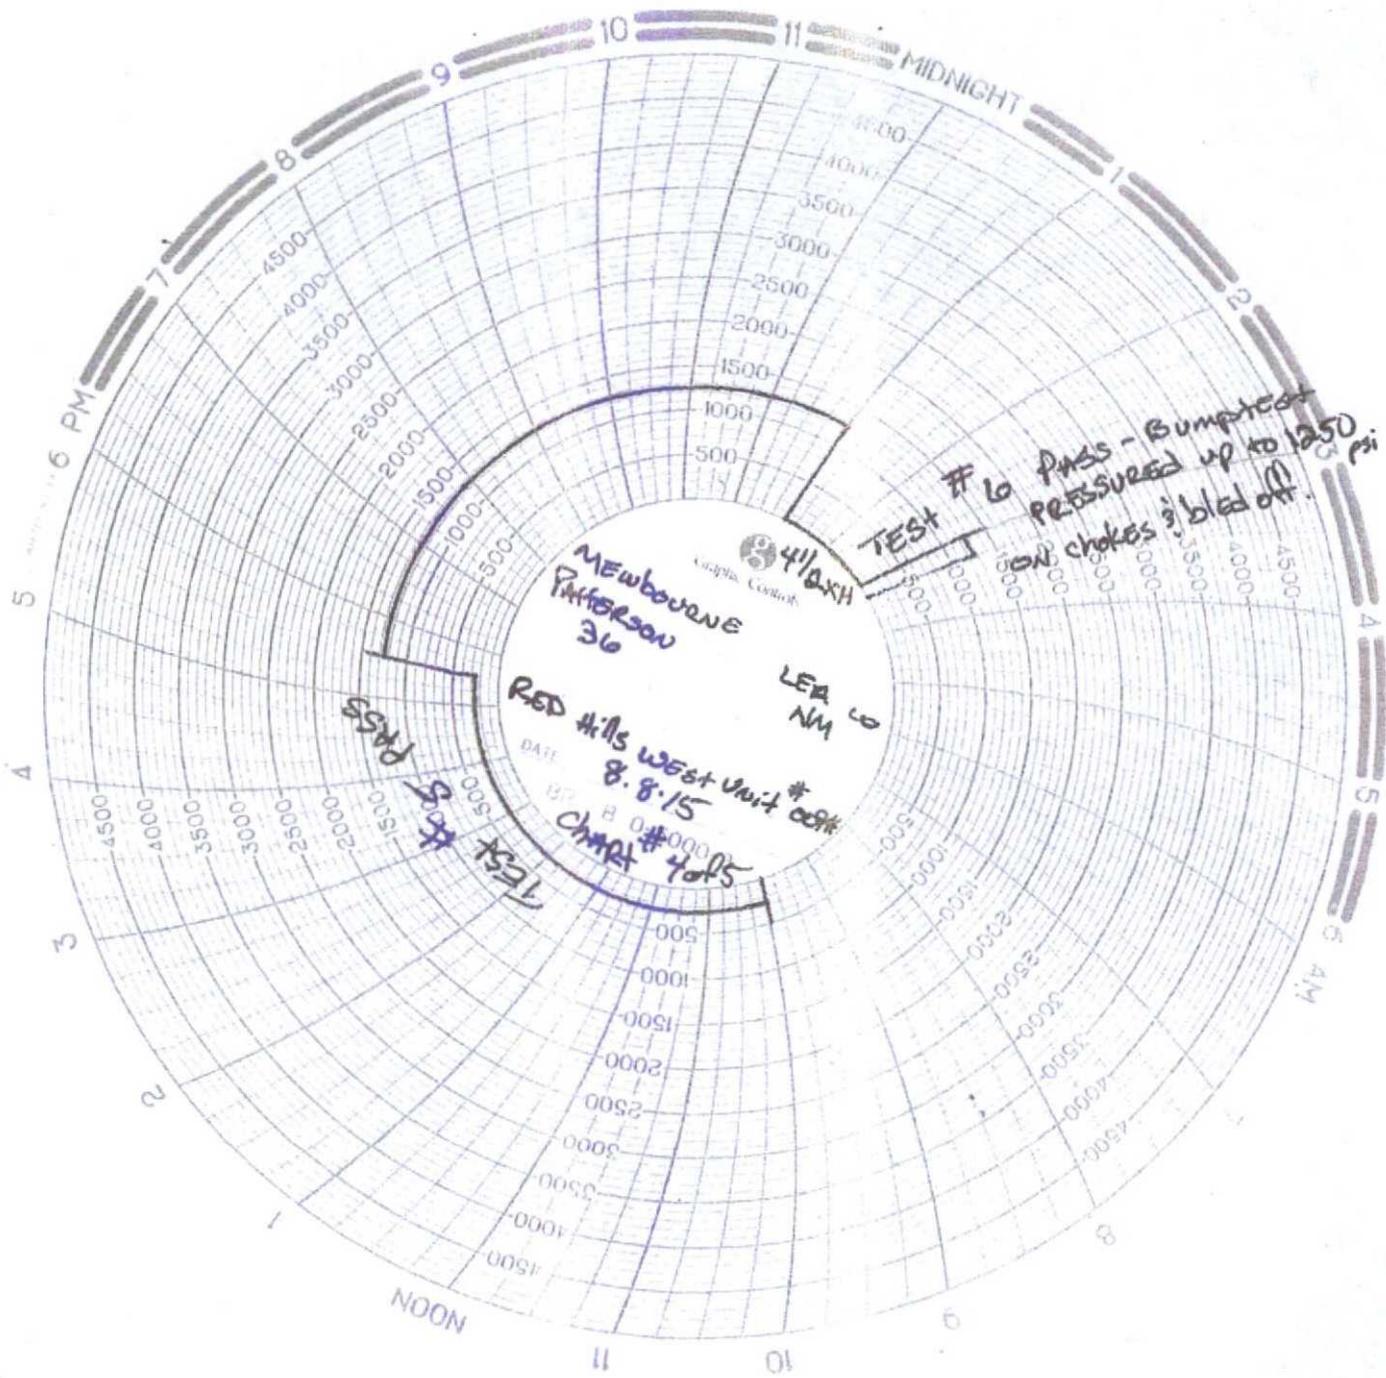

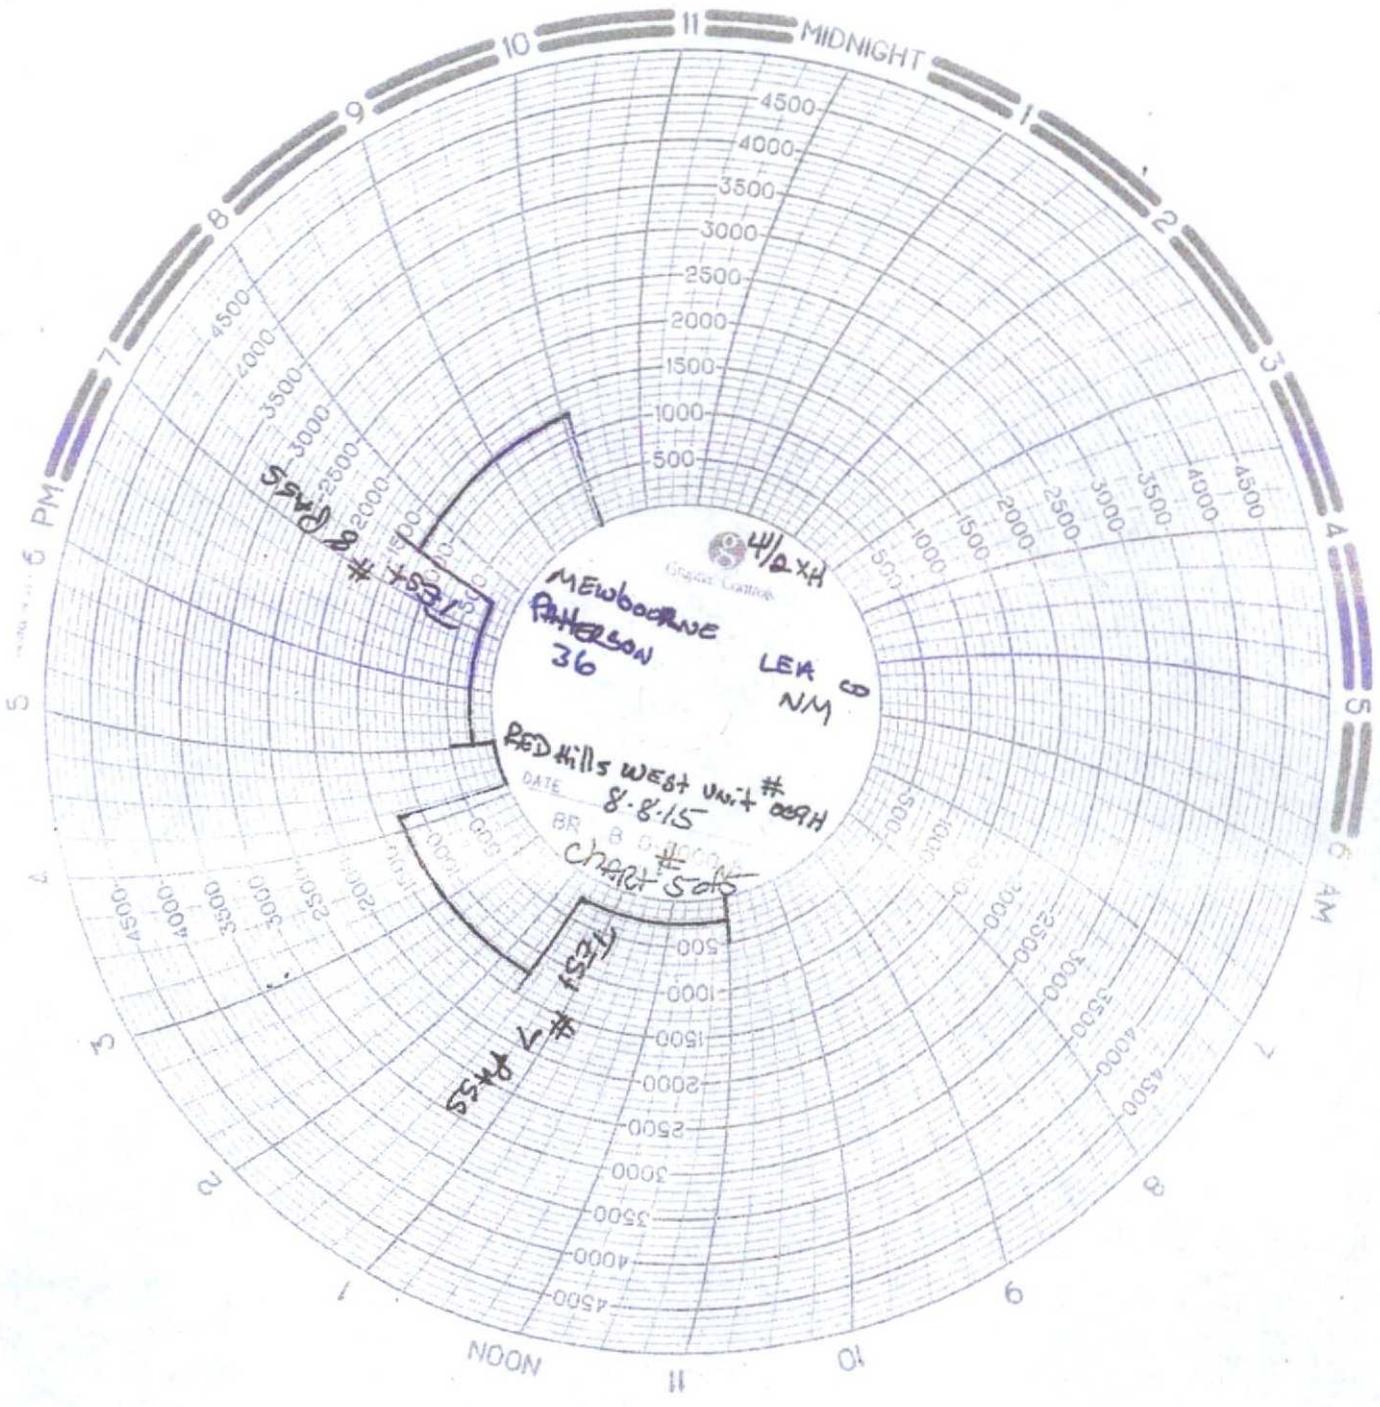

Mewbourne  
Patterson  
36

LEA CD  
NM

RED HILLS WEST UNIT #  
DATE 8-8-15

BR 8 0 0 0 0  
Chart 505

TEST # 7 PASS

4 1/2 XH  
# 1551