

HOBBS OGD

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

AUG 31 2016
RECEIVED

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-36489
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Copperhead 18 State
8. Well Number 1
9. OGRID Number 16696
10. Pool name or Wildcat Johnson Ranch; Wolfcamp, West (Gas)
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3541' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well Gas Well Other

2. Name of Operator OXY USA Inc.

3. Address of Operator P.O. BOX 50250 MIDLAND, TX 79710

4. Well Location
Unit Letter P : 660 feet from the South line and 660 feet from the East line
Section 18 Township 24S Range 29E NMPM County Eddy

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: PLUGBACK <input checked="" type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

RUWL 8/10/16, RIH & tag PBD @ 14110', POOH, RIH & perf @ 13366-13363, 13203-13200' Total 24 holes, POOH, RDWL. 8/17/16 RUWL RIH w/ CIBP and set @ 13410', POOH. RIH & perf @ 13306-13303, 13265-13260, 13257-13251, 13230-13226, 13228-13222' Total 96 Holes, POOH, PU AS1X packer RIH & set @ 13160', RDWL. 8/19/16 RIH w/ 2-3/8" tubing & set @ 13160', pressure test casing to 600# for 15 min, good test. RIH & clean out, flow to clean up and test well for potential.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Regulatory Coordinator DATE 08/26/16


Type or print name Jana Mendiola E-mail address: janalyn_mendiola@oxy.com PHONE: 432-685-5936

For State Use Only Petroleum Engineer

APPROVED BY:  TITLE DATE 08/31/16

Conditions of Approval (if any):

OXY USA Inc. - Current
Copperhead 18 State #1
API No. 30-025-36489

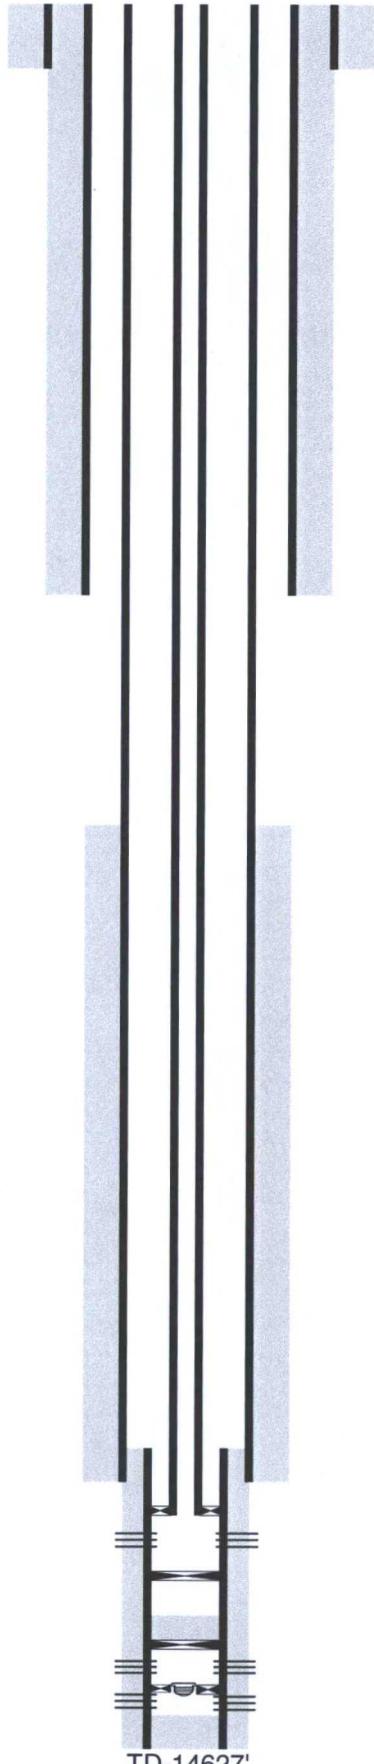

17-1/2" hole @ 727'
13-3/8" csg @ 727'
w/ 575sx-TOC-Surf-Circ

12-1/4" hole @ 5034'
9-5/8" csg @ 5034'
w/ 2900sx-TOC-Surf-Circ

8-3/4" hole @ 12646'
7" csg @ 12646'
w/ 700sx-TOC-7230'-TS

6-1/8" hole @ 14627'
4-1/2" liner @ 12362-14627'
w/ 345sx-TOC-12362'-Circ

2-3/8" tbg & AS1X pkr @ 13160'

CIBP @ 13410'

CIBP @ 14175' w/ 4sx cmt, PBTB 14110'

Model R Pkr @ 14438' w/ blk plug

Perfs @ 13200-13366'

Perfs @ 14228-14388'

Perfs @ 14477-14532'

TD-14627'