

District I - (575) 393-6161

1625 N. French Dr., Hobbs, NM 88240

District II - (575) 748-1283

811 S. First St., Artesia, NM 88210

District III - (505) 334-6178

1000 Rio Brazos Rd., Aztec, NM 87410

District IV - (505) 476-3460

1220 S. St. Francis Dr., Santa Fe, NM

87505

HOBBS OCD

OIL CONSERVATION DIVISION

DEC 21 2016

1220 South St. Francis Dr.

Santa Fe, NM 87505

RECEIVED

WELL API NO.

30-025-26052

5. Indicate Type of Lease

STATE ☒ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Chevron U.S.A. INC.

3. Address of Operator

6301 DEAUVILLE BLVD, MIDLAND, TX 79706 RMN3002

4. Well Location

Unit Letter G : 2227 feet from the NORTH line and 1948 feet from the EAST line
Section 3 Township 22S Range 37E NMPM County Lea11. Elevation (Show whether DR, RKB, RT, GR, etc.)
GR 3395'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☒ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Call and notify NMOCD 24 hrs. before operations begin.
2. MIRU. NDWH. NU BOPE. ^{35'}
3. Set CIBP@6,600', dumpbail ^{35'} or spot 25sx of cement on top.
4. Circulate with packer fluid.
5. ND BOPE. NUWH. RDMO. ³⁰⁺
6. Notify NMOCD to witness test. Chart casing to 500# for 15 minutes.
Closed loop above ground tank system will be used for fluids.

Condition of Approval: notify
OCD Hobbs office 24 hours
prior of running MIT Test & Chart

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE M. Lee Roark TITLE Project Manager DATE 12/20/16Type or print name M. Lee Roark E-mail address: LRoark@Chevron.com PHONE: (432)-687-7279**For State Use Only**APPROVED BY: Mary S Brown TITLE AO/II DATE 12/21/2016

Conditions of Approval (if any):



Chevron U.S.A. Inc. Wellbore Diagram : MARK12WA

Lease: OEU EUNICE FMT

Well No.: MARK 12

Field: FLD-WANTZ

Location: 2227FNL1948FEL

Sec.: N/A

Blk:

Survey: N/A

County: Lea **St.:** New Mexico

Refno: EQ3251

API: 3002526052

Cost Center: UCU522300

Section: E037

Township: 3 S


Range: S022 E

Current Status: ACTIVE

Dead Man Anchors Test Date: 03/29/2007

Directions:

CURRENT

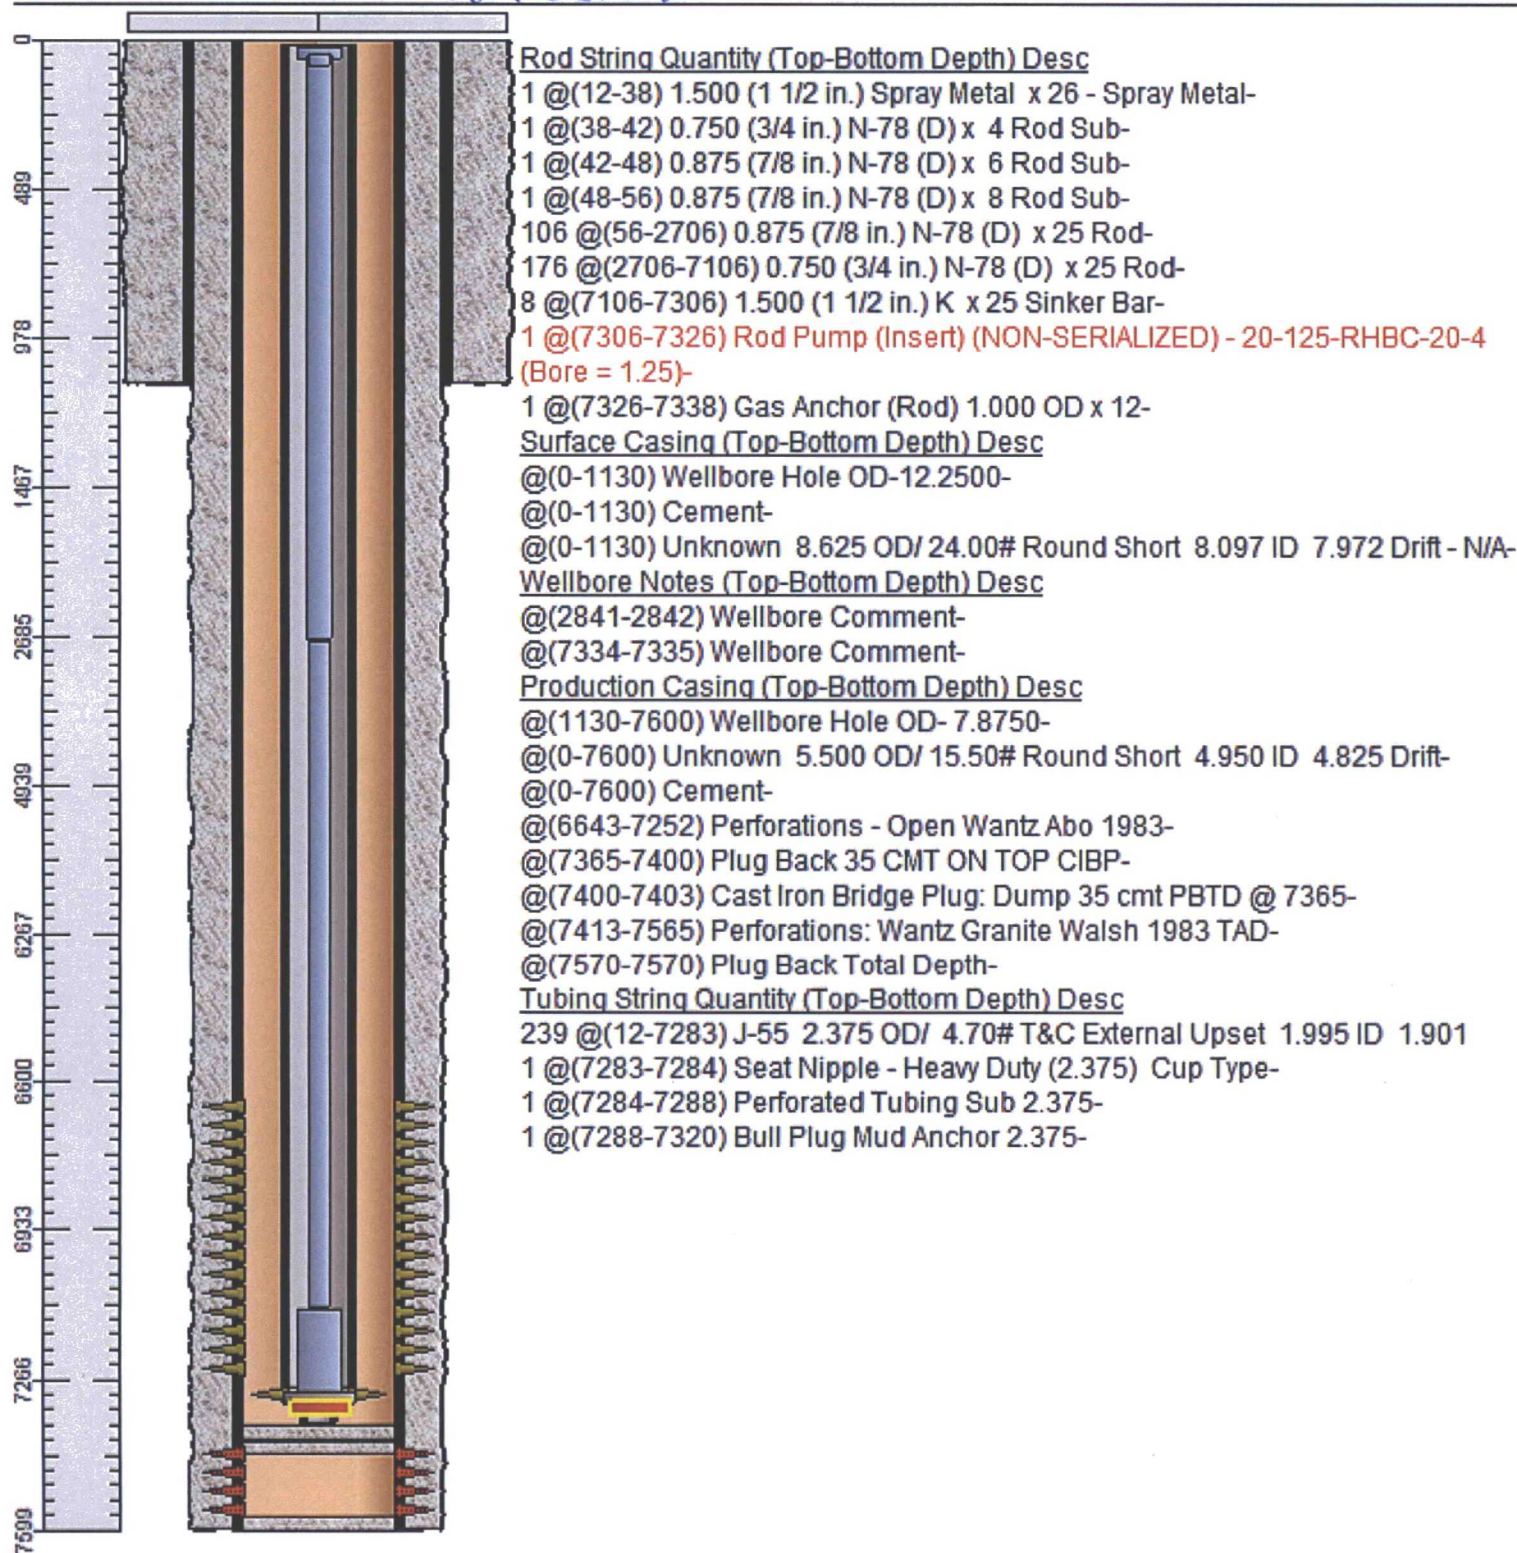

Ground Elevation (MSL): 3394.00

Spud Date: 09/06/1978

Compl. Date: 07/18/1983

Well Depth Datum: Kelly Bushing

Elevation (MSL): 0.00

Correction Factor: 12.00

PROPOSED WELLBORE DIAGRAM

Lease: MARK **Well No:** 12 **Field:** Wantz Abo
Location: 2227' FNL & 1948' FEL 2-T22S-37E
County: Lea **St:** NM **Refno:** _____ **API:** 30-025-26502 **Cost Center:** _____


Surface Csg.

Size: 8-5/8"
 Wt.: 24#
 Set @: 1130'
 Sxs cmt: 550
 Circ: Yes
 TOC: Surf
 Hole Size: 12-1/4"

Production Csg.

Size: 5-1/2"
 Wt.: 15.5#
 Set @: 7600'
 Sxs Cmt: 1700
 Circ: Yes
 Hole Size: 7-7/8"
 PBTD: _____
 TD: 7600'

T.Salt 1210'
 B.Salt 2362'
 Yates 2494'
 San Andres 3870'
 Glorieta 5027'
 Blinberry 5533'
 Abo 6534'

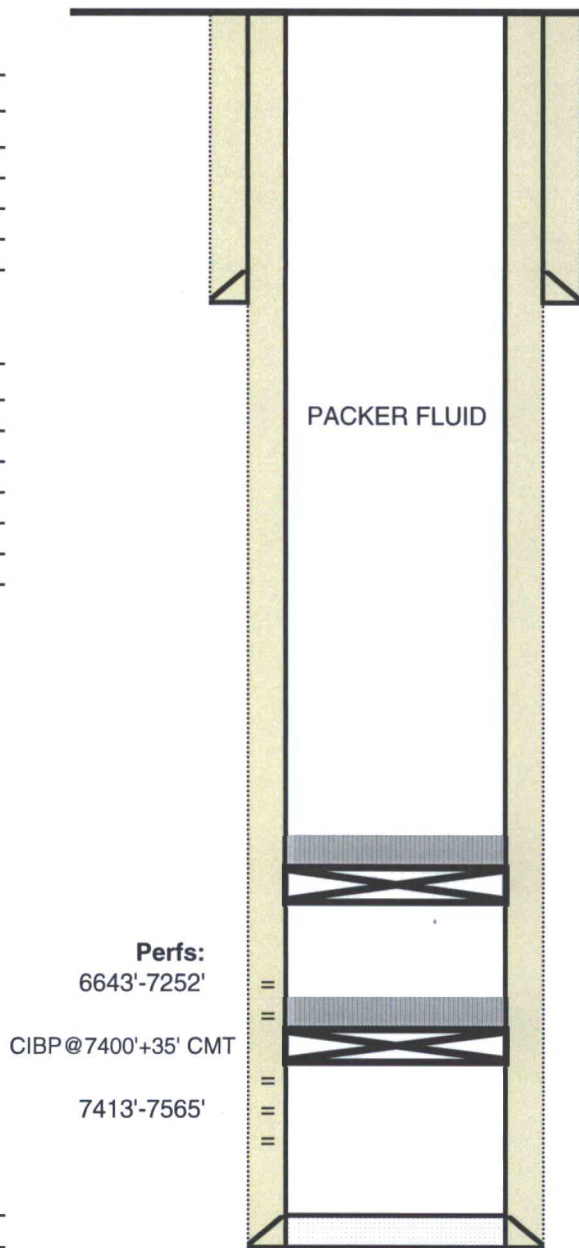

CIBP@6600' AND DUMPBAIL 3SX OR SPOT 25SX CLASS "C" CEMENT ON TOP

Perfs:
 6643'-7252'
 CIBP@7400'+35' CMT
 7413'-7565'

Remarks: _____

Updated by: LRQS
 Date: 12/20/2016

Prepared by: _____
 Date: _____