

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.	30-025-33192
5. Indicate Type of Lease	STATE ☒ FEE ☒
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Royal Coachman
8. Well Number	1
9. OGRID Number	5898
10. Pool name or Wildcat	Monument Abo
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	3720 KB

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐
2. Name of Operator DAVID H. ARRINGTON OIL AND GAS,
3. Address of Operator P.O. BOX 2071 MIDLAND, TX 79702
4. Well Location Unit Letter I : 1980 feet from the S line and 330 feet from the E line Section 27 Township 19S Range 36E NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3720 KB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT R	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	INT TO PA ☒
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P&A NR ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	P&A R ☐
DOWNHOLE COMMINGLE ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 4100' 100 4449' WOC & TAG
1. MIRU ND WH, NU BOP. TIH w/ pkr to 4450', sqz 75 sx - disp to 7000'. POOH
 2. TIH to TOF @ 4449'. circ w/ P&A mud, spot 25 sx. WOC & tag. POOH
 3. Cut & Pull 5 1/2 from 2850'. LD same. TIH w/ tbg to 3055'.
 4. Spot 75 sx. WOC & tag @ 2800'. PUH to 1500', spot 35 sx, PUH to 373', cmt to surf w/ 105 sx. Verify
 5. Cut off WH & mast anchors. Install DHM. RR. RDMO
- verify cmt to surface all strings

NOTIFY OCD 24 HOURS PRIOR TO
BEGINNING PLUGGING OPERATIONS

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE ENGINEERING TECH

DATE 02/22/2017

Type or print name DEBBIE WHITING

E-mail address: DEBBIE.WHITING@ARRINGTONONE.COM (505) 682-6685

For State Use Only

APPROVED BY:

TITLE P.E.S.

DATE 02/28/2017

Conditions of Approval (if any):


1980' FSL
330' FEL
S-19
T19S
R36E

Royal Coachman 1
Monument Field
Lea County, New Mexico
Existing Wellbore

KB: 3720'
GL: 3702'

API: 30-025-33192

Spud: 04/20/96
Rig Rel: 05/11/06

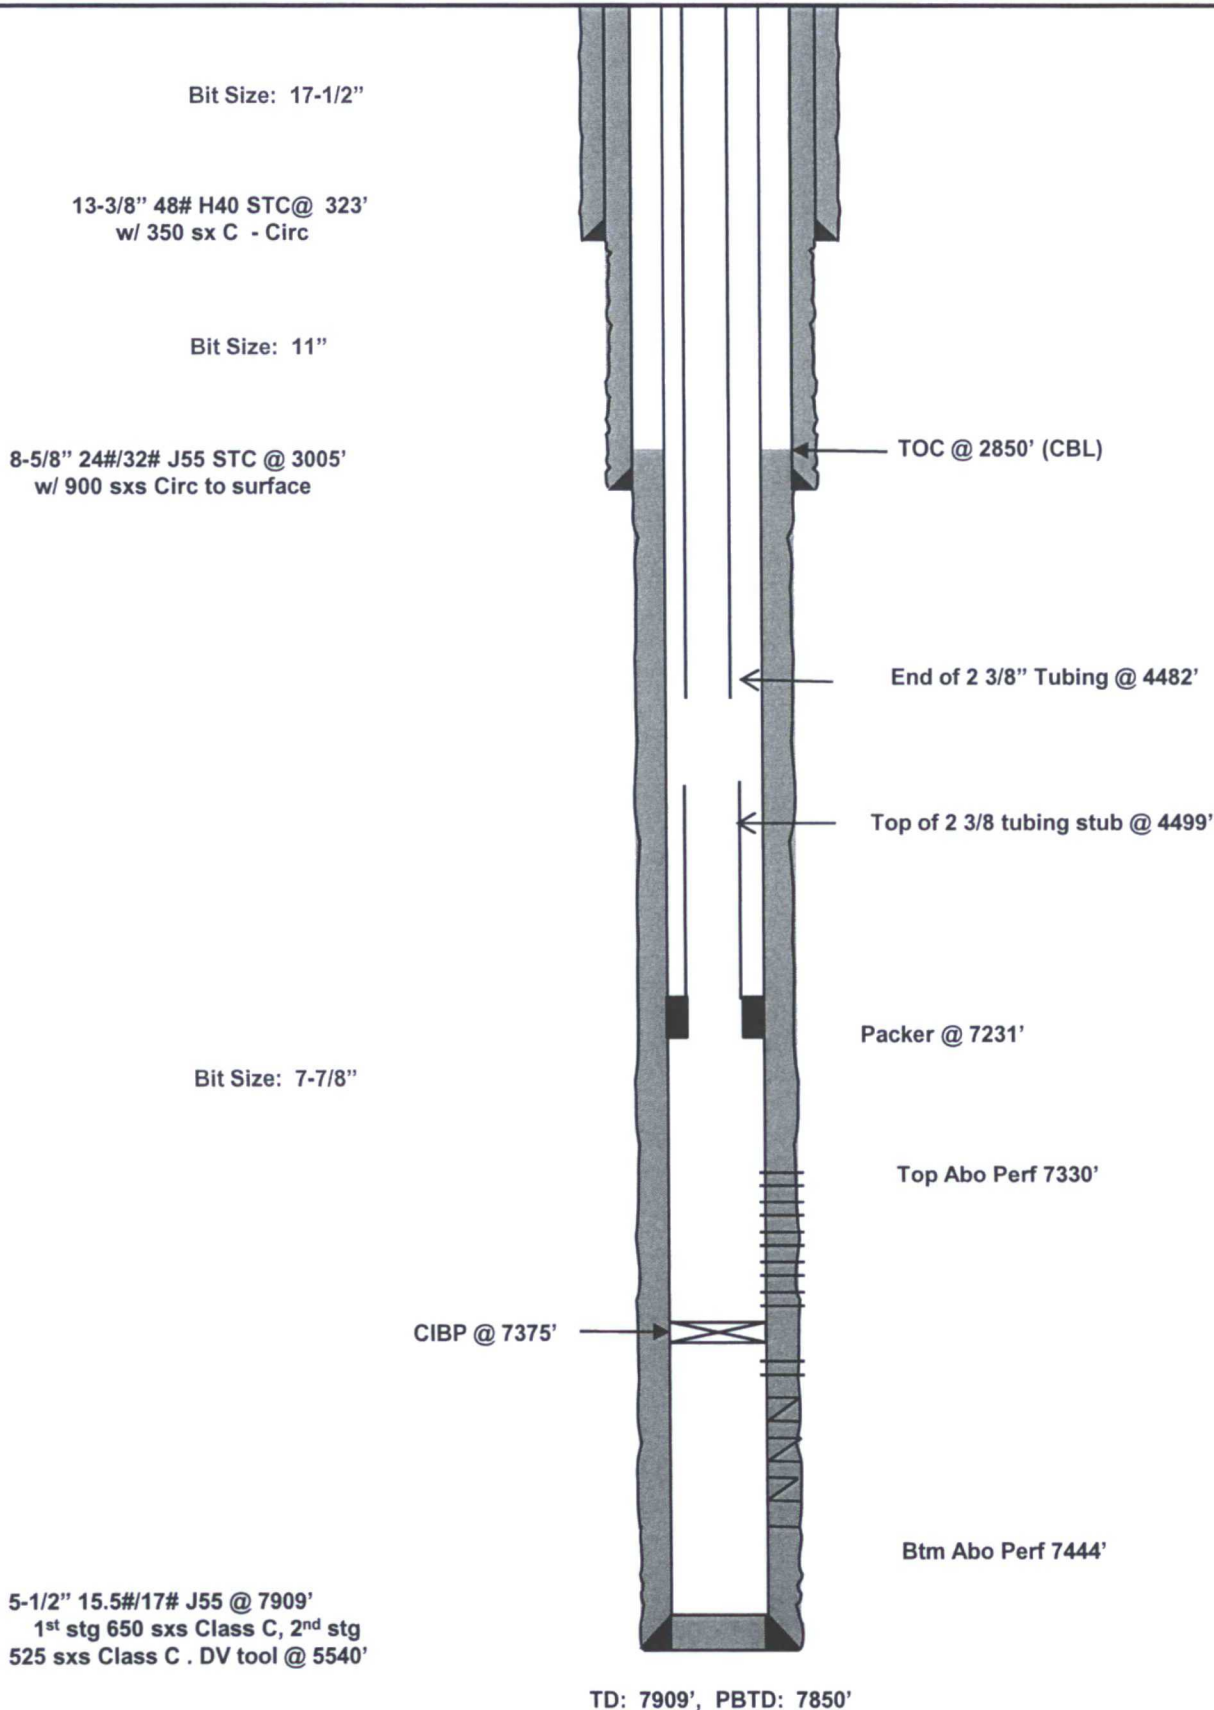


Royal Coachman 1
Monument Field
Lea County, New Mexico
Plugged Wellbore

KB: 3720'
GL: 3702'

1980' FSL
330' FEL
S-19
T19S
R36E

API: 30-025-33192

Spud: 04/20/96
Rig Rel: 05/11/06

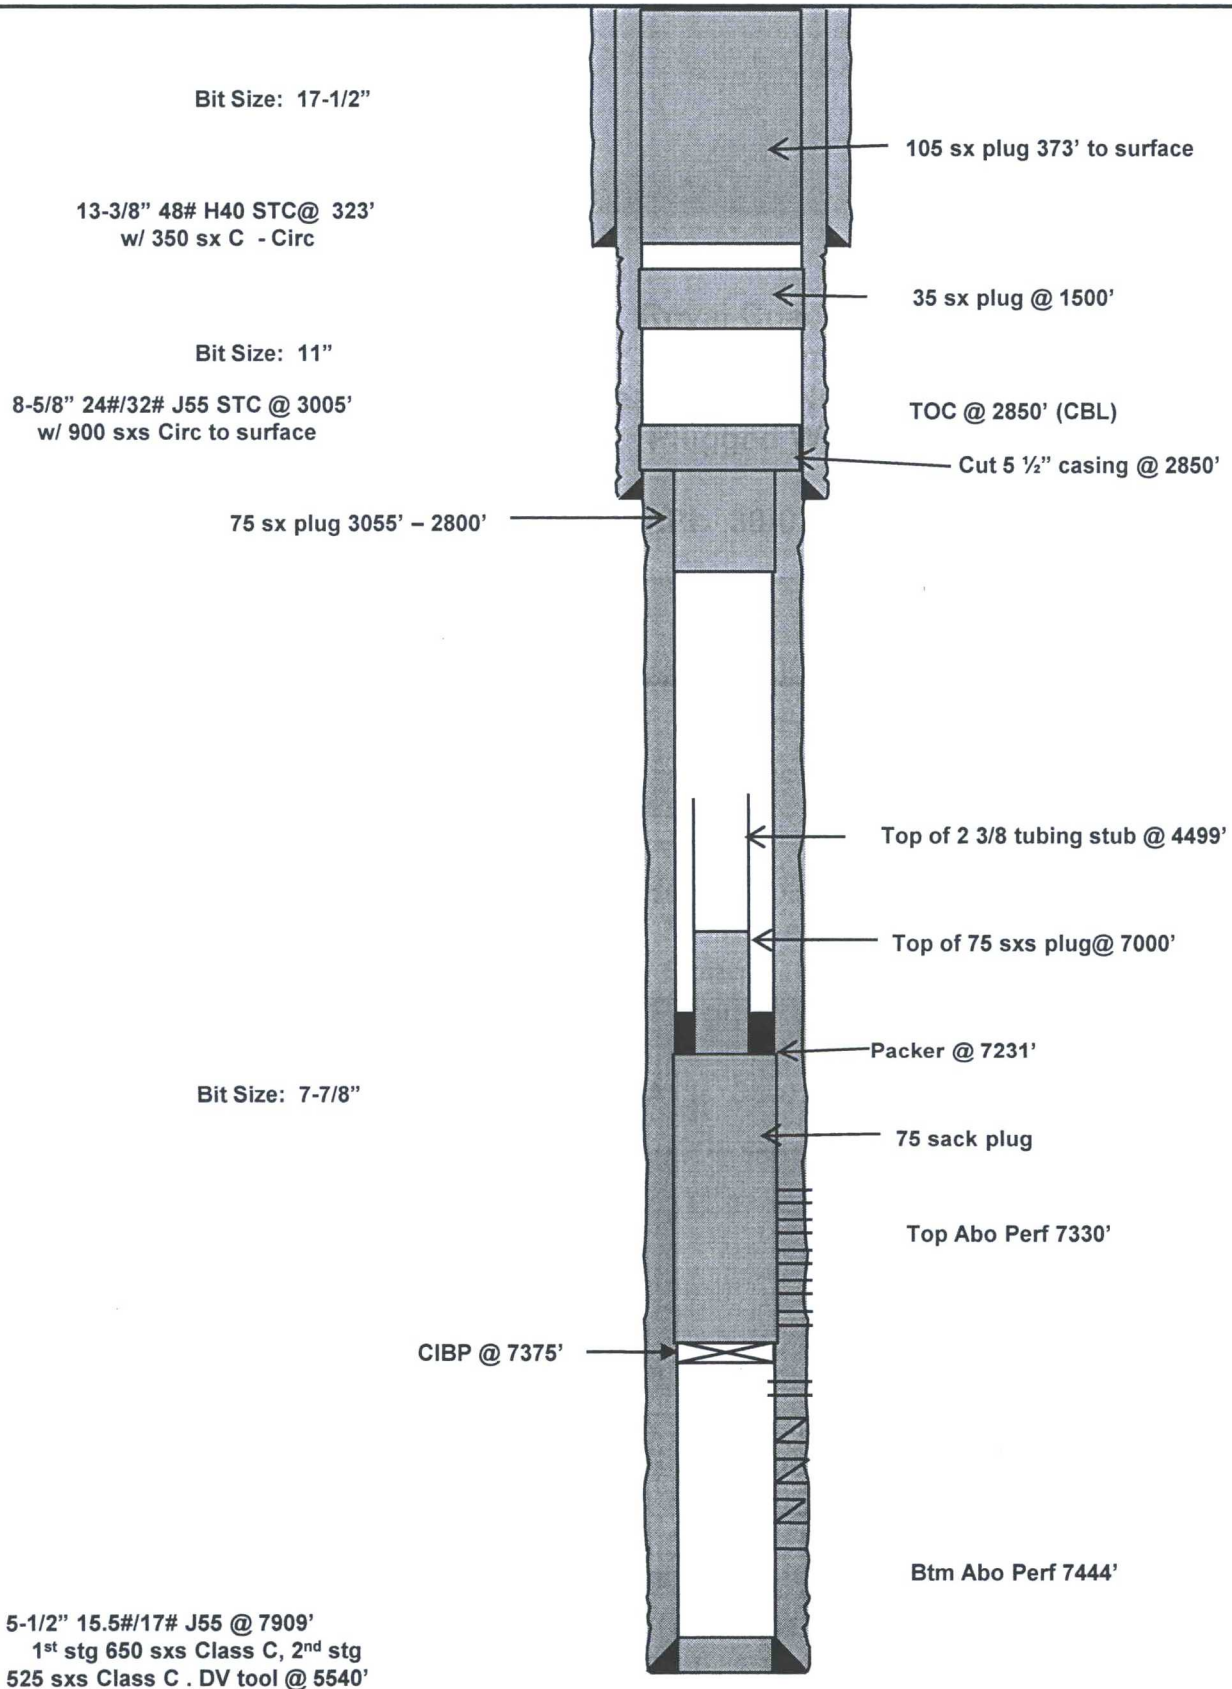

TD: 7909', PBTD: 7850'