

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-05232
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Wishbone Texas Operating Company, LLC		6. State Oil & Gas Lease No. B-9774
3. Address of Operator 10613 W. Sam Houston Pkwy N #400, Houston, TX 77064		7. Lease Name or Unit Agreement Name State T
4. Well Location Unit Letter N : 990 feet from the SOUTH line and 2310 feet from the WEST line Section 2 Township 15S Range 37E NMPM County LEA		8. Well Number 7
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3798.65' GL		9. OGRID Number 370256
		10. Pool name or Wildcat Denton (Devonian)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	INT TO PA FM P&A NR _____ P&A R _____
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐		OTHER: ☐	
CLOSED-LOOP SYSTEM ☐			

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Attempt to perf 2 7/8 @ 9282'. SQZ w/35 sx Class'H'. Tag @ 8906' or better.
OR IF NOT SUCCESSFUL

- Set **7"** CIBP @ 8956'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 8956-8856'
- Spot 25 sx cmt @ 7052-6952'. WOC & Tag (DV Tool)
- Spot 25 sx cmt @ 4690-4590'. (San Andres)
- Spot 25 sx cmt @ 3130-3030'. WOC & Tag (Yates, B/Salt)
- Perf & Sqz 50 sx cmt @ 2160-2090'. WOC & Tag (Shoe, T/Salt)
- Perf & Sqz 80 sx cmt @ 200'-Surface.
- Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

CHECK FOR PRESSURE ON BRADENHEAD PRIOR TO OPENING VALVE

Spud Date:

Rig Rele:

**NOTIFY OCD 24 HOURS PRIOR TO
BEGINNING PLUGGING OPERATIONS**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Abigail Montgomery

TITLE

Agent

DATE

8/18/17

Type or print name

Abigail Montgomery

E-mail address:

abbym@acmandassociates.com

PHONE:

432-580-7161

For State Use Only

APPROVED BY:

Mark Whitaker

TITLE

Petroleum Engr. Specialist


DATE

08/21/2017

Conditions of Approval (if any):


State "T" # 7 990' FSL & 2310' FWL of Sec. 2, T15S, R37E, Unit Letter "N"
API # 30-025-05232

Spud: November 18, 1952
Elev: 3820' DF

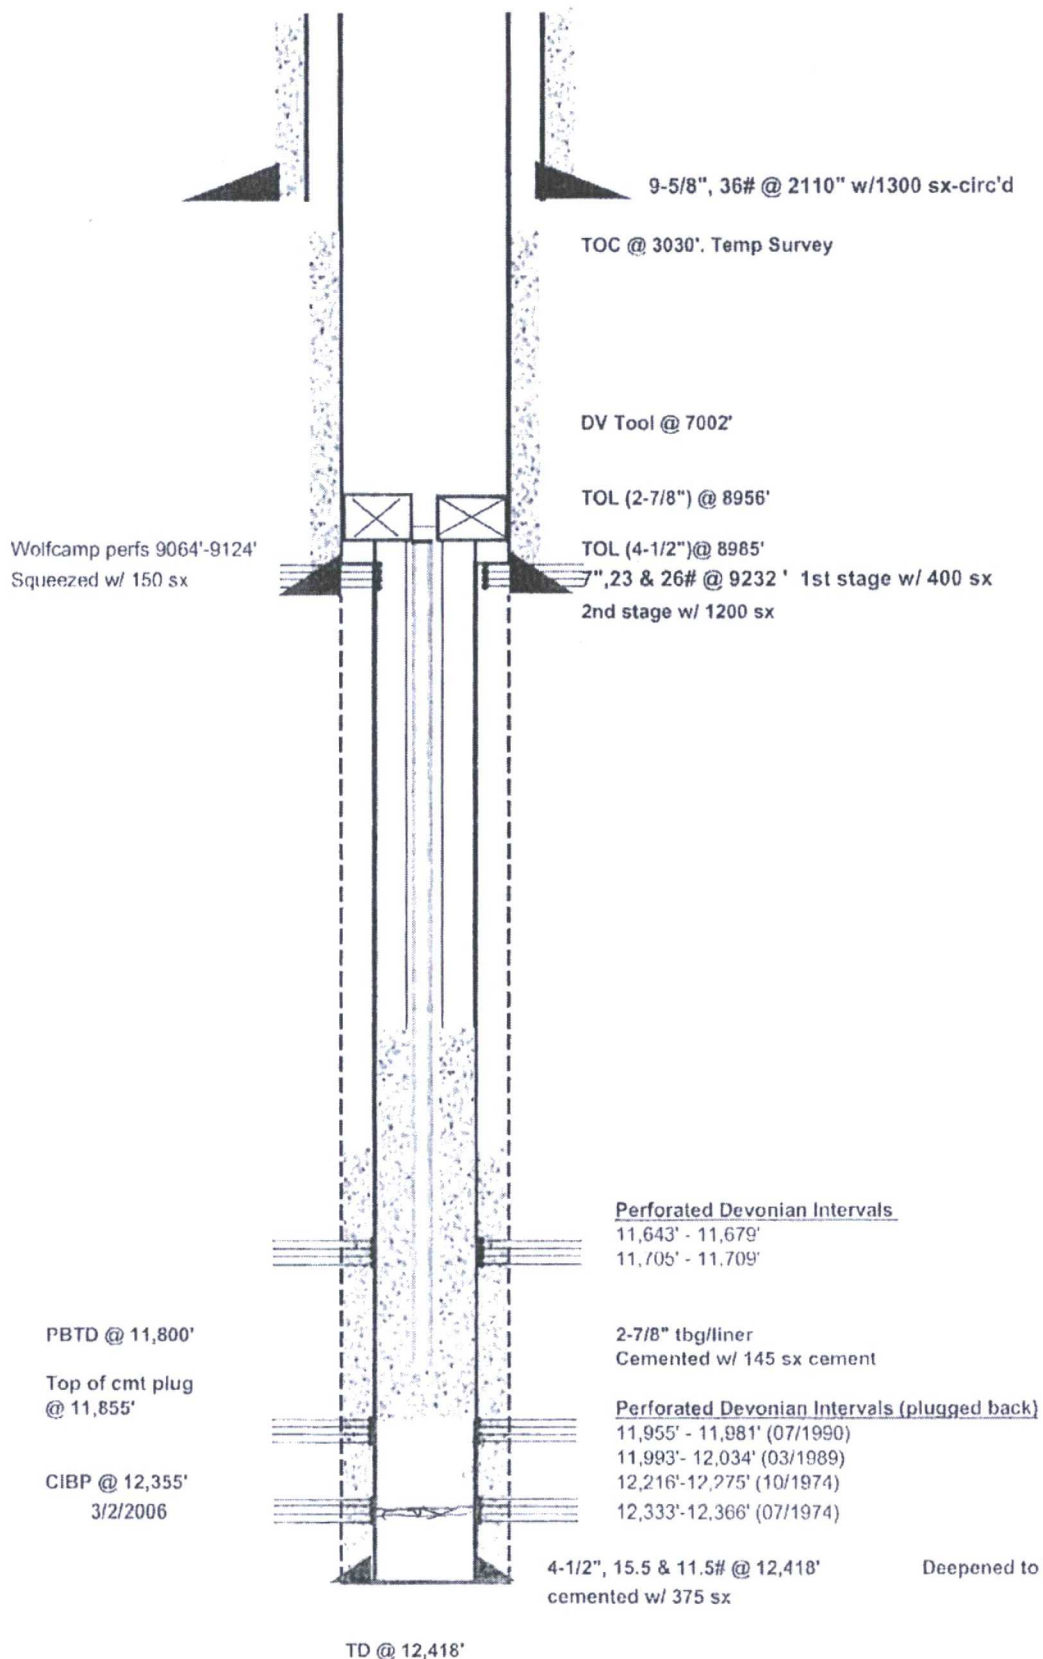

33.0419197
-103.1720505

State "I" # 7 990' FSL & 2310' FWL of Sec. 2, T15S, R37E, Unit Letter "N"
API # 30-025-05232

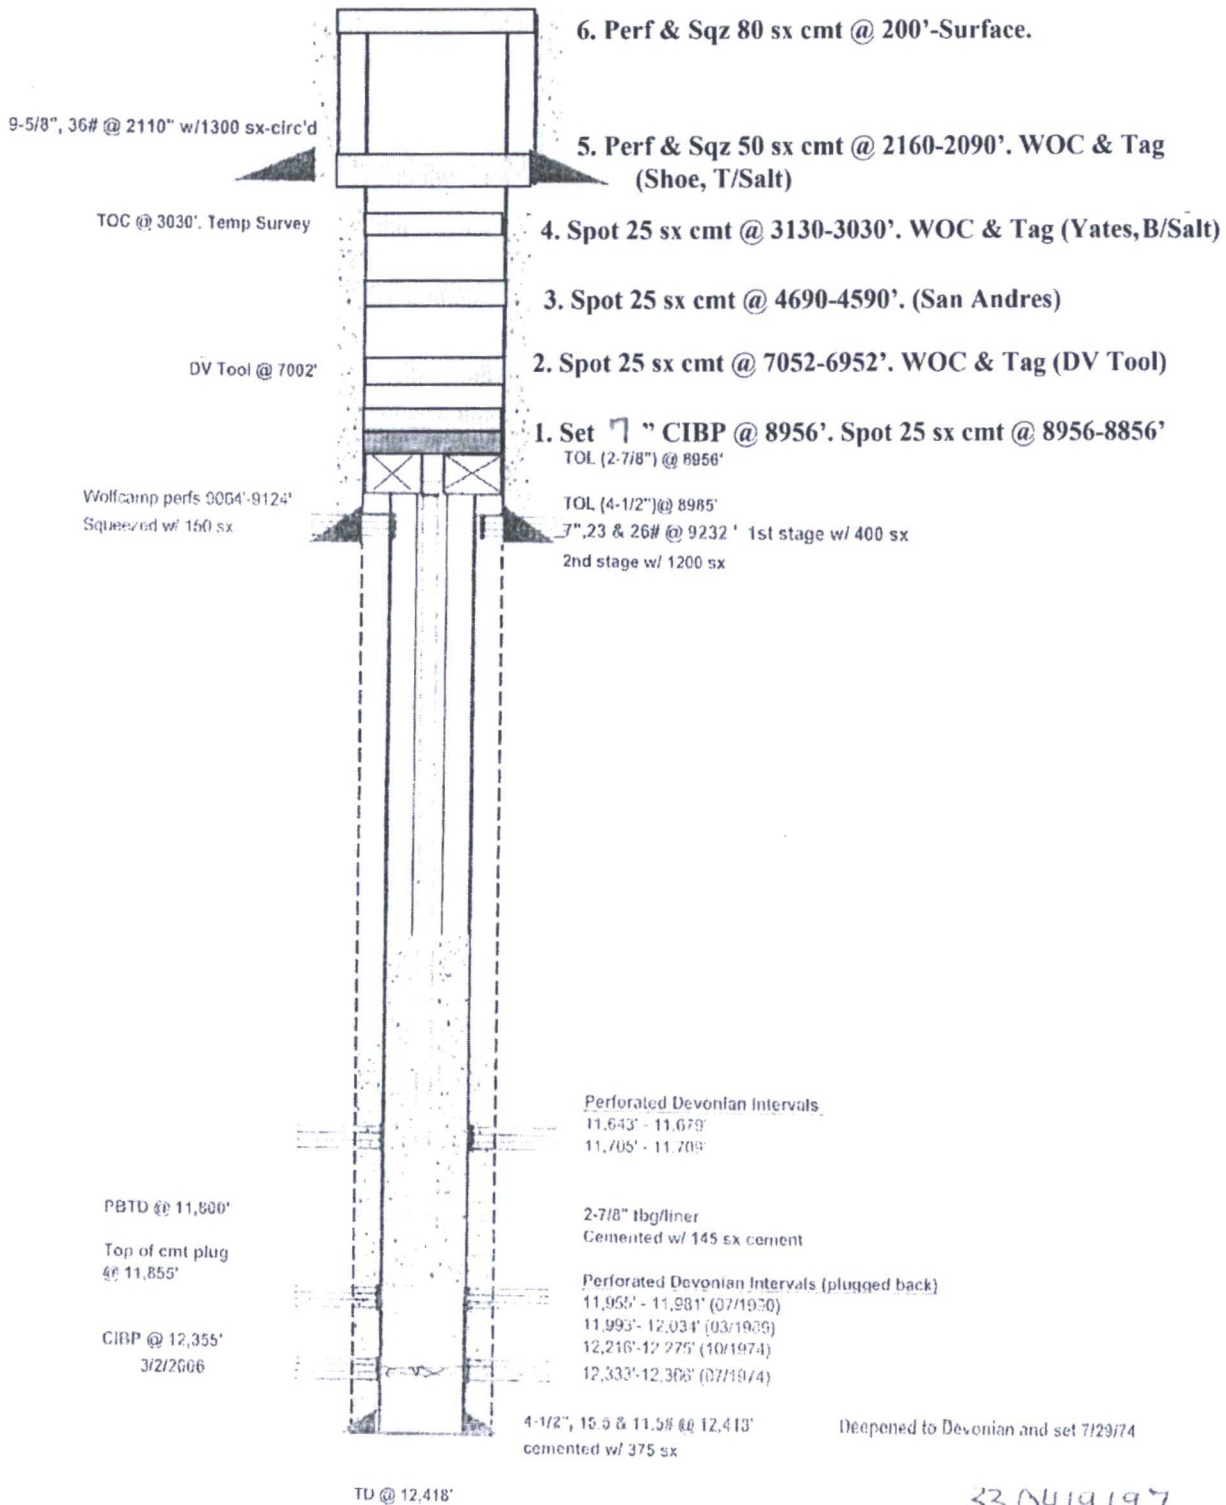

33.0419197
-103.1720505