

District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO. 30-025-26806
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. L-6731-2
7. Lease Name or Unit Agreement Name Maralo "16" State
8. Well Number 6Y
9. OGRID Number 281085
10. Pool name or Wildcat Sioux Tansill (Yates 7 Rivers)

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator  
RMR Operating, LLC

3. Address of Operator  
14282 Gillis Rd. Farmers Branch, Texas 75244-3715

4. Well Location  
Unit Letter M : 660 feet from the South line and 760 feet from the West line  
Section 16 Township 26S Range 36E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
2938'GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

<b>NOTICE OF INTENTION TO:</b>		<b>SUBSEQUENT RI</b>		<b>INT TO PA</b> <u>PM</u> <b>P&amp;A NR</b> _____ <b>P&amp;A R</b> _____
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>		
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>		
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>		
DOWNHOLE COMMINGLE <input type="checkbox"/>				
CLOSED-LOOP SYSTEM <input type="checkbox"/>				
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>		

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

② Circulate hole with 9.5# Brine w/ 12.5# gel/BB1 Pressure test csg to 500 psi

① Set CIBP at 3177'. (Top Perf @3227')

Spot 25 sx on top CIBP. Spot 25 sxs 2950'

Perf 5-1/2" casing (4 SPF) @1500'. Sqz with 75 sxs. Displace to 1400'. WOC and Tag

Spot 100' cmt plug from 400' to 300' (Fresh Water Plug)

Perf. @200'. Circulate cement to surface inside/outside 5 1/2" csg.

Spot 10 sxs cmt surface plug.

Cut-off wellhead. Install marker. Clean Location

Spud Date:

Verify cement to surface all strings

Rig Release Date.

NOTIFY OCD 24 HOURS PRIOR TO BEGINNING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ross Pearson TITLE V.P. Operations DATE 8/18/17

Type or print name Ross Pearson E-mail address: ross@redmountainresources.com PHONE: 469-995-0125

APPROVED BY: Mark Whitman TITLE Petrochem Engr. Specialist DATE 08/21/2017


Conditions of Approval (if any):

**WELL DATA**

DATE: 4/12/2007

LEASE/WELL: **Maralo "16" State #6Y**  
FIELD: **Sioux Tansill (Yates 7 Rivers)**

LOCATION: M: 660' FSL and 760' FWL, Sec 16,  
Township 26S, Range 36E  
COUNTY: Lea STATE: NM

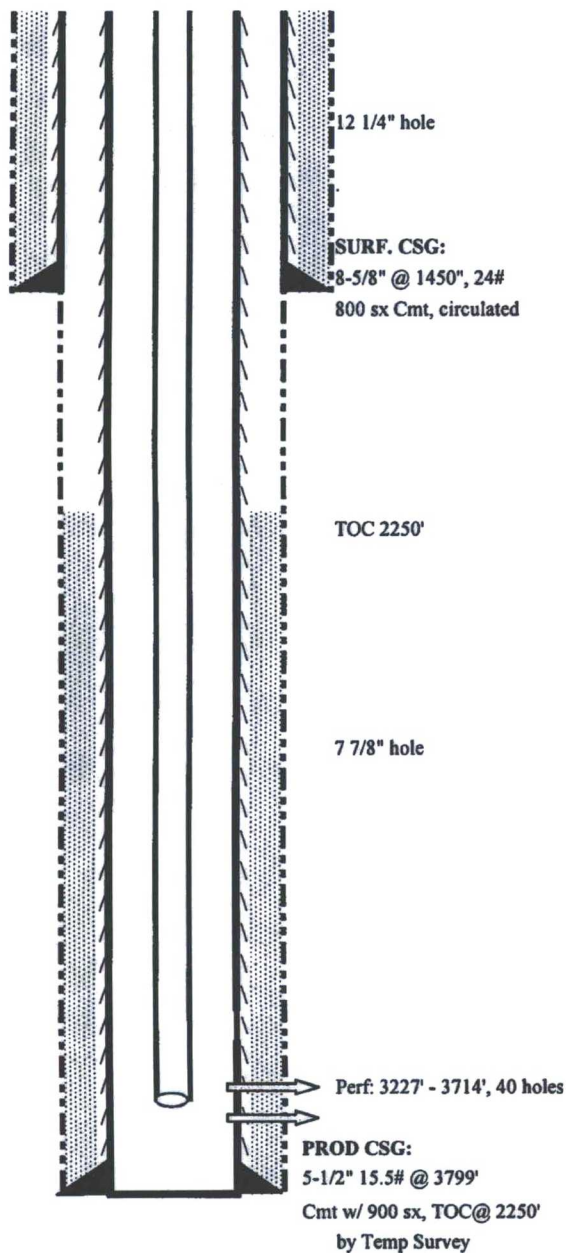

TD: 3799'  
PBD: 3756'

REMARKS: