Form 3160-5 (June 2015)

### **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

## 5. Lease Serial No. NMNM24161

SUNDRY NOTICES AND REPORTS ON WELLS	
Do not use this form for proposals to drill or to re-enter an	
abandoned well. Use form 3160-3 (APD) for such proposals.	Ì

SUBMIT IN TRIPLICATE - Other instructions on page 2000					6. If Indian, Allottee or Tribe Name			
SUBMIT IN	TRIPLICATE - Other ins	tructions on p	age 200	SOC	7. If Unit or CA	//Agreement,	Name and/or No.	
abandoned well. Use form 3160-3 (APD) for such proposations of the suc						8. Well Name and No. KEEL A FEDERAL 01		
Name of Operator					9. API Well No. 30-025-33316-00-S1			
3a. Address 6301 DEAUVILLE BLVD MIDLAND, TX 79706	3b. Phone No. ( Ph: 432-687	include area code) -7479	-0	10. Field and Pool or Exploratory Area S YOUNG				
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description	)			11. County or I	Parish, State		
Sec 33 T18S R32E NWSE 1980FSL 2080FEL					LEA COUNTY, NM			
12. CHECK THE AI	PROPRIATE BOX(ES)	TO INDICAT	E NATURE O	F NOTICE,	REPORT, OF	R OTHER I	DATA	
TYPE OF SUBMISSION			TYPE OI	FACTION			8	
✓ Notice of Intent  ☐ Subsequent Report	Acidize Alter Casing	_ ,	ulic Fracturing	☐ Reclam		INT TO	D PA PM	
	Casing Repair		Construction	Recom		P&A R		
☐ Final Abandonment Notice	☐ Change Plans ☐ Convert to Injection	☑ Plug a	and Abandon	☐ Water I	rarily Abando			
14. I hereby certify that the foregoing is	Electronic Submission #	USA INCORPO	RATED, sent to	the Hobbs				
Name (Printed/Typed) RICKY S	PILLER		Title ENGIN	EER				
Signature (Electronic S	Signature (Electronic Submission)			017				
	THIS SPACE FO	OR FEDERAL	OR STATE	OFFICE U	SE			
Approved By James Ca	2. ams_	[	Title 2	067			9.22-1) Date	
Conditions of approval, if any, are attache certify that the applicant holds legal or equivalent would entitle the applicant to conductive the conductive that the applicant to conductive the applicant to conduct the applicant the	aitable title to those rights in th		Office CF	0				
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent					ake to any departr	ment or agenc	y of the United	
(* )								

Form 3160-5 (August 2007)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010

5. Lease Serial No. NMNM24161

6. If Indian, Allottee or Tribe Name


## SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

abandoned well.	Jse Form 3160-3 (A	PD) for such propos	als.					
SUBMIT	IN TRIPLICATE - Other	7. If Unit of CA/Agreement, Name and/or No.						
1. Type of Well  Oil Well  Gas W	cll	8. Well Name and No. Keel A Federal # 1						
2. Name of Operator CHEVRON USA INC				9. API Well No. 30-025-33316	9. API Well No. 30-025-33316			
3a. Address 6301 DEAUVILLE BLVD. RM. N3002 MIDLAND, TX 79706		3b. Phone No. (include area 432-687-7479	code)	10. Field and Pool or Exploratory Area S. Young; San Andres				
4. Location of Well (Footage, Sec., T., SEC. 33, T18S, R32E MER NMP 1980 FSL & 2	) G -103.76948		11. Country or Parish, State Lea County, NM					
12. CHEC	K THE APPROPRIATE BO	X(ES) TO INDICATE NATU	RE OF NOTIO	CE, REPORT OR OTH	ER DATA			
TYPE OF SUBMISSION .		TYPE OF ACT	ION					
✓ Notice of Intent	Acidize Alter Casing	Deepen Fracture Treat	Property .	luction (Start/Resume)				
Subsequent Report	Casing Repair Change Plans	New Construction  ✓ Plug and Abandon		omplete Other porarily Abandon				
Final Abandonment Notice	Convert to Injection	Plug Back	Wate	er Disposal				
13. Describe Proposed or Completed O the proposal is to deepen direction: Attach the Bond under which the v following completion of the involv testing has been completed. Final determined that the site is ready fo  5/8" 23# @ 803' TOC surface, 5 1/2 Chevron respectfully requests to ab 1. Notify BLM 24 hrs. prior to startin 2. MIRU, NDWH, NU BOPE, POOH 3. Set CIBP @ 5132', RIH & spot 35 4. Mix and spot 80 sx CL "C" cemer 5. Mix and spot 80 sx CL "C" cemer 6. Mix and spot 80 sx CL "C" cemer 7. Mix and spot 80 sx CL "C" cemer 8. Cut off wellhead 3' below grade, All cement plugs will be class "C" w Bond coverage: 0329	ally or recomplete horizontal work will be performed or project operations. If the operation Abandonment Notices must refinal inspection.)  "15.5# @ 5,476' TOC surandon this well as follows g work (575) 234-5909. If with rods and tubing if project of the project of the from 4,400-3,750, (Gray and from 1,385'-1,100, WOO and from 850' to surface. Install required dry hole missall r	ly, give subsurface locations a povide the Bond No. on file wit on results in a multiple complebe filed only after all requirem face, Perfs 5,182'-5,226'.  393-3412 (1666) esent. 850', WOC / Tag / Test / circle burg, Queen). C & tag (7 Rivers, Yates, Bac & tag (Top Salt, Rustler).  arker as per COA's, turn ov	nd measured a h BLM/BIA. I stion or recomp ents, including c gel (perfs, S se Salt).	nd true vertical depths of Required subsequent repoletion in a new interval reclamation, have been san Andres).	of all pertinent markers and zones. ports must be filed within 30 days 1, a Form 3160-4 must be filed once			
			CONDITIONS OF APPROVAL					
Below ground leve  14. Thereby certify that the foregoing is to Ricky Spiller	rue and corfect. Name (Printe	Mer Ker (Egu ed/Typed) Title Engir	eer					
Signature 19 Date 07/10/2017								
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved by	2 0			1	2 -			
Conditions of approval, if any, are attache that the applicant holds legal or equitable entitle the applicant to conduct operations	itle to those rights in the subje		SPO		Date 9. 22-17			
Tile 18 U.S.C. Section 1001 and Title 43 fictitious or fraudulent statements or representations.			y and willfully	to make to any departme	ent or agency of the United States any false			

#### Chevron U.S.A. Inc. Wellbore Diagram: KEEL A FED 1



[Lease] OEU EUNICE FMT [Well No.] KEEL A FEDERAL 1 [Field] YOUNG SOUTH
[Location] 1980FSL2080FEL [Sec.] N/A [Blk] \_\_\_\_\_\_\_ [Survey] N/A
[County] Lea [St.] New Mexico [Refno] BF2187 [API] 3002533316 [Cost Center] UCKP50100
[Section] E032 [Township] 33 [Range] S018
[Current Status] ACTIVE [Dead Man Anchors Test Date] NONE
[Directions]

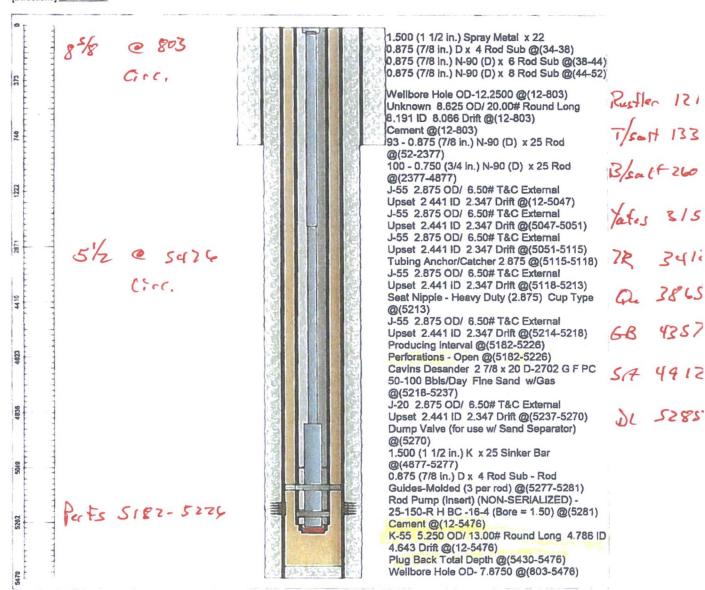

[Ground Elevation (MSL)] 3686.00 [Spud Date] 03/08/1996 [Compl. Date] 04/22/1996 [Well Depth Datum] Kelly Bushing [Elevation (MSL)] 3698.00 [Correction Factor] 12.00 [Last Updated by] kswa [Date] 04/13/2015 [null] null [null] null

# P+A Chevron U.S.A. Inc. Wellbore Diagram: KEEL A FED 1



[Lease] OEU EUNICE FMT [Well No.] KEEL A FEDERAL 1 [Field] YOUNG SOUTH [Location] 1980FSL2080FEL [Sec.] N/A [Blk] [Survey] N/A [County] Lea [St.] New Mexico [Refno] BF2187 [API] 3002533316 [Cost Center] UCKP50100 [Section] E032 [Township] 33 [Range] S018 [Current Status] ACTIVE [Dead Man Anchors Test Date] NONE [Directions] 100SX 850-SURFACE 84 MLF 1222 80 SX 1,385-1,100 WOE/TAG MLF 01 59 805X 3,465-3,000 NOC/TAG Perforations - Open @(5182-5226) 1623 MLF

> 5/30 CIBPE 5,150 3 55x 5,/50 - 4,850 WO (/TAG/TEST Cement @(12-5476) K-55 5,250 OD/ 13.00# Round Long 4.786 ID 4.643 Drift @(12-5476) Plug Back Total Depth @(5430-5476) Wellbore Hole OD- 7.8750 @(803-5476)

805X 4,400-3,750 WOC/TAG

[Ground Elevation (MSL)] 3686.00 [Spud Date] 03/08/1996 [Compl. Date] 04/22/1996 [Well Depth Datum] Kelly Bushing [Elevation (MSL)] 3698.00 [Correction Factor] 12.00 [Last Updated by] kswa [Date] 04/13/2015 [null] null [null] null

1123

#### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

#### Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



### United States Department of the Interior

#### BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/tun



In Reply Refer To: 1310

#### Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
  Operations must include adequate measures for stabilization and reclamation of disturbed lands.
  Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
  process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979