Form 3160-5 (April2004)

UNITEDSTATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

FORMAPPROVED OM B No. 1004-0137 Expires: March 31, 2007

Lease	Serial	No.
LC-06	7968	ł

Do not use th	is form for proposals all. Use Form 3160 - 3	to drill or to re-e	nter an	6. If Indian,	Allottee or Tribe Name
SUBMIT IN TRIPLICATE - Other instructions on reverse side.		7. If Unit or CA/Agreement, Name and/or No. West Dollarhide Drinkard Unit			
	. 3b. PhoneNo.(include area code)		8. Well Na: 137 9. API We 30-025- 10. Field a Dollarhi	9. API Well No. 30-025-32088 10. Field and Pool, or Exploratory Area Dollarhide; Tubb-Drinkard 11. County or Parish, State LEA	
12. CHECK AI	PPROPRIATE BOX(ES)T	O INDICATE NATUR	RE OF NOTICE,	1	R OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION				
Notice of Intent Subsequent Report Final Abandonment Notice	Acidize AlterCasing Casing Repair Change Plans Convert to Injection	Deepen FractureTreat New Construction Plug and Abandon Plug Back	Production (S Reclamation Recomplete Temporarily Water Dispos		Water Shut-Off Well Integrity OtherRepair Tbg. Leak -Return to Production
13. Describe Proposed or Comple If the proposal is to deepen dir	ted Operation (clearly state all p ectionally or recomplete horizon	ntally, give subsurface locati	ons and measured an	d true vertical de	work and approximate duration therecepths of all pertinent markers and zones

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

02/15/2006: MIRU PU. Bled well down. POOH w/rods & pump. Pump 130BCP down tbg & ann. NUBOP. SDON.

02/16/2006: TIH & tag btm @ 7,025' (5' fill). RU Tuboscope. POOH inspecting 2-7/8" tbg. SD due to high winds-incomplete.

02/17/2006: Continue POOH inspecting 2-7/8" tbg. LD 6 bad jts tbg due to pitting. PU & TIH w/3-1/2" BHA. SDON.


02/18/2006: Continue TIH w/BHA to FHD of 6,596'. NDBOP, set TAC w/20k # Tension. NU Wellhead, RIH w/rods & pump. space out & hang well on pump.

Load & test.

02/19/2006: RDMO.

RETURN TO PRODUCTION.

3/28/2006 On 24 Hr. pumping 8 BO, 18.5 MCF, 125 BW, GOR: 2307.5

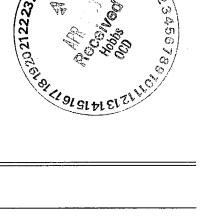

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)	ı				
Alan W. Bohling	Title	Regulatory Agent			
Signature alaule Bohling	Date	04/18/2006			
THIS SPACE FOR FEDERAL OR STATE OFFICE USE					
Approved by Asia Il Illowing	T	itle Date	100 - 0 0000		
Conditions of approval, if any, are attached. Approval of this notice decreases certify that the applicant holds legal or equitable title to those rights in the subject which would entitle the applicant to conduct operations thereon.	lease O	RVISOR/GENERAL MANAGER Office	APR 2 8 2006		

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.