

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-00577
1. Type of Well: Oil Well ☐ <u>Gas</u> Well ☒ Other ☐ HOBBS OCD		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator COG Operating, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 600 W. Illinois Ave, Midland, TX 79701		7. Lease Name or Unit Agreement Name Edward State
4. Well Location Unit Letter <u>L</u> : <u>1720</u> feet from the <u>S</u> line and <u>990</u> feet from the <u>W</u> line Section <u>16</u> Township <u>17S</u> Range <u>32E</u> NMPM County <u>Lea</u>		8. Well Number <u>3</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4029'		9. OGRID Number 229137
		10. Pool name or Wildcat Maljamar; Yes, West Queen (Gas)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENCE
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OF
PULL OR ALTER CASING ☐	CASING/CEMENT JOB
DOWNHOLE COMMINGLE ☐	
CLOSED-LOOP SYSTEM ☐	
OTHER: ☐	OTHER: ☐

INT TO P&A INT
P&A NR NR
P&A R R

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Tag 5 1/2" CIBP @ 3442'. Spot 25 sx on CIBP
2. Set 5 1/2" CIBP @ 3090'. Circulate hole w/ MLF. Pressure test csg, Spot 25 sx @ 3090-2990'. WOC & Tag
3. Perf & Sqz 55 sx @ 2330-2180'. WOC & Tag 2400-2250'
4. Perf & Sqz 50 sx @ 1300-1200'. WOC & Tag 1900'-1750'
5. Perf & Sqz 60 sx @ 250 Surface. 283'- surface
6. Cut off well head, verify cmt to surface, weld on Below Ground Dry Hole Marker.
Above

Spud Date:

NOTIFY OCD 24 HOURS PRIOR TO
BEGINNING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Abigail Montgomery TITLE Agent DATE 8/14/18
Type or print name Abigail Montgomery E-mail address: abbym@bcmmandassociates.com PHONE: 432-580-7161
For State Use Only
APPROVED BY: Mark Whitman TITLE P.E.S. DATE 08/16/2018
Conditions of Approval (if any):

C103 INTENT TO P&A EXPIRES
1 YEAR FROM DATE OF APPROVAL

Concho

Lease & Well

30-025-00577


Spud - 8/8/59

Edward # 3

16L 17S 32E 1720 FSL 990 FWL

Elevation - 4029'

KB -

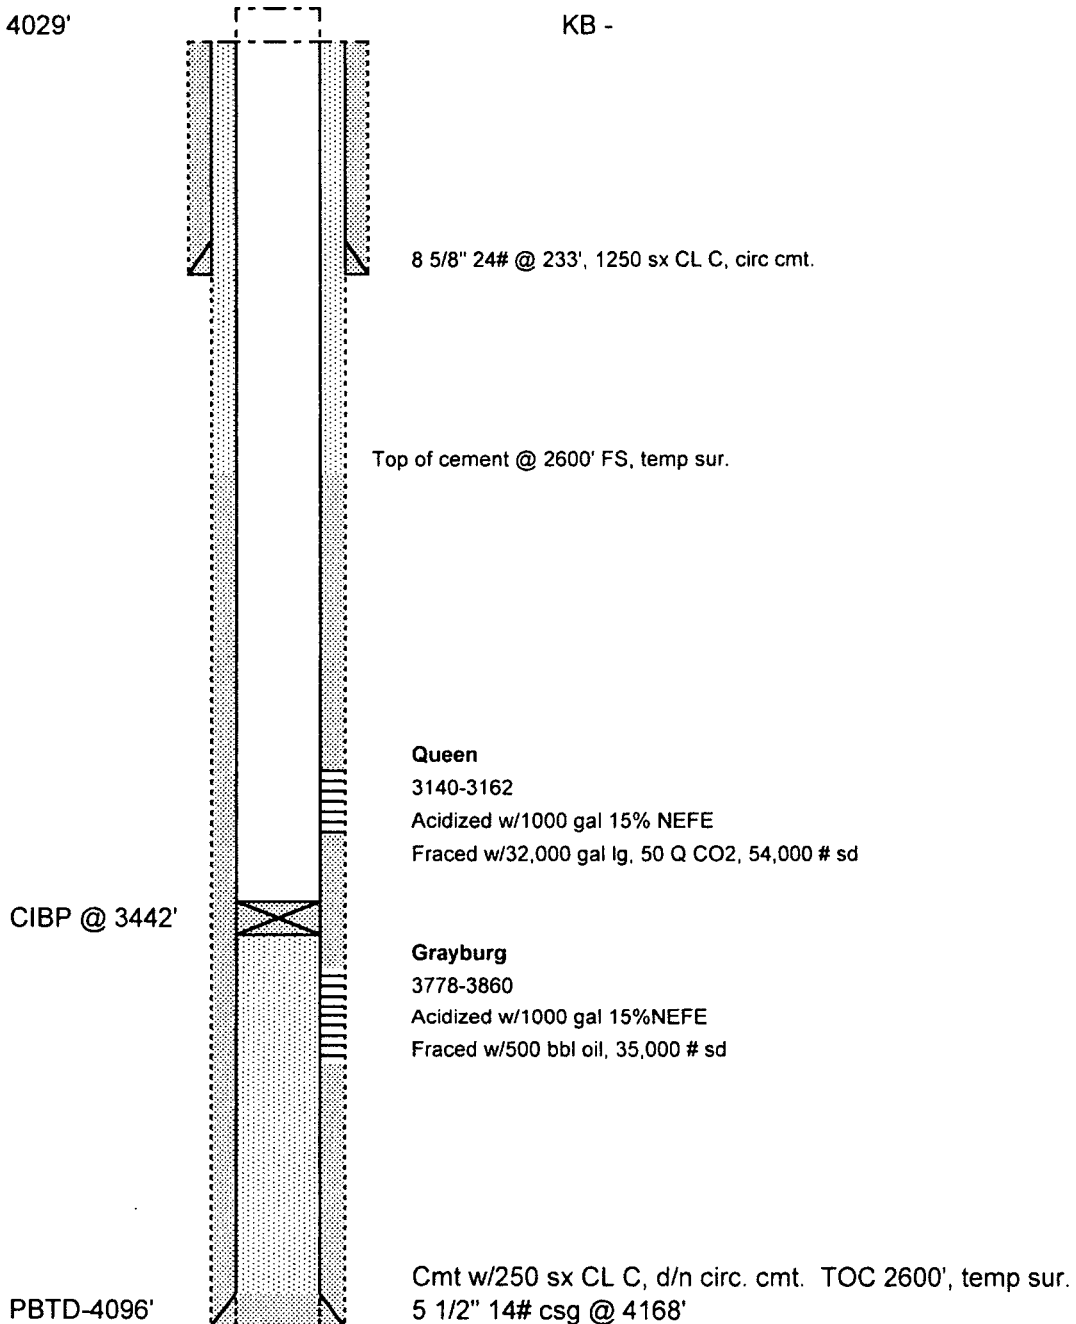

32.8320847
-163.7768707

Concho

Lease & Well #

30-025-00577


Spud - 8/8/59

Edward # 3

16L 17S 32E 1720 FSL 990 FWL

Elevation - 4029'

KB -

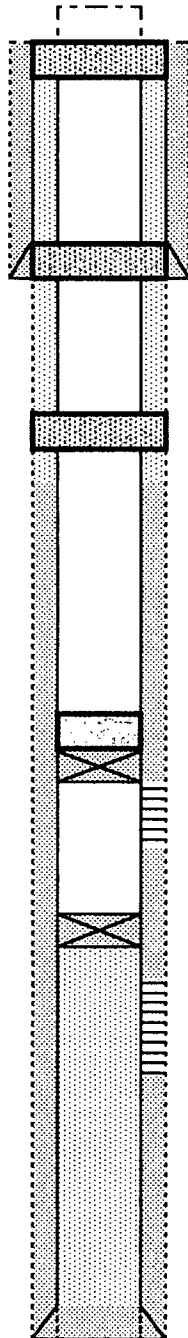

5. Perf & Sqz 60 sx cmt @ 250'-Surface.

8 5/8" 24# @ 233', 1250 sx CL C, circ cmt.

4. Perf & Sqz 50 sx cmt @ 1300-1200'. WOC & Tag

3. Perf & Sqz 55 sx cmt @ 2330-2180'. WOC & Tag

Top of cement @ 2600' FS, temp sur.

2. Set 5 1/2" CIBP @ 3090'. Circ hole w/ MLF. Pressure test csg.
Spot 25 sx cmt @ 3090-2990'. WOC & Tag

Queen

3140-3162

Acidized w/1000 gal 15% NEFE

Fraced w/32,000 gal lg, 50 Q CO2, 54,000 # sd

1. Tag 5 1/2" CIBP @ 3442'.

Grayburg

3778-3860

Acidized w/1000 gal 15%NEFE

Fraced w/500 bbl oil, 35,000 # sd

CIBP @ 3442'

PBTD-4096'

Cmt w/250 sx CL C, d/n circ. cmt. TOC 2600', temp sur.
5 1/2" 14# csg @ 4168'