Forth 3160-5 (June 2015)	זס	OCD Hobbs		FORM APPROVED OMB NO. 1004-0137						
DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT						Expires: January 31, 2018 5. Lease Serial No.				
	SUNDRY	S C C D	NMLC031670A							
	abandoned we	2 2019	6. If Indian, Allottee or Tribe Name							
	SUBMIT IN	7. If Unit or CA/Agreement, Name and/or No.								
1. Type of Well	Gas Well Ot			8. Well Name and No. SEMU 153	<u> </u>					
2. Name of Oper		Contact:		ES.COM	9. API Well No. 30-025-35434-0	0-S1				
3a. Address			(include area code) 10. Field and Po 3-3355 EUMONT							
MIDLAND,			3-3364							
	, .	., R., M., or Survey Description)	11. County or Parish, S							
Sec 19 120	5 R38E 500500 L0	ot 4 830FSL 910FWL			LEA COUNTY,	NM				
12.	CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	I REPORT, OR OTH	IER DATA			
TYPE OF S	SUBMISSION	TYPE OF ACTION								
Notice of	Intent	Acidize	Dee		Product	tion (Start/Resume)	UWater Shut-Off			
□ Subsequer		Alter Casing		Iraulic Fracturing	□ Reclam		Well Integrity			
	ndonment Notice	□ Casing Repair 5 K □ Change Plans	_	v Construction g and Abandon	□ Recom	rarily Abandon	Other			
_				g Back 🖸 Water						
following com testing has bee determined that 1) MIRU, N 2) RU rever 3) Tag TOC 4) Spot 25s 5) Spot 80s 6) Spot 25s 7) Spot 25s 8) Spot 70s 9) Set CIBF 10) Spot 60	andonment Notices must be file inal inspection. 200H w/ Prod Tbg it and collars - drill out CIE nud to open perfs @ 3011	le completion or reco requirements, includ Circ hole clean	completion or recompletion in a new interval, a Form 3160-4 must be filed once quirements, including reclamation, have been completed and the operator has irc hole clean $SFF ATTACHED$ COD							
Below	ground	level dry	hole	mark	er re	quired				
14. I hereby certify that the foregoing is true and correct. Electronic Submission #450198 verified by the BLM Well Information System For CONOCOPHILLIPS COMPANY, sent to the Hobbs Committed to AFMSS for processing by DEBORAH MCKINNEY on 01/28/2019 (19DLM0212SE)										
Name (Printed	RYANT	Title AGENT								
Signature	Submission)	Date 01/11/2019								
		THIS SPACE FO	R FEDER	AL OR STATE	OFFICE U	SE				
Approved By fames a. Comment				Title SPET			<b>Z-4-19</b> Date			
certify that the appl	d. Approval of this notice does uitable title to those rights in the act operations thereon.	Office CF	Ю							
		U.S.C. Section 1212, make it a statements or representations as			willfully to m	ake to any department or	agency of the United			
(Instructions on page 2) ** BLM REVISED **										
	X7	NMOC	•	2-14						
	-									

•

## Additional data for EC transaction #450198 that would not fit on the form

#### 32. Additional remarks, continued

r

'n


13) RDMO. Cut off WH & anchors, install DH marker. Clean location

#### WELLBORE SKETCH ConocoPhilips Company -- Permian Basin Businoss Unit

			Date. <u>8/30/18</u>	
RKB @ <u>3543</u> DF @ <u>3543</u> GL @ <u>3532</u> J4 <sup>1</sup> / <sub>4</sub> <sup>1</sup> / <sub></sub>	Subarea Lease & Well No Legal Descriptio County Field Date Spuedod APi Number	n <u>Sec 19-M</u> T-20-S, R-38-E Lea State Hardy North 3/29/01	No. 153 910' FWL 830' FS New Mexico	<u>SL</u>
TOC @ Surface		30-025-35434 Operator Num Lonse ID Field Number		
Production 5-1/2", 174/1, to 7850' Cnit'd w/ 1015 SX TOC @ Surface		т/sa B/so		140 <sup>0</sup> 2550
Packer @2956' F* Nipple		Yet.		57
= = Perfa - 2995' - 3011'		7 R	2 9	202
DV Tool @3899'		Qu	30	170
		Pear	35	592
		GB	37	48
		S A	- 3	974
		GI	57	27 D
10C cap @ 7595' CIBP w/ Cmt Cap 7600.		32	51	828
Hardy, Strawn = Perd 7647' - 7733' = PBID Not Recorded (Float Collar) @ 7763'     TD @ 7850'		5	6	326
E EPHID Not Recorded (Float Collar) @ 7763'		DK	4	654
		A6 0	4	938
		St	-	7584

с **в** 

WELLBORE SKETCH ConocoPhillips Company -- Permian Basin Business Unit

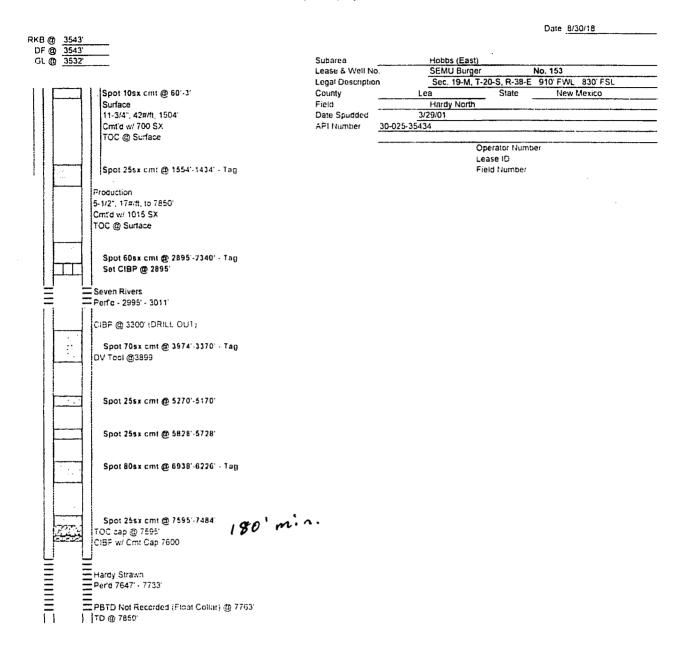

### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

# 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.** 

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted