Submit 1 Copy To Appropriate District Office	State of New Mexico	Form C-103
District I - (575) 393-6161	Energy, Minerals and Natural Resources	Revised July 18, 2013 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240	^	
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSECUATION DIVISION	30-025 - 2066 5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178	1222 South St. Francis Dr.	STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410	Santa F. NM 87505	6. State Oil & Gas Lease No.
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	100 of 100	
87505	L. '8 %, 'ED	06-5084
SUNDRY NOTICES AND RANORTS ON ELLS		7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOS	ALS TO DRILL OR TO DESTEN OR PLUG BACK TO A ATION FOR PERMIT FORM C-101) FOR SUCH	51.1.11 23
PROPOSALS.)		State 11 23
1. Type of Well: Oil Well	Gas Well Other	8. Well Number
2. Name of Operator		9. OGRID Number
OXY USA Inc. 3. Address of Operator		16696 10. Pool name or Wildcat
P.O. Box 50250 Midland, TX 79710		Mescalero San Andres
4. Well Location		
Unit Letter F: 1980 feet from the North line and 1980 feet from the West line		
Section 23	Township 105 Range 32E	NMPM County Lea
	11. Elevation (Show whether DR, RKB, RT, GR, etc.	:.)
	433('	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILLY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. TD-4430' PBTD-4400' Perfs-4105-4198' 7-5/8" 24# csg @ 1584' w/ 600sx, 11" hole, TOC-Surf-Circ 4-1/2" 9.5# csg @ 4430' w/ 250sx, 6-3/4" hole, TOC-3110'-TS 1. RIH & set CIBP @ 4055', M&P 25sx cmt to 3855' 2. M&P 25sx cmt @ 3501-3301' WOC-Tag 3. Perf @ 2269', sqz 25sx cmt to 2169' WOC-Tag 4. Perf @ 1634', sqz 25sx cmt to 1534' WOC-Tag		
5. Perf @ 250', sqz 60sx cmt to surface.		
10# MLF between plugs - Above ground steel tanks will be utilized		
Spud Date:	Rig Release Date:	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
SIGNATURE TITLE Sr. Regulatory Advisor DATE 3 22 (9		
Type or print name <u>David Stewart</u> E-mail address: <u>david_stewart@oxy.com</u> PHONE: <u>432-685-5717</u>		
For State Use Only		
APPROVED BY: Kerry Forter TITLE Conpliance Office A DATE V-22-19		
Conditions of Approval (if and)	V FU	

ì

OXY USA Inc. - Proposed State 11 23 #6 API No. 30-025-20661


60sx @ 250'-Surface

25sx @ 1634-1534' WOC-Tag


25sx @ 2269-2169' WOC-Tag

25sx @ 3501-3301' WOC-Tag

CIBP @ 4055' w/ 25sx to 3855'

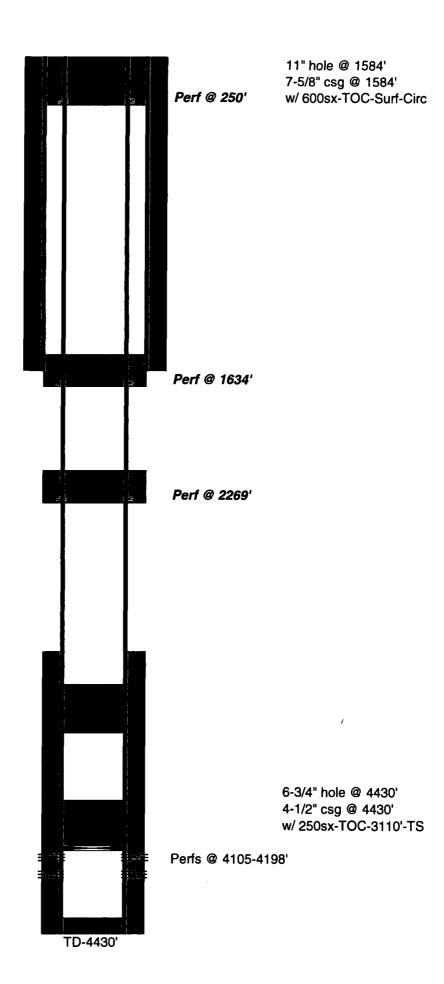

OXY USA Inc. - Current State 11 23 #6 API No. 30-025-20661

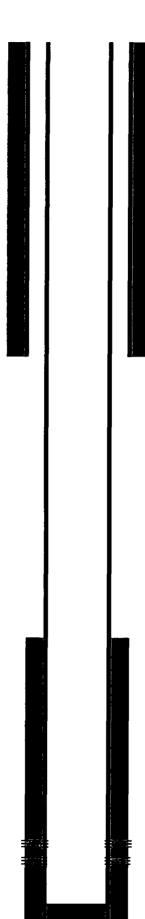

11" hole @ 1584' 7-5/8" csg @ 1584' w/ 600sx-TOC-Surf-Circ

6-3/4" hole @ 4430' 4-1/2" csg @ 4430' w/ 250sx-TOC-3110'-TS

Perfs @ 4105-4198'

TD-4430'

GENERAL CONDITIONS OF APPROVAL:

- 1) Insure all bradenheads have been exposed, identified, and valves are operational prior to rigging up on well.
- 2) Contact the appropriate NMOCD District Office no later than 24 hours prior to moving in and rigging up.
- 3) A copy of the approved C103 intent to P&A should be distributed to the onsite company and plugging representatives. Approved procedures are good for a period of one year from approved date, unless otherwise specified on the C103 intent. Approvals past this date will require the submission and approval of a new C103 intent.
- 4) A company representative is required to be present to witness all operations including setting CIBP's, circulation of mud laden fluids, perforating, squeezing or spotting cement plugs, tags, or any other operations approved on the C103 intent to P&A. Company representative should contact the NMOCD and report all operations.
- 5) Any changes that may be required during plugging operations should be approved by the NMOCD before proceeding.
- 6) A closed loop system is to be used for all plugging operations. Contents of the steel pits to be hauled to a NMOCD permitted disposal facility.
- 7) Mud laden fluids must be placed between all cement plugs mixed at 25 sacks of salt gel per 100 barrels of brine.
- 8) All cement plugs will be 100' or 25 sacks cement, whichever is greater. Class 'C' cement will be used above 7500' and Class 'H' below 7500'. Plugs should be no more than 3000' apart
- 9) Site remediation due within one year of well plugging completion.