

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural ResourcesOIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505Form C-103
May 27, 2004

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-37126
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☐ FEE ☒
2. Name of Operator Apache Corporation		6. State Oil & Gas Lease No.
3. Address of Operator 6120 South Yale, Suite 1500 Tulsa, OK 74136-4224		7. Lease Name or Unit Agreement Name J.G. Hare
4. Well Location Unit Letter <u>M</u> : 430 feet from the <u>South</u> line and <u>530</u> feet from the <u>West</u> line Section <u>33</u> Township <u>21S</u> Range <u>37E</u> NMPM County <u>Lea</u>		8. Well Number <u>16</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3458'		9. OGRID Number <u>00873</u>
Pit or Below-grade Tank Application ☐ or Closure ☐		
Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____		
Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS. ☐ P AND A ☐
 CASING/CEMENT JOB ☐

OTHER: Re-stimulate and Activate ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

7/13/2006 MIRU. Drill out cmt and CIBP @ 3650'.
 7/17/2006 Drill out cmt and CIBP @ 3940'.
 7/24/2006 Squeeze Grayburg & San Andres perforations, 3696-3916' & 3954-4178', with 300 sxs.
 7/26/2006 Drill out cement and circ well clean. Test casing to 500 psi for 30 mins okay.
 7/27/2006 Perforate upper Grayburg at 3696 - 3716' with 2 jspf.
 7/28/2006 Acidize Grayburg with 2000 gals 15% HCl.
 7/31/2006 Frac Grayburg with 45,542 gals gel and 100,250# 20/40 sand.
 8/1/2006 RIH with 2-7/8" to 3744'. RIH with pump & rods.
 8/4/2006 Put on production producing Grayburg.

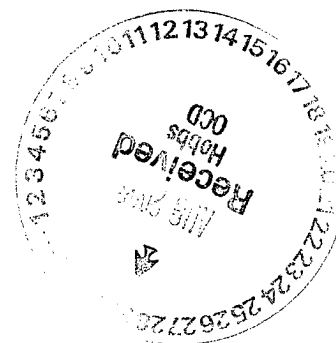

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Elaine Linton TITLE Engineering Technician DATE 08/25/2006

Type or print name Elaine Linton

For State Use Only

E-mail address: elaine.linton@apachecorp.com Telephone No. (918)491-5362

OC DISTRICT SUPERVISOR/GENERAL MANAGER

SEP 01 2006

APPROVED BY: Chris Williams TITLE _____ DATE _____

Conditions of Approval (if any):