

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-025-20137

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

State BB

8. Well No.

2

9. Pool name or Wildcat

Langlie Mattix 7 Rvrs Queen Grayburg

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Chevron USA Inc.

3. Address of Operator

15 Smith Rd, Midland, TX 79705

4. Well Location

Unit Letter D : 44D 430 feet from the North line and 990 feet from the West line

Section 2 Township 25-S Range 37-E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24 hrs prior to MI & RU.
2. RU on a string west-side. RIH Tag CIBP @ 3700, spot 65sx, plug 3700-1300 (Blinebry) WOC Tag.
3. RU on B string east-side, set 2 7/8 CIBP @ 3450, spot 55 sx, plug 3450-1300 (Grayburg-San Andres) WOC Tag.
4. Cut both strings 2 7/8 csgs @ 1300, L/D csgs.
5. Spot 160sx, plug 1300-850 (Stub, T-Salt, 9 5/8 shoe) WOC Tag.
6. Displace hole w/MLF, 9.5# brine w/25# gel P/BBL.
7. Spot 90 sx plug 250-Surf (Surf) WOC Tag.
8. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 9/3/2003

Type or print name G.R. Bledsoe Telephone No. (432) 687-7153

(This space for State use)

OC DISTRICT SUPERVISOR/GENERAL MANAGER

APPROVED BY Chris Williams TITLE OC DISTRICT SUPERVISOR/GENERAL MANAGER DATE SEP 09 2003


Conditions of approval, if any:

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR CHEVRON USA INC.
LEASE NAME STATE BB
WELL # 2

SECT 2 TWN 25-S RNG 37-E
FROM 430 40 NSL 990 EWL 1
TD 6300 FORMATION @ TD TUBB - Drinkard
PBDT FORMATION @ PBDT GRAYBURG - SA

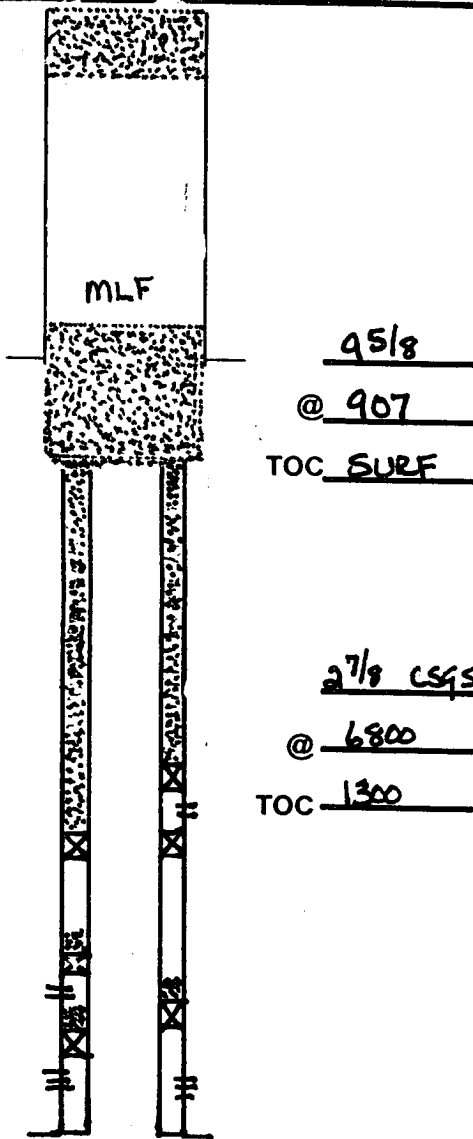

9 5/8
@ 907
TOC SURF

2 7/8 CSGS
@ 6800
TOC 1300

WEST EAST
A STRING B STRING

TD 6300

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	9 5/8	907	SURF	Ciec
INTMED 1				
INTMED 2	2 7/8	6300	1300	T.S
PROD	2 7/8	6300	1300	T.S

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	3505 - 3552
INTMED 2	OPENHOLE	
PROD	1300	

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	BLINEBRY	65	3700
YATES	2	CIBP	55	3450
QUEEN	3	9 5/8 SHO E	160	1300
GRAYBURG	4	SURF	90	250
SAN ANDRES				
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				