

UNITED STATES **OCD-HORBS**
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0137
Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
064118

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
Latigo Petroleum

3a. Address
P.O. Box 10304, Midland, TX 79701

3b. Phone No. (include area code)
432-617-0208

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
Unit 1 - 1980' FSL 660 FEL
Sec 34 T-23-S R-37-E

7. If Unit of CA/Agreement, Name and/or No.

8. Well Name and No.
Eva Blinbury # 1

9. API Well No.
30-025-10936

10. Field and Pool or Exploratory Area
Langlie Mattix 7 rvrs

11. Country or Parish, State
Lea County, New Mexico


12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☒ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other
	☐ Change Plans	☒ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

- 1) Rigged up Rig, RIH W/ Scraper, set down at 325' - OK'd to RIH open ended spot 50 sx cement at 3250'.
- 2) Spot 50 sx at 3,250', WOC, Tag at 2,872'. Circulate Salt Gel mud, spot 25 sx of cement at 2,519 ft, PUH to 1668' spot 25 sx of cement, POOH, WOC.
- 3) Tag cement at 1480', POOH w/ tubing. RIH w/ 7" Packer to 285', establish injection rate into Hole at 325', 1 1/2 - 2 bbls per minute, 200PSI. POOH w/ Packer. RIH open ended to 566', circulated hole clean w/ Fresh Water. Spot 40 sx of cement, calculated top of cement 334'. POOH w/ tbq. Set Packer at Surface, mix & sqz. 110 sx of cement, displaced below Packer & S.I.
- 4) Tag cement 10' below Packer, cut off well head, set Dry Hole Marker w/ 20 sx of cement, cut off Anchors, cleaned location & Moved off.

4/11/07

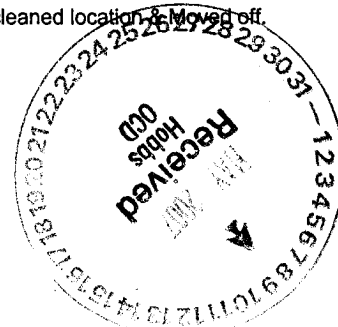

14. I hereby certify that the foregoing is true and correct.

Name (Printed/Typed)
Howard Boatright

Title AGENT

Signature

Handwritten signature of Howard Boatright

Date 04/12/2007

THIS SPACE FOR FEDERAL OR STATE OFFICE USE **ACCEPTED FOR RECORD**

Approved by

Title

Office

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

MAY 2 2007

Handwritten signature of Wesley A. Ingram
WESLEY A. INGRAM
PETROLEUM ENGINEER

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

GWW