

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-09865
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Priest
8. Well Number 004
9. OGRID Number 236378
10. Pool name or Wildcat Denton (Wolfcamp)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Saber Resources LLC

3. Address of Operator

400 W Illinois, Suite 950, Midland, Texas 79701

4. Well Location

Unit Letter D : 990 feet from the West line and 660 feet from the North line
Section 1 Township 15S Range 37E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3809'

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: Temporarily Abandon ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

5/10/07 - 5/10/07 - MIRU PU, NDWH & NU BOP. POH & fish all tbg & rods from well. Fish & LD 294 jnts of 2-7/8" tbg and 81 fiberglass rods & 175 steel rods. RIH with 4-3/4" tapered mill on 2-7/8" workstring to 9147'. POH, RU Gray WL. RIH with 5-1/2" CIBP and set @ 9060'. RIH with dump bailer and dump 20' cmt on top of plug. RU WL.
5/11/07 - Contacted Sylvia Dickey with NMOCD to notify of csg integrity test. Pressure up on casing to 510 psi. Shut in well. Ran chart for 30 minutes, no bleed off. Open well, RIH with WS and POH, LD. ND BOP and NUWH. Shut well in. Temporarily abandon. Charts attached.

TA expires
5/11/2012

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Doug Keathley TITLE ve - operations DATE 5/22/07


Type or print name Doug Keathley E-mail address: doug@saberresources.com Telephone No. 432-685-0169

For State Use Only

APPROVED BY: Chris Williams TITLE DISTRICT SUPERVISOR/GENERAL MANAGER DATE JUN 04 2007

Conditions of Approval (if any):

This Approval of Temporary
Abandonment Expires 5/11/12

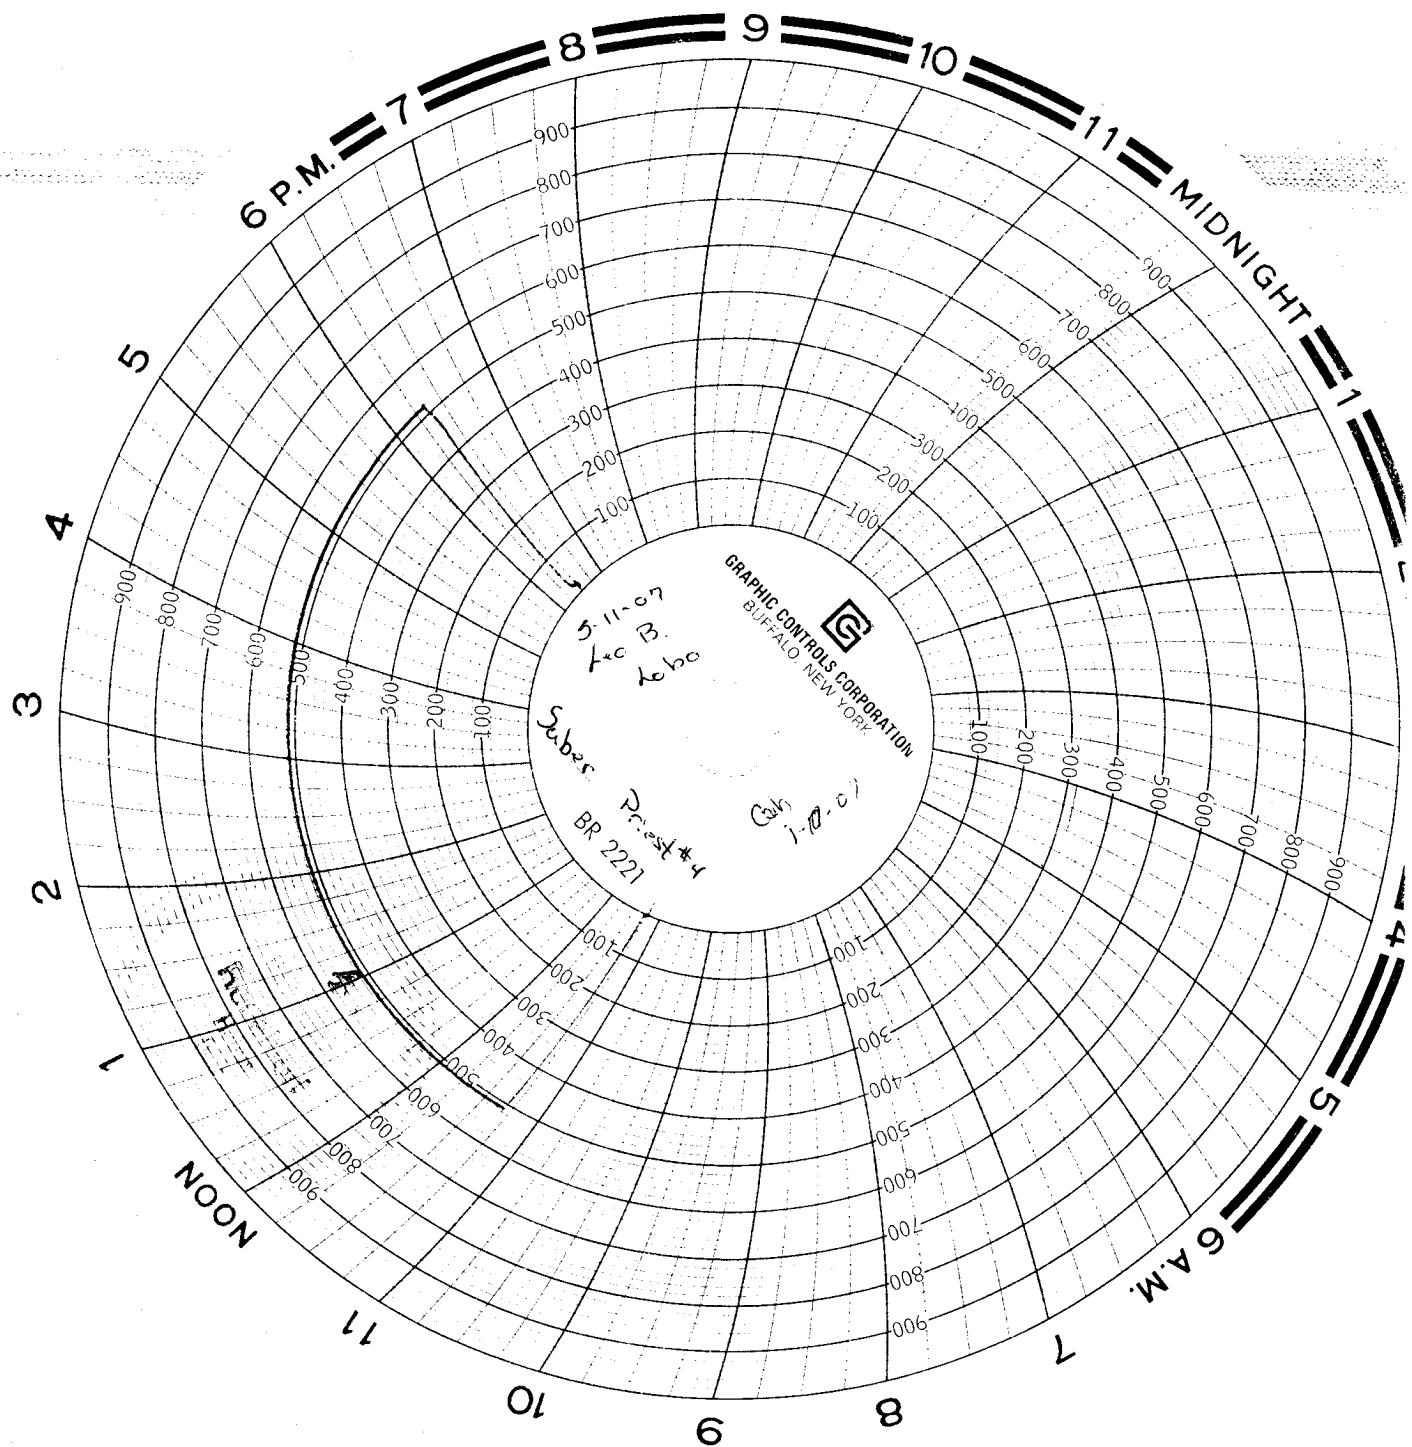

SABER RESOURCES
PRIEST #4
5/11/07
CSG. TEST