

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-33952
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	NEW MEXICO 'BZ' STATE NCT-10
8. Well No.	7
9. Pool Name or Wildcat	LANGIE MATTIX 7 RVR QUEEN GRAYBURG
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3154'

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMITS (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH ROAD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>L</u> : <u>1700</u> Feet From The <u>SOUTH</u> Line and <u>330</u> Feet From The <u>WEST</u> Line Section <u>2</u> Township <u>25-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3154'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: RECOMPLETE TO GRAYBURG ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8-05-03: MIRU PU. TIH TO 5200'.
8-06-03: PERF 3490-3504, 3558-3572, 3598-3614. PU PKR & TIH TO 3700. PUH ABOVE PERFS.
8-07-03: ACIDIZE PERFS 3490-3614 W/2,100 GALS 15% ANTI-SLUDGE HCL. SET PKR @ 3474.SN @ 3438. RU SWAB.
8-08-03: SWAB WELL.
8-11-03: PU PKR & SET @ 3418. NU FRAC STACK.
8-12-03: FRAC GRAYBURG PERFS 3490-3614 W/43,000 GALS YF135ST & SAND.
8-13-03: RU SWAB. REL PKR. TIH W/BIT & TIH TO 3800' TO TAG FOR FILL. (NO FILL). PUH ABOVE PERFS.
8-14-03: TIH W/BPMA, PERF SUB, SN, 2 3/8" TBG & TAC. RIG DOWN. TURN WELL OVER TO PRODUCTION TO RUN RODS.

FINAL REPORT

9-02-03: ON 24 HR OPT. PUMPING 7 OIL, 25 GAS, & 160 WATER.

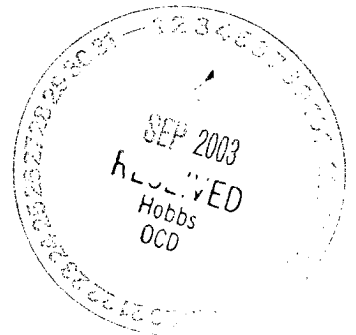

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Leake TITLE Regulatory Specialist DATE 9/3/2003

TYPE OR PRINT NAME Denise Leake Telephone No. 915-687-7375

PETROLEUM ENGINEER

(This space for State Use)

APPROVED [Signature] TITLE
CONDITIONS OF APPROVAL, IF ANY:

DATE

SEP 19 2003