

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-23624
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: SFPRR
8. Well No. 10
9. OGRID Number 151228
10. Pool name or Wildcat West Sawyer San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Mar Oil and Gas Corp

3. Address of Operator
PO Box 5155 Santa Fe, 87502

4. Well Location
Unit Letter **N** **660** feet from the **South** line and **2180** feet from the **West** line
Section **28** Township **9S** Range **37E** NMPM County **Lea**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____
Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____


12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPNS. ☐
PULL OR ALTER CASING ☐	CASING/CEMENT JOB ☐
PLUG AND ABANDON ☐	ALTERING CASING ☐
CHANGE PLANS ☐	P AND A ☒
MULTIPLE COMPLETION ☐	
OTHER: ☐	OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

6/29/07 MIRU. POH w/ rods. Circulated well w/ mud laden fluid. SDFN.
7/02/07 Tried to pull tbg. Tbg. stuck. SDFN.
7/03/07 Freepoint tbg. Cut tbg. @ 2715. Pulled tbg up to 2100. WIH w/ perf. gun. Perf csg. @ 2715. Sqzd. 50 sx. cement. SDFN.
7/04/07 Tagged plug @ 2365. WIH w/ wireline and perf. csg. @ 2360. Sqz. 50 sx. cement. SDFN. WOC.
7/05/07 Tagged plug @ 2270. COH. Perf. csg @ 467. Sqx. 100 sx cement and Circulated cement to surface. Rigged down. Cut off well head. Weld on Dry Hole Marker. Cleaned location.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

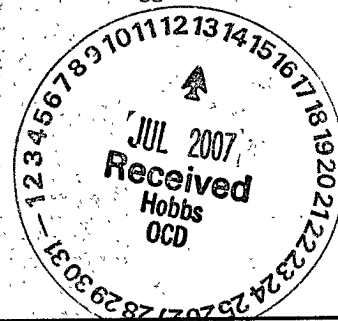

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCB guidelines ☐ a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Billy E. Prichard TITLE Foreman DATE 7/10/07

Type or print name Billy E. Prichard E-mail address: shabillron01@warpdiveonline.com Telephone No. 505-390-9100

For State Use Only
APPROVED BY Larry W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE JUL 16 2007
Conditions of Approval (if any)