

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised March 25, 1999

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-24712
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		7. Lease Name or Unit Agreement Name:  Brewer 689-C Ltd.
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other		8. Well No. 1
2. Name of Operator BTA Oil Producers		9. Pool name or Wildcat North Bagley, Permo Penn
3. Address of Operator 104 S. Pecos, Midland, TX 79701		
4. Well Location  Unit Letter <u>A</u> : <u>560</u> feet from the <u>North</u> line and <u>560</u> feet from the <u>East</u> line  Section <u>6</u> Township <u>12S</u> Range <u>33E</u> NMPM Lea County		
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 4292' GL 4302' KB		


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

BTA Oil Producers P&A'd this well as follows:

1. Spotted 50 sx plug @ 8400-8120' - tagged.
2. Cut and pulled 5-1/2" casing @ 3770'.
3. Spotted 65 sx cmt plug @ 3820-3547' - tagged.  
Covered 5-1/2" stub @ 3770' & 8-5/8" shoe @ 3725'.
4. Spotted 50 sx @ 2500-2335' (Yates).
5. Cut and pulled 8-5/8" casing @ 870'.
6. Spotted 55 sx @ 920-804' - tagged (8-5/8" stub).
7. Spotted 100 sx @ 440-295' - tagged (13-7/8" shoe).
8. Spotted 35 sx @ 60'-surface.  
P&A 9/25/03.
9. Installed dry hole marker.

Approved as to plugging of the Well Bore.  
Liability under bond is retained until  
surface restoration is completed.

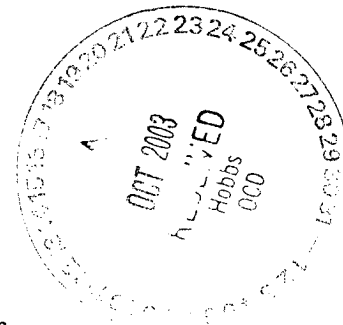

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Pam Inskeep TITLE Regulatory Administrator DATE 10/15/2003

Type or print name Pam Inskeep Telephone No. 432-682-3753

(This space for State use)  
APPROVED BY Gary W. Wink TITLE OC DISTRICT SUPERVISOR/GENERAL MANAGER DATE OCT 21 2003  
Conditions of approval, if any: