

DISTRICT I

P O Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd , Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO	30-025-38019
5 Indicate Type of Lease	STATE ☐ FEE ☒
6 State Oil / Gas Lease No	
7 Lease Name or Unit Agreement Name	L.R. KERSHAW
8 Well No	16
9 Pool Name or Wildcat	MONUMENT: TUBB

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1 Type of Well OIL WELL ☒ GAS WELL ☐ OTHER ☐

2 Name of Operator CHEVRON USA INC

3 Address of Operator 15 SMITH RD, MIDLAND, TX 79705

4 Well Location
Unit Letter A 990 Feet From The NORTH Line and 500 Feet From The EAST Line
Section 13 Township 20-S Range 37-E NMPM LEA COUNTY

10 Elevation (Show whether DF, RKB, RT,GR, etc) 3557' GL

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐ NEW WELL COMPLETION ☒

12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103

9-27-07: MIRU KEY #320 TIH W/BIT. 9-28-07. CSG DID NOT HOLD 10-01-07. TIH W/PKR TO 3838. PUH TO 3774.
10-02-07. RUN GR/CCL/CBL PERF DRINKARD PERFS 6711-14, 6730-38, 6778-84, 6800-15, 6818-38
10-03-07: TIH W/PKR SPOT 500 GALS ACID ACR PERFS 6711-6838. SET PKR PUMP 2700 GALS 20% HCL. 10-05-07. SWABBING. TIH W/PRESSURE BOMBS 10-08-07. REL PKR TIH W/PKR & SET @ 4514. 10-11-07 FRAC DRINKARD PERFS W/30,000 GALS YF125FT & SAND.
10-12-07: TIH W/GAUGE RING TO 6670. TIH W/PLUG & SET @ 6630.
10-15-07: TIH W/CCL, GAMMA, PERF 6482-6490, 6494-6497, 6518-6526, 6564-6574, 6605-6608 EOT @ 6442.
10-17-07: TIH W/TBG. EOT @ 6615. SPOT 15% ANTI SLUDGE ACID. SET PKR ACIDIZE 6605-6608, 6564-6574, 6518-26, 6494-97, 6482-90 EOT @ 6442. REV OUT. 10-18-07: SWAB. 10-19-07. SET PRESSURE BOMBS 10-22-07: UNSET PKR
10-23-07: SET PKR @ 4515. FRAC TUBB PERFS W/72,000 GALS 50 QUAL WF150 FOAM 10-24-07 FLOW BACK WELL
10-25-07: TAG FILL @ 6610 TIH W/GAUGE RING TO 6200 TIH W/PLUG & SET @ 6000 10-26-07. TIH W/PKR & SET. REL PKR PERF BLINEBRY 5730-82, 5858-80, 5824-46 10-29-07: TIH W/PKR & SET
10-30-07: REL PKR TREAT PERFS 5730-5880 W/1200 GALS 15% NEFE HCL. REV CIRC 50 BBLS. SET PKR @ 5677 PUMP 1200 GALS 15% NEFE HCL. 10-31-07: SWAB 11-01-07: SET PRESSURE BOMBS. 11-05-07 REL PKR. TIH W/PKR TO 4512. 11-07-07: FRAC BLINEBRY PERFS W/68,000 GALS YF125FT. 11-08-07: TIH W/BIT TO 4835. 11-09-07. TAG SAND @ 5921. DRILL OUT TO 6015. PULL UP TO 4835.
11-12-07: DRILL OUT CIBP TO 6630. TIH & TAG @ 7315 PULL UP TO 4835 11-13-07: BROKE CIRC @ 4835 TIH TO 7315. DRILL DN TO DBTD @ 7507. 11-14-07. KILL W/50 BBLS DN TBG 11-15-07. TIH W/PKR & SET @ 5667 BAKER ATLAS RAN PRIZM LOG. TAG TD @ 7503. SWAB
11-16-07: SWAB 11-19-07. SWAB. 11-20-07: TIH W/PKR & SET @ 5950 11-21-07: SWAB 11-26-07: TIH W/200. ITS TBG TO 6327.
11-27-07: PU PUMP & TIH W/2 7/8" TBG. SET PUMP @ 5827. FINAL REPORT W/O TEST.

12-02-07. ON 24 HR OPT. PUMPING 157 OIL, 502 GAS, & 650 WATER. GOR-3198 DHC #HOB-0170 (BLINEBRY, TUBB, DRINKARD)

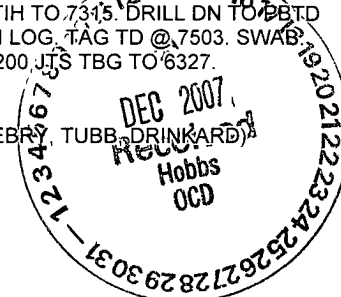

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist

DATE 12/12/2007

TYPE OR PRINT NAME Denise Pinkerton

Telephone No 432-687-7375

(This space for State Use)

APPROVED

Chris Williams

OC DISTRICT SUPERVISOR/GENERAL MANAGER

CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE

JAN 09 2008