

DISTRICT I

P O Box 1980, Hobbs, NM 88240

DISTRICT II

P O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO	30-025-25720
5 Indicate Type of Lease	STATE ☒ FEE ☐
6 State Oil / Gas Lease No	B- 1334
7 Lease Name or Unit Agreement Name	CENTRAL VACUUM UNIT
8 Well No	45
9 Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1 Type of Well	OIL WELL ☐ GAS WELL ☐ OTHER ☒ WATER INJECTION WELL
2 Name of Operator	CHEVRON USA INC
3 Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4 Well Location	Unit Letter C 121 Feet From The NORTH Line and 2475 Feet From The WEST Line Section 31 Township 17S Range 35E NMPM LEA COUNTY
10 Elevation (Show whether DF, RKB, RT,GR, etc)	3977' GL

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☒ ADD PERFS & ACIDIZE

12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103

12-06-07: MIRU
12-07-07: REL ON/OFF TOOL CIRC BW LATCH BACK ON PKR @ 4331.
12-10-07: REL PKR @ 4331 DISPL W/BW WELL ON VAC TIH & TAG @ 4732
12-11-07: C/O TO 4783. DISPL W/50 BBLS BW PERF 4390-4766 TIH W/GUNS & TAG @ 4431. TIH W/WS TO 2523.
12-12-07: TIH & TAG @ 4431. TIH & TAG @ 4450. TAG @ 4765 DRILL 4765-4772. PU BHA & TIH W/130 JTS 2 3/8" WS TO 4301
12-13-07: MILL TO 4783 LOWER MILL TO TAG @ 4780. C/O TO 4783. PERF 4390-4766. TIH W/GUNS TAG UP @ 4590.
12-14-07: MILL 4411-4783. MILL @ 4475-4476, 4560-4590, 4602-4634 LOST CIRC. PULL ABOVE PERFS @ 4411
12-17-07: MILL 4411-4781. C/O TO 4783 TIH W/2 3/8" WS TO 2523.
12-18-07: ROTATING 4634-4781. TAG FILL
12-19-07: TIH W/GUNS TO PERF IN 4 1/2" CSG FR 4766-4617
12-20-07: PERF 4592-4602, 4460-4470, 4516-4522, 4446-4450, 4450-4460, 4420-4430, 4430-4440, 4390-4394, 4405-4408 TIH TO 4354.
12-21-07: SPOT 8 BBLS 15% HCL TIH W/PKR TO 4329.
12-26-07: PMP 6000 GALS 15% ACID FR 4390-4766.
12-27-07: PMP 6000 GALS 15% ACID.
12-28-07: FLOWING.
01-02-08: REL PKR TIH TO TAG BAD CSG @ 4756 MILL THRU @ 4756 FELL THRU TO 4783.
01-03-08: TIH W/2 3/8" TBG. EOT @ 4328 SET PKR @ 4328. CIRC PKR FLUID 65 BBLS.
01-04-08: CHART & TEST TO 520# FOR 35 MINS LEAK OFF 10# GOOD. RIG DOWN. FINAL REPORT

RECEIVED

JAN 11 2008

HOBBS OCD


I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 1/9/2008
TYPE OR PRINT NAME Denise Pinkerton Telephone No 432-687-7375

(This space for State Use)

APPROVED Chris Williams TITLE OC DISTRICT SUPERVISOR/GENERAL MANAGER
CONDITIONS OF APPROVAL, IF ANY DATE

MAR 18 2008

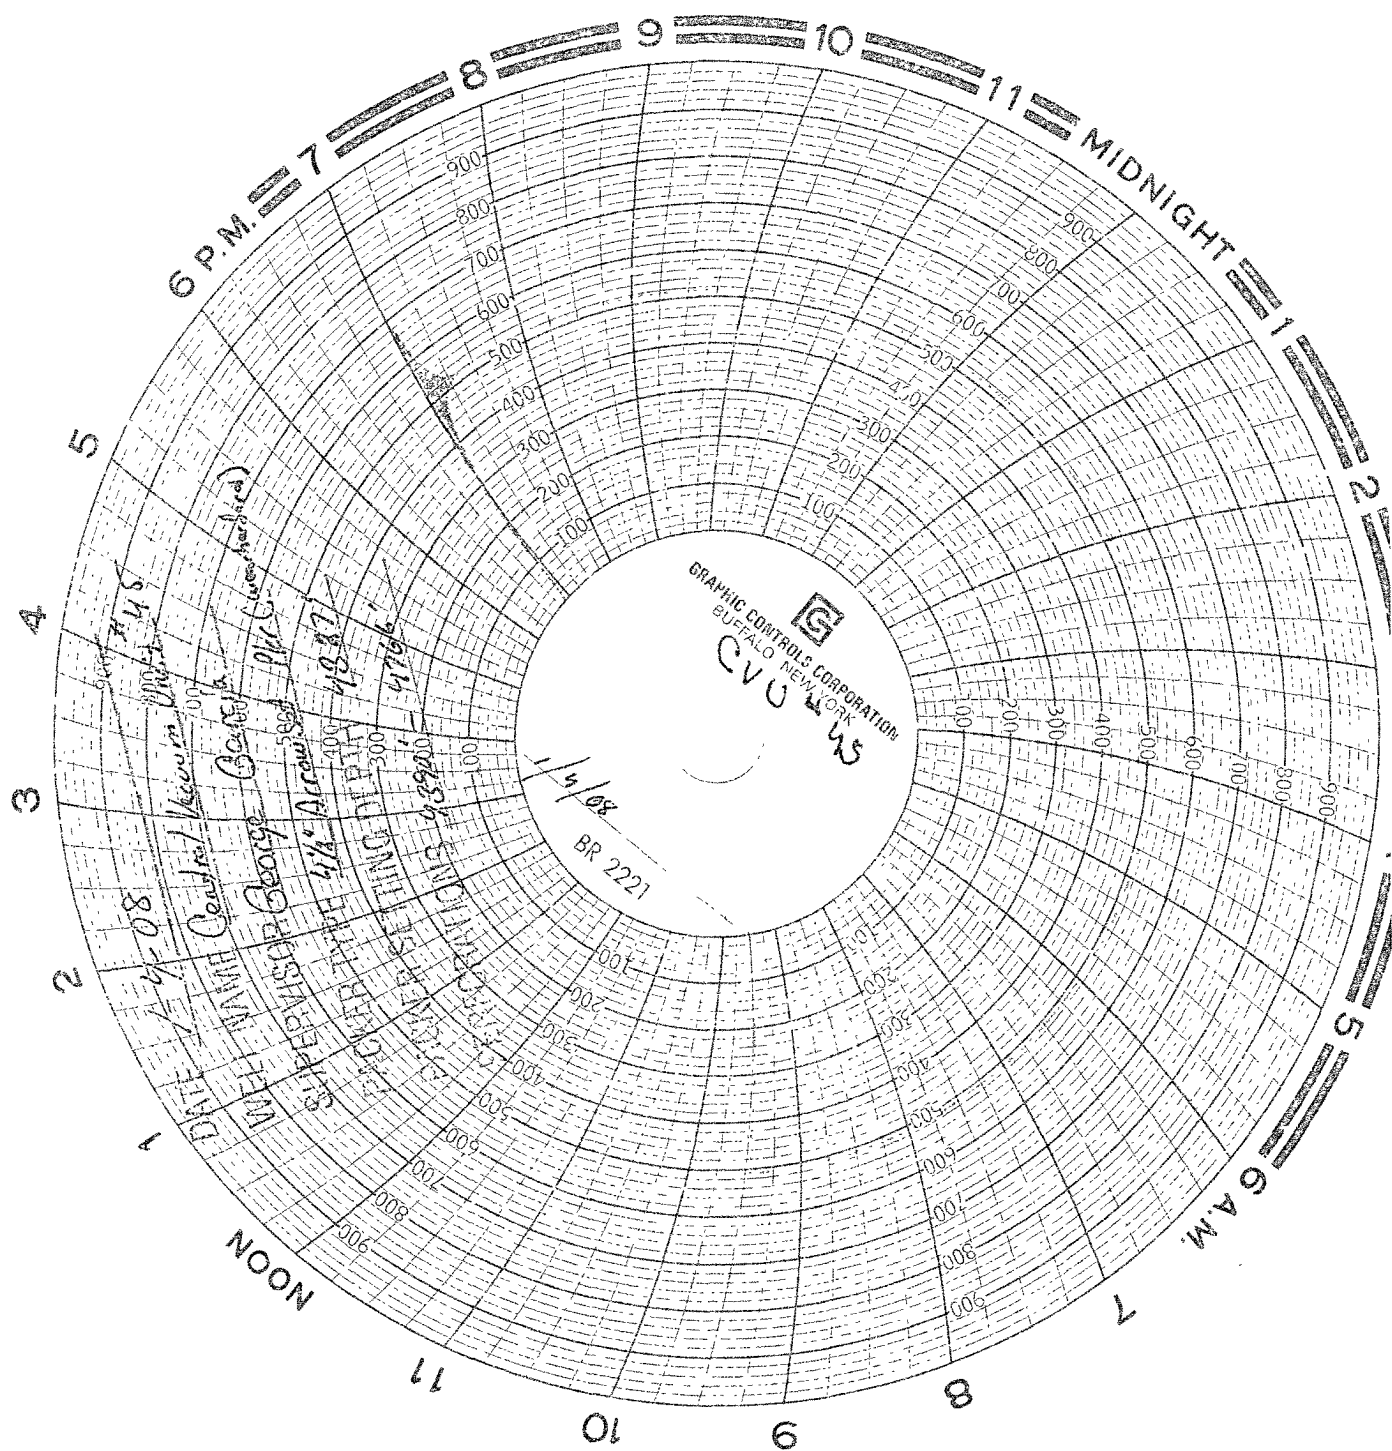

Control Vacuum Unit #45
121' FNL - 2.475 FWL
API: 30-025-25720
Unit Ltr: C
Section 31
TSHP: 517
Range: 35E