

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised May 08, 2003

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

|  |  |   |
|--|--|---|
| <b>SUNDRY NOTICES AND REPORTS ON WELLS</b><br>(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)          |  | WELL API NO.<br>30-025-33671  |
| 1. Type of Well:<br>Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>  |  | 5. Indicate Type of Lease<br>STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/> |
| 2. Name of Operator<br>Amerada Hess Corporation  |  | 6. State Oil & Gas Lease No.  |
| 3. Address of Operator<br>P.O. Box 840 Seminole, Texas 79360   |  | 7. Lease Name or Unit Agreement Name<br>W.A. Weir 'B'   |
| 4. Well Location<br>Unit Letter <u>F</u> : <u>2310</u> feet from the <u>North</u> line and <u>1650</u> feet from the <u>West</u> line<br>Section <u>26</u> Township <u>19S</u> Range <u>26E</u> NMPM County <u>Lea</u> |  | 8. Well Number<br>4   |
| 11. Elevation (Show whether DR, RKB, RT, GR, etc.)<br>3676' GR   |  | 9. OGRID Number<br>000495   |
|  |  | 10. Pool name or Wildcat<br>Monument ABO  |

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

10/7/03 thru 10/19/03

Aries Well Svc MIRU pulling unit. TOH w/rods & pump. Removed wellhead & installed BOP. TIH w/tbg & prod eqpt. TIH w/tbg to 7530' and 5 1/2" pkr set @ 7102'. BJ Svs MIRU & spotted 200 gals of Toluene & 800 gals of Xylene mixed down tbg. Swabbed well. BJ Svs acidized Abo zone perms from 7192'-7401' w/4700 gals of 15% HCL acid. Swabbed well. Released pkr & TOH w/tbg & pkr. TIH w/tbg, removed BOP, installed wellhead & set tbg OE @ 7334'. TIH w/repair 25-150-RHBC-20-6-9 4 sucker rod pump. Spaced out pump, loaded tbg & returned well to production. RDPU and cleaned location.

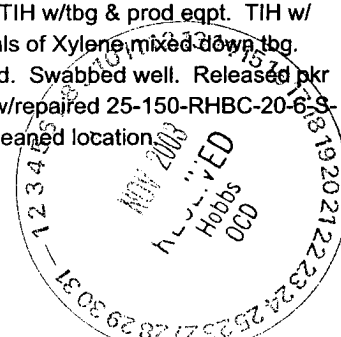

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carol J. Moore TITLE Senior Advisor DATE 11/3/2003

Type or print name Carol J. Moore cmoore@hess.com Telephone No. (432)758-6738

(This space for State use)

APPROVED BY Gay W. Wink FIELD REPRESENTATIVE II/STAFF MANAGER DATE NOV 10 2003  
Conditions of approval, if any: