Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

5. Lease Serial No.

FORM APPROVED OMB NO. 1004-0135 Expires: November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter applications abandoned well. Use Form 3160-3 (APD) for such prophers

LC032339A 6. If Indian, Allottee or Tribe Name

abandoned well. Use Full	111 3 180-3 (AFD) for such proposals 3000	_
SUBMIT IN TRIPLICATE - Other instructions on reverse side		7. If Unit or CA/Agreement, Name and/or No.
1. Type of Well Oil Well Gas Well Other 2. Name of Operator OXY USA Inc. 3a. Address P.O. Box 50250, Midland, TX 79710- 4. Location of Well (Footage, Sec., T., R., M., or Survey & 658 FNL 1964 FWL NENW(C) Sec 3 T2	Description)	8. Well Name and No. G.H. Mattix #2 Federal 9. API Well No. 30-025-10989 10. Field and Pool, or Exploratory Area Langlie Mattix 7R Qn 11. County or Parish, State Lea NM
12. CHECK APPROPRIATE	BOX(ES) TO INDICATE NATURE OF NOTICE, REF	ORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION	I
If the proposal is to deepen directionally or recomp	Alter Casing Fracture Treat Reclamati	roposed work and approximate duration thereof.
testing has been completed. Final Abandonment N determined that the final site is ready for final inspe	BP-3090' 10/08 5" hole, TOC-Surf-Circ ole, TOC-Surf-Circ P 25sx cmt to 2970' Cxac. Hole Tag Tag Tag SE	APPROVED DEC 1 2008 JAMES A. AMOS SUPERVISOR-EPS E ATTACHED FOR NDITIONS OF APPROVAL
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)	Title	
David Stewart	Sr. Regulatory An	alyst
12.85	Date u(18/08	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE		
Approved by Conditions of approval, if any, are attached. Approval of	Title Title	Date
certify that the applicant holds legal or equitable title to which would entitle the applicant to conduct operations the	those rights in the subject lease	

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

OXY USA Inc. G.H. Mattix Federal #2 API No. 30-025-10989

25sx @ 100'-Surface


25sx @ 362-262'

60sx @ 1275-1060' WOC-Tag

50sx @ 2550-2350' WOC-Tag

25sx @ 3070-2970'

10/08-CIBP @ 3090' w/ 5sx

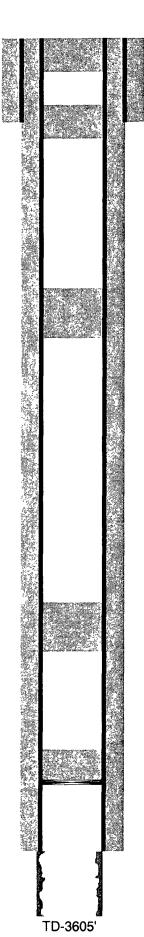


15" hole @ 312' 13-3/8" csg @ 312' w/ 175sx-TOC-Surf-Circ

8" hole @ 3313' 7" csg @ 3313' w/ 875sx-TOC-Surf-Circ

OH @ 3313-3605'

OXY USA Inc. G.H. Mattix Federal #2 API No. 30-025-10989

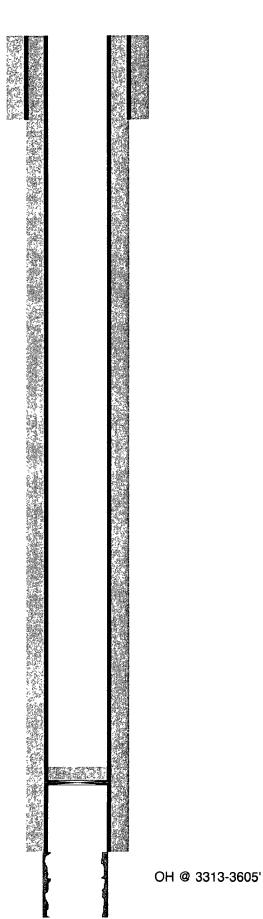

15" hole @ 312' 13-3/8" csg @ 312' w/ 175sx-TOC-Surf-Circ

8" hole @ 3313' 7" csg @ 3313' w/ 875sx-TOC-Surf-Circ

TD-3605'

10/08-CIBP @ 3090' w/ 5sx

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.