Office State of New Mexico	Form C-103
District I District I Market State of the Fig. Minerals and Natural Resources	June 19, 2008 WELL API NO.
1025 N. FIGHT DL., 11000S, NW 00240	30-025-35099
District III 1301 W Grand Ave, Artesia, NM 8 10 2 10 1 CONSERVATION DIVISION District III 1220 South St. Francis Dr.	5. Indicate Type of Lease
District IV District IV District IV District IV Tool Rio Brazos Rd , Aztec, NM 87505 Santa Fe, NM 87505	STATE S FEE 6. State Oil & Gas Lease No.
1220 S St. Francis Dr., Santa Fe, NM	
87505 SUNDRY NOTICES AND REPORTS ON WELLS	E-3788 7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name of Olin Agreement Name
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	Grouper State
1. Type of Well: Oil Well Gas Well Other	8. Well Number 2
2. Name of Operator Mack Energy Corporation	9. OGRID Number 013837
3. Address of Operator	10. Pool Name or Wildcat
P.O. Box 960 Artesia, NM 88210	Anderson Ranch Queen
4. Well Location	
Unit Letter K 2308 feet from the South line and	1980 feet from the West line
Section 14 Township 16S Range 32E	NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR etc. 4280' GR	,
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ REMEDIALWOR	
 = 	ILLING OPNS. P. AND A
PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMEN	
DOWNHOLE COMMINGLE	
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.	
Notify OCD 24 hours prior to starting plugging operations.	NAMES WHILL BOOK AND ALL
1) Set CIBP @ 3600' w/ a 35' cmt cap.	
2) Set 25sx cmt plug from 2500' to 2250', WOC tag (Top of Yates/bottom salt) 3) Set 25sx cmt plug from 1300' to 1530'. WOC tag (Top of salt) 1200 - 1450	
3) Set 25sx cmt plug from 1300 to 1550, WOC tag (Top of salt) 4) Set 25 sx cmt from 585 to 335, WOC tag (8 5/8" csg shoe)	
5) Set 10sy cmt from 100' to surface	
C) Install D. S. A. Marilani	onservation Division Must be notified
24 hours prior to the beginning of plugging operations	
Note: Circ. well with salt gel mud consisting of at least 9.5# Brine with 25 pounds	*
of gel per barrel after the bottom plug is set.	
Spud Date: Rig Release Date:	
Spud Date: Rig Release Date: 1/23/2006	/26/2006
I hereby certify that the information above is true slid complete to the best of my knowledge and belief.	
SIGNATURE L. Shevel TITLE Production Clerk DATE 1/29/09	
	ergycorp.com PHONE: (575) 748-1288
For State Use Only Moil Address A. M. Company	
APPROVED BY: TITLE TITLE	DATE 2/3/2009
Conditions of Approval (if any):	


COMPLIANCE OFFICER

Mack Energy Corporation

Grouper State #2 30-025-35099 Sec. 14 T16S R32E

Before

After

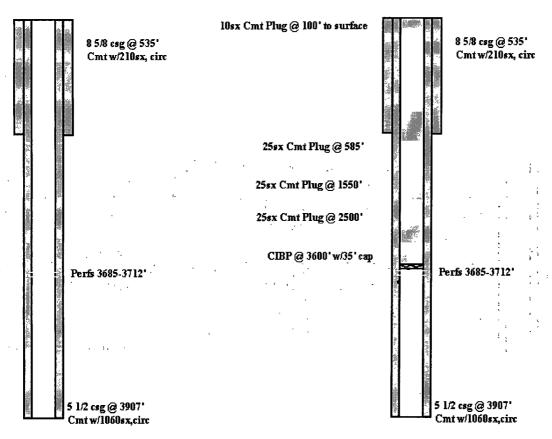

TD 3907'

TD 3907'