

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.
30-025-09938

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

Alice Paddock

8. Well No.

1

9. Pool name or Wildcat

Blinebry

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Chevron USA Inc

3. Address of Operator

15 Smith Rd, Midland, TX, 79705

4. Well Location

Unit Letter O : 660 feet from the South line and 1980 feet from the East line

Section 1 Township 22-S Range 37-E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐


COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Notify OCD 24 hrs prior to MI and RU.
2. Set 5 1/2 CIBP at 5400, spot 25sx, plug 5400-5200 (Blinebry) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Spot 30sx, plug 2950-2700 (8 5/8 shoe) WOC Tag.
5. Cut 5 1/2" csg at 2300, L/D csg.
6. Spot 40sx, plug 2350-2200 (Stub, B-Salt) WOC Tag.
7. Spot 60sx, plug 1200-1000 (T-Salt) WOC Tag.
8. Perf 4 holes at 370, sqz 125sx, plug 375-150 8 5/8 x 13 3/8 (13 3/8 shoe) WOC Tag.
9. 10sx Surf, install dry hole marker.

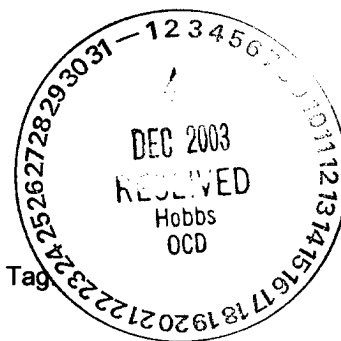

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 12/1/2003

Type or print name G.R. Bledsoe

Telephone No. (432) 687-7153

(This space for State use)

APPROVED BY Gary W. Wink

OC FIELD REPRESENTATIVE II/STAFF MANAGER
TITLE _____ DATE _____

Conditions of approval, if any:
THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME ALICE PADDOCK


WELL # 1

SECT 1 TWN 22-5 RNG 37-E

FROM 660 NSL 1980 EWL

TD 5843 FORMATION @ TD Bline Bay

PBTD FORMATION @ PBTD

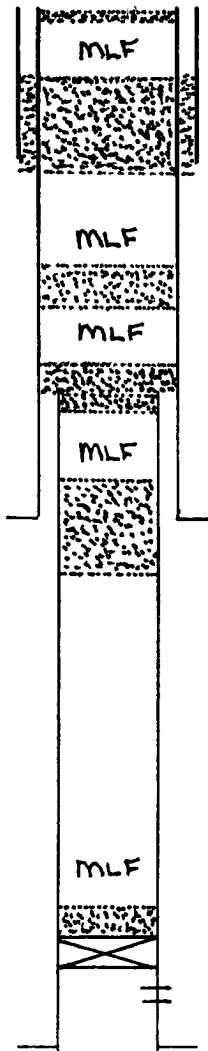

13 3/8

@ 313

TOC SURF

8 5/8

@ 2883

TOC SURF

5 1/2

@ 5843

TOC 2330

TD 5843

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	13 3/8	313	SURF	Circ
INTMED 1	8 5/8	2883	SURF	CALC
INTMED 2				
PROD	5 1/2	5843	2330	T.S

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL		TOP - BOTTOM
INTMED 1		PERFS	5461 - 5541
INTMED 2		OPENHOLE	
PROD	2300		

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP	25	5400
YATES	2	8 5/8 SHOE	30	2950
QUEEN	3	STUB	40	2350
GRAYBURG	4	T-SALT	60	1200
SAN ANDRES	5	13 3/8 S	125	375
	6	SURF	10	10
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				