

RECEIVED

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

OCD-HOBBS

FORM APPROVED  
OMB NO 1004-0137  
Expires March 31, 2007

APR 14 2009

HOBBS

## SUNDY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an  
abandoned well. Use Form 3160-3 (APD) for such proposals.

## SUBMIT IN TRIPLICATE - Other instructions on reverse side

## 1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other

Injection

## 2. Name of Operator

XTO Energy Inc.

## 3a Address

200 N. Loraine, Ste. 800 Midland, TX 79701

## 3b Phone No (include area code)

432-620-6740

## 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1860' FSL &amp; 1980' FEL; Unit Ltr. J, Section 18, T-21S, R-36E

## 5. Lease Serial No.

LC-031740-A

## 6. If Indian, Allottee or Tribe Name

## 7. If Unit or CA/Agreement, Name and/or No.

NM-70948A

## 8. Well Name and No.

Eunice Monument #410 WIW ✓  
South Unit

## 9. API Well No

30-025-30281 ✓

## 10. Field and Pool, or Exploratory Area

Eunice Monument; Grayburg- ✓  
San Andres

## 11. County or Parish, State

Lea NM ✓

## 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

## TYPE OF SUBMISSION

☐ Notice of Intent☒ Subsequent Report☐ Final Abandonment Notice

## TYPE OF ACTION

☐ Acidize☐ Deepen☐ Production (Start/Resume)☐ Water Shut-Off☐ Alter Casing☐ Fracture Treat☐ Reclamation☐ Well Integrity☐ Casing Repair☐ New Construction☐ Recomplete☒ Other Reactivate☐ Change Plans☐ Plug and Abandon☐ Temporarily AbandonInjection Well☐ Convert to Injection☐ Plug Back☐ Water Disposal

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

03/08/09 MIRU & rack 134 jts of 2-7/8" L-80 WS. ND WH. NU BOP. MI Rev Unit. PU & RIH w/4-3/4" bit on 6-3-1/2" DC's & 115 jts of WS. Tag CIBP @ 3,917'. RU swivel. Brk circ & DO CIBP. RD & POOH.

03/11/09 PU & RIH w/1 jt of 2-7/8" WS. Tag CIBP @ 3,909'. RU swivel. DO CIBP, chase dwn hole to 4,010. DO CIBP & fill to 4,024'. Unable to make hole. Circ clean. RD. POOH & ck'd bit. PU & RIH w/new 4-3/4" bit to 3,900'.

03/12/09 RIH w/2-7/8" L-80 WS. Tag CIBP & fill @ 4,024'. RU swivel, brk circ w/45 bbls of 9# brine wtr. DO CIBP & clean out fill from 4,024'-4076'. CHC, RD. POOH w/WS & LD bit. RU wireline. PU & RIH w/5-1/2" WL set CIBP & tag tight spot @ 4,027'. POOH & LD CIBP. RD WL trk. PU & RIH w/4-3/4" tapered mill, 2-7/8" L-80 tbg & tag @ 4,027'. Work mill & clean out scale ring from 4,024'-4,076'. POOH & LD mill.

03/13/09 RU JW Wireline. PU & RIH w/guage ring & junk basket to 4,069'. POOH & LD ring & basket. PU & RIH w/5-1/2" WL set CIBP & set @ 4,060'. POOH & RD WL equipment. PU & RIH w/BJ 5-1/2" trt pkr on 2-7/8" L-80 tbg. Set pkr @ 4,055' to tst tools, unable to set pkr. PUH & set pkr @ 3,886'. L&T TCA w/30 bbls of 9# BW & monitor. RU acidize equipment. Acidize GB perfs fr 3,968'-4,042' in 3 stages w/4,000 gal 20% HCL - 90/10 acid & 2,500 lbs of RS. RD. Blocked off on second stage of RS, work salt thru tbg, pmp 3rd acid stage.

Procedure-Cont'd on next Pg.

## 14 I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

Kristy Ward

Title

Regulatory Analyst

Date 03/23/09

## THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

BUREAU OF LAND MANAGEMENT  
CARLSBAD FIELD OFFICE


Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

PLM

**EMSU #410 WIW**  
**Reactivate Injection Well**

03/14/09      Lite Vacuum. RU Swab. RIH w/2-7/8" swab cups. Made 16 runs. RD. RIH & tag COBP @ 4,052'. POOH & LD prk & 2-7/8" L-80 WS.

03/17/09      MI & rack 126 jts of 2-3/8" TK-70 IPC tbg. PU & RIH w/BJ Arrow set 1X – ENP/IPC 5-1/2" inj pkr w/on/off tool & 1.781 F profile Npl. On 122 jts of 2-3/8" TK-70 tbg. Set pkr @ 3,873'. RU pmp trk. Circ TCA w/100 bbls of Champion R-2246 pkr fluid. ND BOP. NU WH. Top off TCA. RD. RDMO PU. Waiting for approval to RWTI.

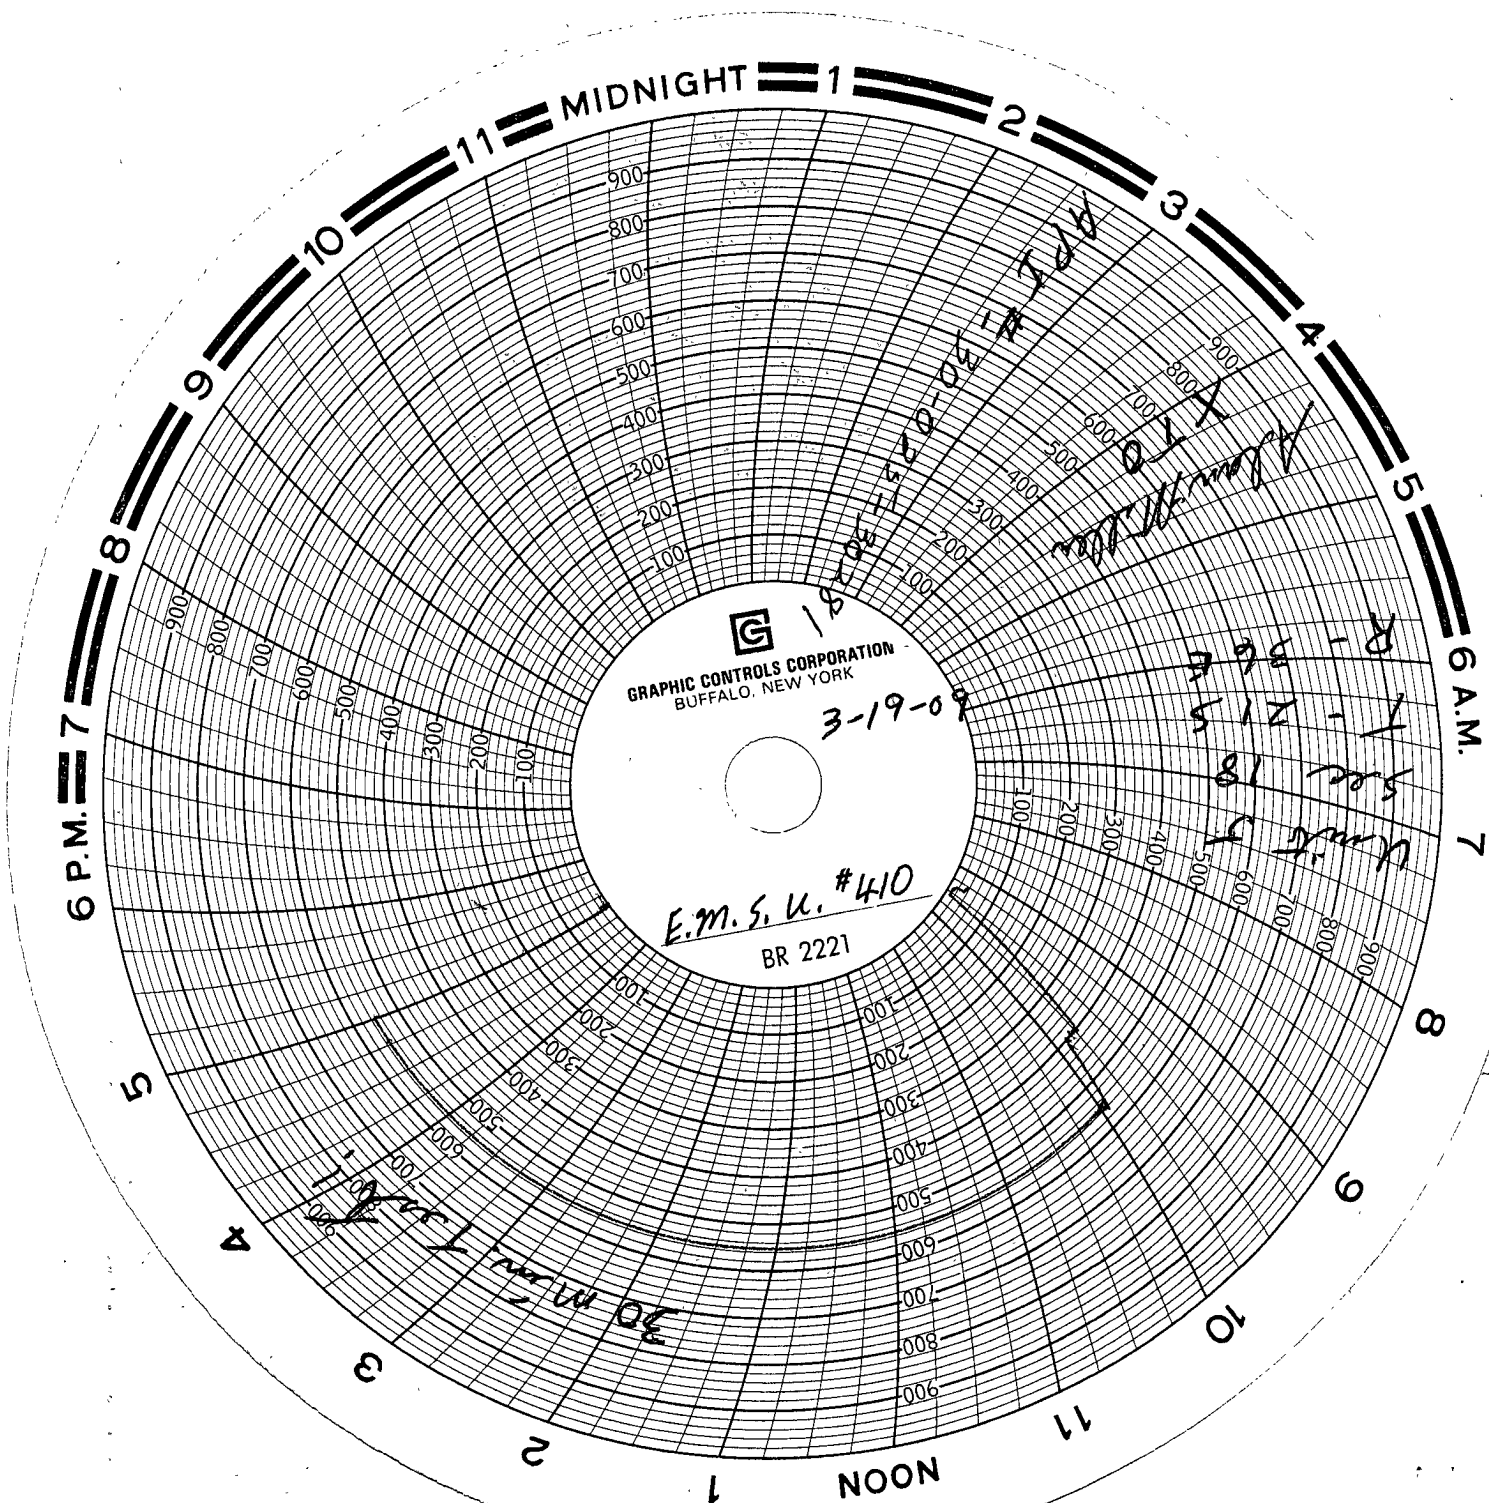

Lobo Trucking  
unit #16

3-19-09

Bobby Parkhurst.

Caliber Date 12-27-08

0 PSI surf-