

June 19, 2008

## District I

1625 N French Dr., Hobbs, NM 88249

## District II

1301 W. Grand Ave., Artesia, NM 88210

## District III

1000 Rio Brazos Rd., Aztec, NM 87410

## District IV

1220 S St. Francis Dr., Santa Fe, NM 87505

87505

**RECEIVED**

MAY 05 2009

**HOBBSOCD**

## OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO.

30-025-07736

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil &amp; Gas Lease No.

7. Lease Name or Unit Agreement Name  
Fred Turner

8. Well Number

1

9. OGRID Number

147179

10. Pool name or Wildcat  
Momument; Tubb

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐2. Name of Operator  
Chesapeake Operating, Inc.3. Address of Operator P.O. Box 18496  
Oklahoma City, OK 73154-0496

## 4. Well Location

Unit Letter P : 660' feet from the South line and 560' feet from the East line  
Section 6 Township 20S Range 38E NMPM County Lea11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3569' GR

## 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

## NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐OTHER: ☐

## SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☒  
CASING/CEMENT JOB ☐OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dear Sirs/Madams:

Please find the worked performed in the plug and abandonment of this well from 4/25/09 through 4/29/09.

MIRU Plugging unit &amp; surface equipment, NU BOP.

RIH w/ 4.65 GR &amp; JB TO 6240'. TIH &amp; set CIBP @ 6240'. (OCD Representative okayed setting depth for CIBP). PU 2 3/8" workstring to 6240' &amp; circu plug mud. Spot 25 sxs on plug. PU to 5508' &amp; spot 25 sx plug. PU to 4200' &amp; spot 40 SX plug. PU the hole w/ 60 JTS.

TIH w/tbg &amp; tag plug @ 4006'. PU &amp; spot 35 sx plug @ 2679'. TOO. TIH w/wire line &amp; perf @ 1695'. Could not establish injection rate. OCD Representative okayed 50 sx spot @ 1752'. WOC &amp; tag plug @ 1575'. TOO. TIH &amp; perf @ 325'. Break circu. ND BOP &amp; NUWH. Circu 225 sxs of cmt down the 5 1/2" csg &amp; up the 8 5/8" annulus to surface. RDMO.

Well P&amp;A'd on 4/29/2009. Prepare location to restore surface.


Approved for plugging of well bore only.  
Liability under bond is retained pending receipt  
of C-103 (Subsequent Report of Well Plugging)  
which may be found at OCD Web Page under  
Forms, www.emnrd.state.nm.us/oed.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

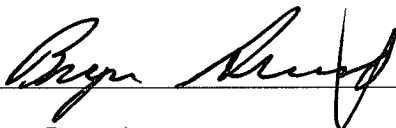

TITLE Senior Regulatory Compl. Spec

DATE 05/04/2009


Type or print name Bryan Arrant

E-mail address: bryan.arrant@chk.com

PHONE: (405)935-3782

For State Use Only

APPROVED BY:



TITLE DISTRICT 1 SUPERVISOR

DATE

MAY 11 2009

Conditions of Approval (if any):