

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised March 25, 1999

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Santa Fe, NM 87505

OIL CONSERVATION DIVISION

DEC 23 2003 P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-02133

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
8015

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐
Convert from Injector to Producer.

2. Name of Operator
Mobil Producing TX & NM, Inc.

3. Address of Operator P. O. Box 4358
Houston TX 77210-4358

7. Lease Name or Unit Agreement Name
Bridges State

8. Well No.
52

9. Pool name or Wildcat
Vacuum; Grayburg-San Andres

4. Well Location
Unit Letter _____ Feet From The North _____ Line and _____ Feet From The East _____ Line
Section 27 Township 17S Range 34E NMPH Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
4640 DR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐

OTHER: Convert Injector to Producer. ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion)

01/24/03 - 01/27/03 - MIRU. Bled tbg down. NU BOP.
01/28/03 - RIH w/gun. Shot 4 holes in tubing. POOH w/gun. RD Wireline.
01/29/03 - POOH w/production tubing. RIH w/work string & 6-3/4" bit.
01/30/03 - RIH & tagged bottom @ 4236'. Begin power swivel & drill out to 4636'.
01/31/03 - 02/05/03 - Hole kept caving back in. Continue drilling and cleaning out back to 4632'.
02/06/03 - 02/07/03 - RU acid truck & acidize OH w/10,000 +/- gals. acid.
02/08/03 - Flow back well to tank and clean up well.
02/10/03 - Swab well.
02/11/03 - 02/12/03 - RIH w/production tbg, pump & TAC. Flange well up. Clean location.

Unsuccessful workover. Well is shut-in.

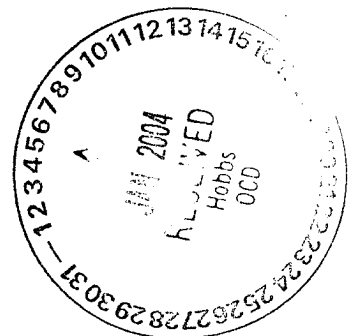

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Linda Koch TITLE Contract Completion Admin. DATE 12/19/2003

TYPE OR PRINT NAME Linda G. Koch TELEPHONE NO. (713) 431-1287

(This space for State Use)

APPROVED BY Paul J. Harty TITLE PETROLEUM ENGINEER DATE JAN 13 2004

CONDITIONS OF APPROVAL IF ANY: