

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.
30-025-30063

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
B-5943

7. Lease Name or Unit Agreement Name:

Monstate

8. Well No.
6

9. Pool name or Wildcat
Eumont, Yates, 7-Rvrs, Queen

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other

2. Name of Operator
Chevron USA Inc

3. Address of Operator
15 Smith Rd, Midland, TX, 79705

4. Well Location

Unit Letter J : 1980 feet from the South line and 1750 feet from the East line

Section 13 Township 19-S Range 36-E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐


CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24 hrs prior to MI and RU.
2. RIH Tag CIBP at 3560, spot 25sx, plug 3560-3460 (Eumont, Yates, 7-Rvrs, Queen) WOC Tag.
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Spot 50sx, plug 1700-1400 (13 3/8 Shoe, T-Salt) WOC Tag.
5. Spot 45sx, plug 250-Surf (Surf) WOC Tag.
6. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

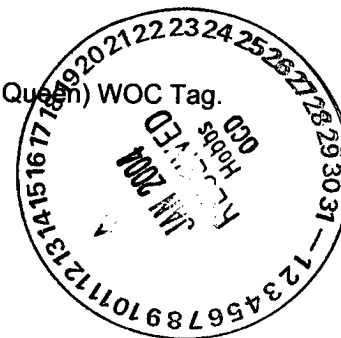

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G.R. Bledsoe TITLE HES Specialist DATE 1/12/2004

Type or print name G.R. Bledsoe Telephone No. (432) 687-7153
(This space for State use)

APPROVED BY Gary W. Wink ORIGINAL SIGNED BY GARY W. WINK FIELD REPRESENTATIVE II/STAFF MANAGER DATE JAN 14 2004
Conditions of approval, if any

PLUGGING & ABANDONMENT WORKSHEET

(3 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME MONSTATE

WELL # 6

SECT 13

TWN 19-S

RNG 36-E

FROM 1980

N/S 1750

EWL

TD 10,307

FORMATION @ TD WOLF CAMP

PBTD

FORMATION @ PBTDEumont 7 rves Q

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	13 3/8	1635	SURF	Circ
INTMED 1	4 5/8	4000	SURF	Circ
INTMED 2				
PROD	7	7196	SURF	Circ

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1	5"	6901	8600	6901	Circ
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	3610 - 3700
INTMED 2		
PROD	OPENHOLE	

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	1	CIBP	25	3560
YATES	2	13 3/8 S	50	1700
QUEEN	3	SURF	45	250
GRAYBURG				
SAN ANDRES				
CAPITAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				

CIBP @ 3560' w/ 35' CMT

MLF

13 3/8

@ 1635

TOC SURF

Eumont, Y, 7 rves, QUEEN

Eumont, Y, 7 rves, QUEEN

Grayburg SQZ'd

4 5/8

@ 4000

TOC SURF

CIBP @ 4175 w/ 35' CMT UPPER SLA

CIBP @ 5100 w/ 35' CMT LOWER SLA

CIBP @ 6725 w/ 35' CMT

Drinkard

7"

@ 7196

TOC SURF

CIBP @ 7250 w/ 35' CMT ABO

Liner 5"

@ 6901 - 8600

TOC 6901

WOLF CAMP

TD 10,307