

Submit 1 Copy To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W Grand Ave., Artesia, NM 88201  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S St Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
October 13, 2009

RECEIVED  
OCT 23 2009  
HOBBSOCD

CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. <b>30-025-10677</b> ✓
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name <b>Skelly Penrose B Unit</b> ✓
8. Well Number <b>59</b> ✓
9. OGRID Number <b>025078</b> ✓
10. Pool name or Wildcat <b>Langlie Mattix 7 Rvr Q-GB</b> ✓

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other **Injection Well** ✓

2. Name of Operator

**Whiting Oil and Gas Corporation** ✓

3. Address of Operator

**400 West Illinois, Suite 1300, Midland, Texas 79701**

4. Well Location

Unit Letter **P** : **330** feet from the **South** line and **330** feet from the **East** line  
Section **8** Township **23-S** Range **37-E** NMPM **Lea** County ✓

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ **PLUG AND ABANDON** ☒  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

**LOAD WELL W/M.L.F. 9.5# brine w/12.5# salt gel per bbl.**

MIRU Plugging Rig. ND WH. NU BOP. POH with 2 3/8" tbg and packer. Set CIBP at 3400' with 25 sks of Class C cmt on top from 3400 - 3159'. Pump 25 sks of Class C cmt from 2100 - 1859'. Perforate casing at 1200'. Squeeze with 25 sks of Class C cmt. WOC 2 hours and tag. Perforate casing at 300'. Squeeze with 50 sks of Class C cmt. WOC for 2 hours and tag cmt. ND BOP. Pump 10 sks of Class C cmt from 70' to surface. RDMO rig. **2550' - 2450'**  
**2 PERF. CIRC. CMT, in/out**  
Cut off wellhead & install marker, cut anchors, backfill cellar.

Tentative Date: 11-18-09 through 11-23-09

THE OIL CONSERVATION DIVISION MUST  
BE NOTIFIED 24 HOURS PRIOR TO THE  
BEGINNING OF PLUGGING OPERATIONS

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Daniel Baker TITLE Engineer DATE 10-14-09


Type or print name Daniel Baker E-mail address: daniel.baker@whiting.com PHONE: (432) 894-7142

For State Use Only

APPROVED BY: Maley Brown TITLE Compliance Officer DATE 10/27/2009

Conditions of Approval (if any)

LEASE NAME AND WELL NO.: PENROSE 'B' #59  
WELLBORE DIAGRAM AS OF (DATE): 1-9-74

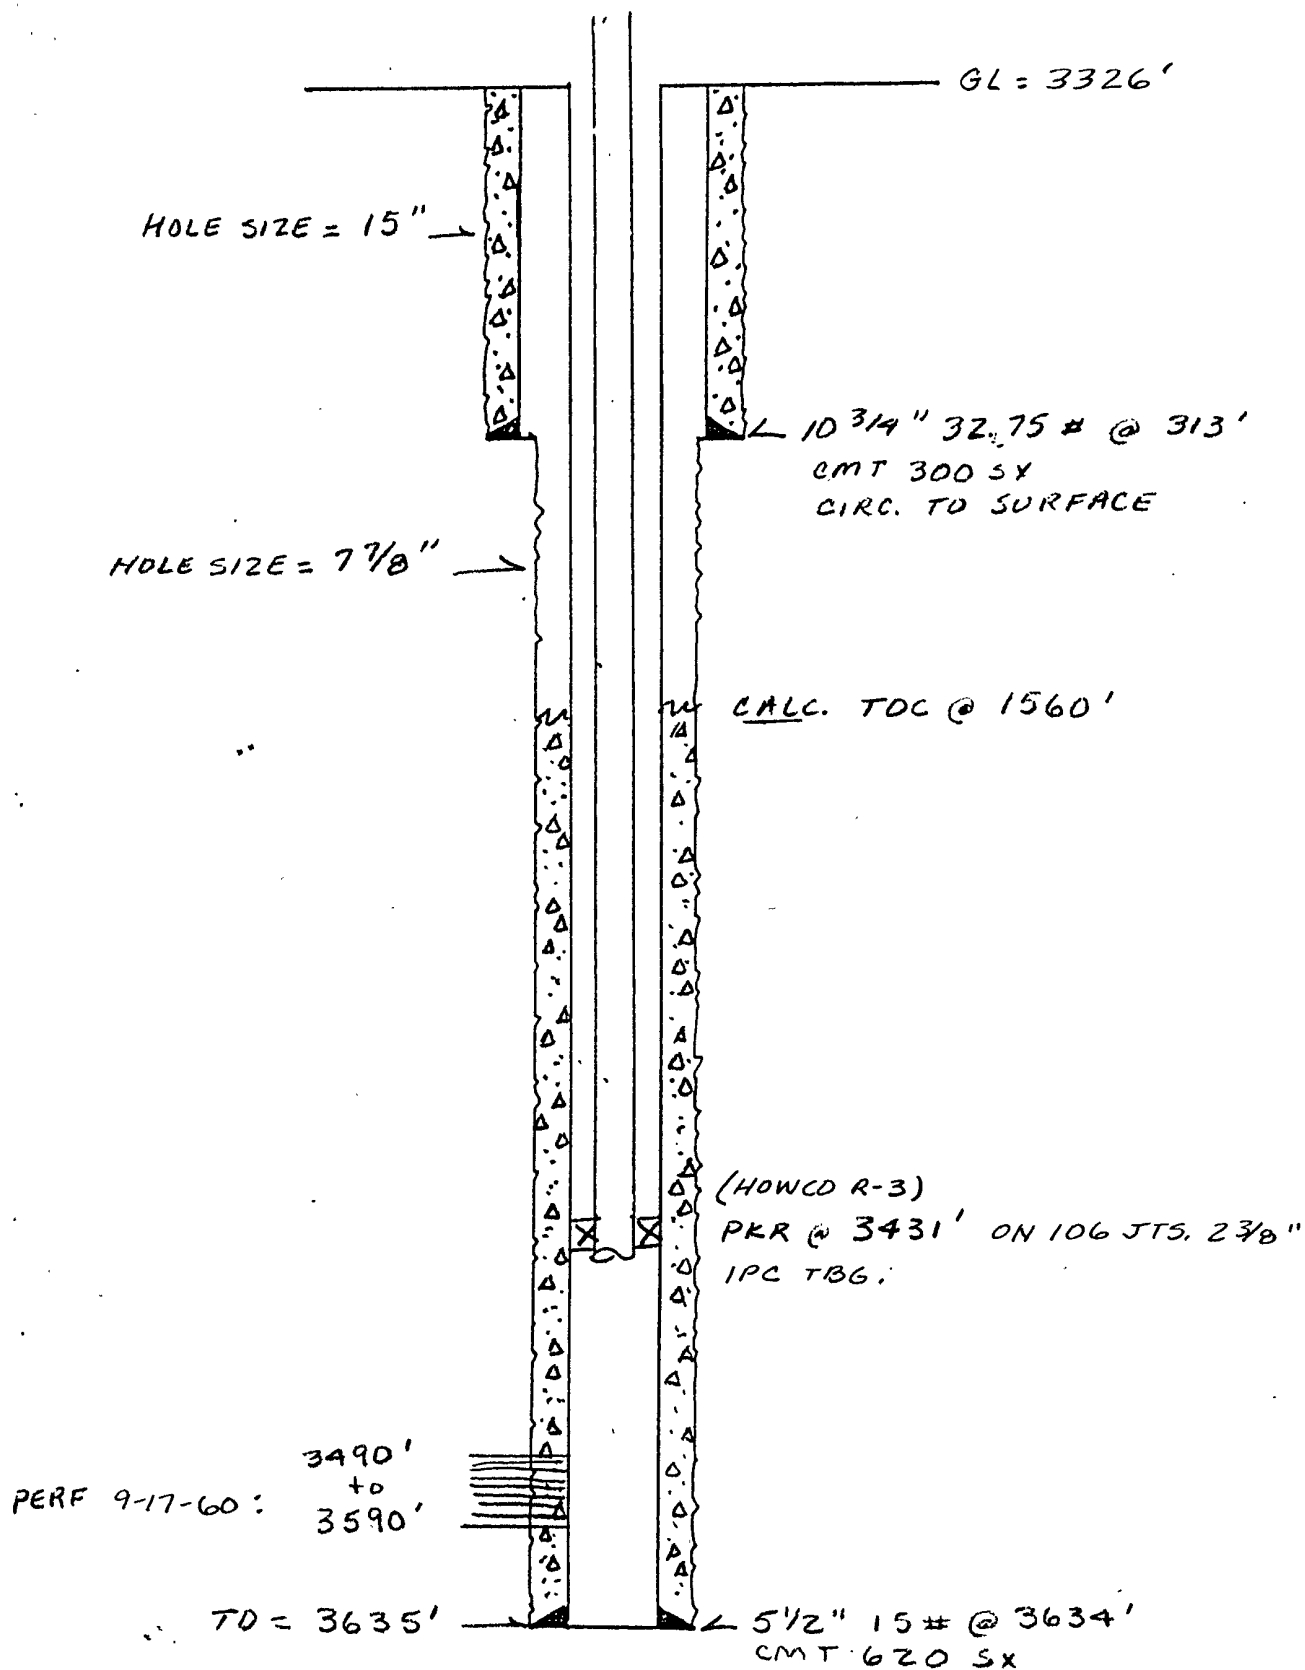

LEASE NAME AND WELL NO.: PENROSE "B" # 59 UNIT P  
STATE: AL COUNTY: SEA BLOCK: — SECTION: 0