

Submit 1 Copy To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM
87505**RECEIVED**

MAR 09 2010

HOBBSOCD

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

October 13, 2009

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-39377
1. Type of Well: Oil Well ☐ Gas Well ☒ Other		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator NADEL AND GUSSMAN PERMIAN, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 601 N. MARIENFELD, STE. 508 MIDLAND, TX 79701		7. Lease Name or Unit Agreement Name LANGLEY 21 COM
4. Well Location Unit Letter H : 1980 feet from the NORTH line and 800 feet from the EAST line Section 21 Township 23S Range 36E NMPM County LEA		8. Well Number 001
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 155615
10. Pool name or Wildcat WILDCAT, MORROW		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
 DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS. ☐ P AND A ☐
 CASING/CEMENT JOB ☐

OTHER: ☐OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1.) CIBP @ 5754'-35 SXS CLASS C CEMENT ON TOP-CIRCULATE PLUGGING MUD-TAG
- 2.) SPOT 25 SXS CLASS C CEMENT @ 3963' *Perf 5350 SQ 50SK cmt 95/8x 5 1/2 shoe*
- 3.) PULL STRETCH-CUT-PULL +/- 3000' CASING
- 4.) SPOT 35 SXS CLASS C CEMENT FROM 50' IN STUB TO 3070'-TAG *\$ Bos*
- 5.) SPOT 40 SXS CLASS C CEMENT @ 1300'-TAG *Perf 50 40SK cmt (13 3/8x 95/8) shoe*
- 6.) CIRCULATE 25 SXS CLASS C CEMENT FROM 60' TO SURFACE
- 7.) CUT OFF ANCHORS-INSTALL P&A MARKER *Spot 40SK cmt @ 450*

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Mark Hoskins

TITLE

AGENT

DATE 3-09-2010

Type or print name MARK HOSKINS

E-mail address:

PHONE:

For State Use Only

APPROVED BY:

Mark Hoskins


TITLE

Staff MGR

DATE

3-9-10

Conditions of Approval (if any):

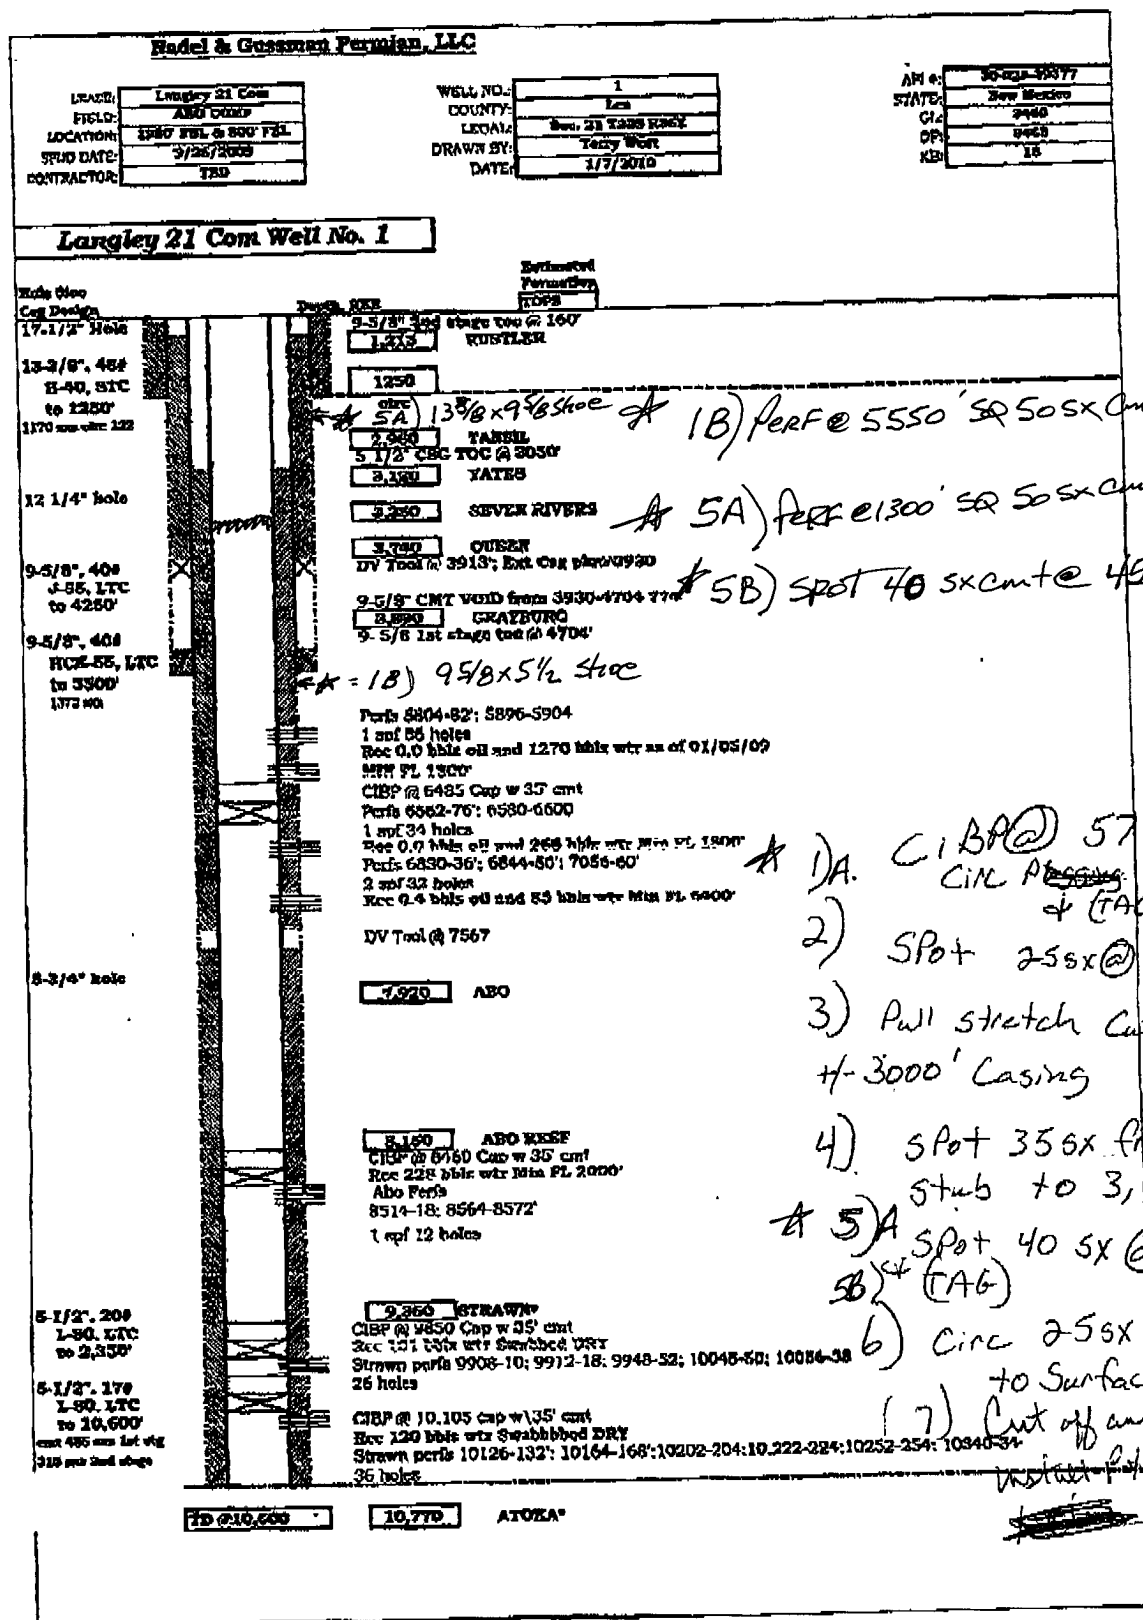

Free wtr @ 400'
TDS 1200'
BOS 3100'