
Submit 3 Copies To Appropriate District	State of New Me		Form C-103	
Office District I	Energy, Minerals and Natur	al Resources	May 27, 2004	
1625 N. French Dr., Hobbs, NM 87240	bbs, NM 87240		WELL API NO. 30-025-22560	
District II 1301 W Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION		5. Indicate Type of Lease	
District_III	ict III 1220 South St. Francis Dr.		STATE FEE X	
1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, NM 87505 District IV				
1220 S. St. Francis Dr., Santa Fe, NM 87505			6. State Oil & Gas Lease No.	
SUNDRY NOTICES AND REPORTS ON WELLS			7. Lease Name or Unit Agreement Name:	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			E.C. Hill C	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		V		
1. Type of Well:		8. Well Number		
Oil Well X Gas Well	Other		2	
2. Name of Operator			9. OGRID Number	
OXY USA Inc.			16696 ✓ 10. Pool name or Wildcat ✓	
3. Address of Operator P.O. Box 50250 Midland, TX	79710-0250		Teague Paddock-Blinebry	
4. Well Location				
I Init Latter	2310 feet from the SOU	th line and	330 feet from the west line	
Oint Letter		inic and	1	
Section 27 Township 23S Range 37E NMPM County Lea 🗸				
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3296' GR				
Pit or Below-grade Tank Application or Closure				
Pit type Depth to Groundwater Distance from nearest fresh water well Distance from nearest surface water				
Pit Liner Thickness: mil Below-Grade Tank: Volumebbls; Construction Material				
	t and the state of	NT (CNT (Devent an Other Data	
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data				
1101102 01 11112111011			SEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	PLUG AND ABANDON 🔲	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILL	ING OPNS. PLUG AND	
PULL OR ALTER CASING	MULTIPLE	CASING TEST AND	ABANDONMENT	
TOLE OF ALTER ONOMA	COMPLETION	CEMENT JOB		
OTHER:		OTHER: Set CIBP	- Run CIT - TA Status	
	operations (Clearly state all ne			
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion				
or recompletion. This Λ_{-}				
Aband Approval				
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 2/24/10 MIRU, POOH W/ RODS & PUMP. NDWH NUBOP 2/25/10 POOH W/ TBG. RIH W/ 7" GAUGE RING TO 5383', POOH. RIH W/ 7" CIBP & SET @ 5383', POOH 2/26/10 RIH & TAG CIBP @ 5383', CIRC WELL W/ 2% KCL PRESSURE TEST CASING TO 650# FOR 30 MIN, TESTED GOOD POOH, NDBOP, NUWH, RDMO				
RIH W/ 7" CIBP & SET @ 5383', POOH				
	2/26/10 RIH & TAG CIBP @ 5383', CIRC WELL W/ 2% KCL			
PRESSURE TEST CASING TO 650# FOR 30 MIN, TESTED GOOD				
POOH, NDBOP, NUWH, RDMO				
3/11/10 NOTIFIED NMOCD, RUN CIT, TEST TO 540#, WITNESSED BY MARK WHITAKER-NMOCD				
I hereby certify that the information al	pove is true and complete to the	best of my knowledg	e and belief. I further certify that any pit or below-	
grade tank has been/will be constructed or c	losed according to NMOCD guideline		or an (attached) alternative OCD-approved plan	
SIGNATURE			atory Analyst DATE 3(18(10	
TD Character	E-1	mail address:	david_stewart@oxy.com	
Type or print name David Stewart Telephone No. 432-685-5717				
For State Use Only	2 /	_	_ /	
APPROVED BY	TI	TLE STAFF	MG2 DATE 3-24-10	
Conditions of Approval, if any.	/			

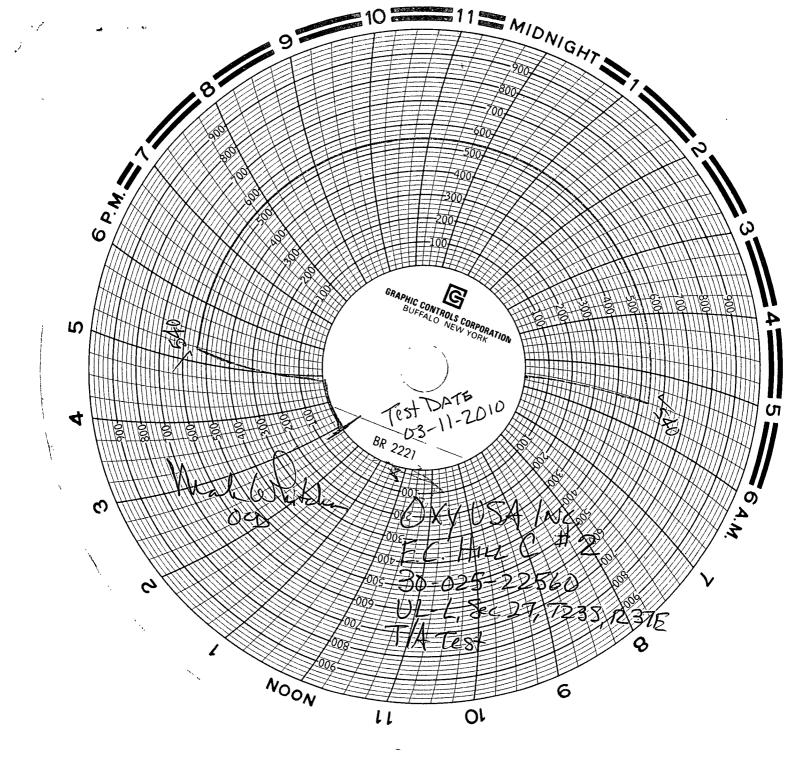

Pate Tok \$67Tok Jum Burns

1

٠

.