

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM

87505

RECEIVED
OCT 28 2010
HOBBSOCD

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.

30-025-02943

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

CENTRAL VACUUM UNIT

8. Well Number 18

9. OGRID Number 4323

10. Pool name or Wildcat

VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

CHEVRON U.S.A. INC.

3. Address of Operator

15 SMITH ROAD, MIDLAND, TEXAS 79705

4. Well Location

Unit Letter J: 1980 feet from the SOUTH line and 1980 feet from the EAST line

Section 30 Township 17-S Range 35-E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER:

OTHER: REPAIR CASING, CLEAN OUT

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

6-22-10: MIRU. 6-23-10: SET RBP @ 3923. SET PKR @ 3891. TEST CSG 3891-3923. NO HOLD. SET PKR @ 3891. SET RBP @ 1579. 6-24-10: SET PKR @ 1548. SET 3RD RBP @ 509. TEST CSG FROM 509-SURF. GOOD. DROP 2 50# SKS SAND ON RBP. 8-15-10: REL RBP. RUN TBG TO 1555'. SET PKR. REL PKR. REL RBP. 8-16-10: ISOLATE CSG LEAK FR 2352-2385. REL PKR. TIH W/TBG TO 3923. LATCH PLUG & REL. TIH W/TBG TO 4020.

8-17-10: MIRU. C/O 4656-4702. SULFATE SCALE. TIH W/RBP & SET @ 1679. PULL UP TO 1580. DROP 6 100# SX ON RBP. 8-18-10: TAG SAND @ 1654. PULL UP TO 1612. PERF. SHOOT 4 HOLES IN 7" CSG @ 1545. SET PKR @ 1491. REL. PU 7" CR & SET @ 1489. 8-19-10: PMP 59 BBLS 250 SX CL NEAT CMT & CIRC TO SURF. REV CIRC W/27 BBLS FW. 8-20-10: TAG TOC @ 1460. DRILL OUT 29' CMT ABOVE CMT RT. DRILL OUT CMT RT @ 1489. DRILL OUT 16' CMT BELOW CMT RT TO 1505. SQZ HOLES @ 1545. EOT @ 1471. 8-21-10: FELL OUT OF CMT @ 1546. FELL OUT OF CMT STRINGERS @ 1555. SET PKR @ 1491. 8-22-10: REL PKR. TAG SAND @ 1654. WASH SAND OFF RBP. SET NEW RBP @ 1587. SET PKR @ 1524. REL. REL RBP @ 1587. MOVE RBP TO 2521. PKR @ 2481. PULL PKR TO 2417. DROP 6-100# SX SAND ON RBP. 8-23-10: PULL PKR TO 2389 & SET. PULL TO 2379, 2369, 2389. REL PKR. TIH TO 2345. 8-24-10: SPOT 50 SX CMT ACR 2441-2055. TIH W/PKR TO 1898. SQZ CMT INTO FORMATION.


8-25-10: REL PKR. RUN TBG TO 2086. TAG UP. DRILL CMT 2086-2417. FELL THRU TO 2487. PRESS CSG TO 310#. CHART & LOST 40# IN 30 MINS. 8-26-10: SET PKR @ 1591. REL PKR. CIRC SAND OFF RBP. REL RBP. TIH W/TBG TO 4698. SPOT 850 GALS X-25 ACR OPEN HOLE. 8-27-10: SET PKR @ 4065. 8-28-10: ACIDIZED 4124-4702 W/8000 GALS 15% HCL. REL PKR. 8-29-10: TIH W/TBG 4618. RUN DN TO 4702. TIH W/TBG, PKR TO 4068. SCALE SQXZ W/30 BBLS PAD, 220 GALS SCW358 & 20 GALS X-105. 8-30-10: REL PKR. 8-31-10: TIH W/2 7/8" TBG TO 2500. 9-01-10: TIH W/SUB PUMP & TBG.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

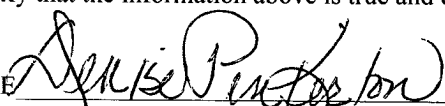

TITLE REGULATORY SPECIALIST

DATE 09-10-2010

Type or print name

DENISE PINKERTON

E-mail address: leakejd@chevron.com

PHONE: 432-687-7375

PETROLEUM ENGINEER

NOV 01 2010

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____
Conditions of Approval (if any): _____